



## Punjab Municipal Development Fund Company

Hiring of Consulting Services for Preparation of Integrated Development and Asset Management Plan (IDAMP) for 16 selected MCs In Punjab under Punjab Cities Program (PCP)

IDAMP – Municipal Committee Vehari  
May 2024



## Table of Contents

<b>Section 1. Introduction</b> .....	<b>5</b>
<b>Section 2. Overview – Municipal Committee Vehari</b> .....	<b>12</b>
<b>Section 3. Existing Asset Inventory Analysis</b> .....	<b>15</b>
<b>Section 4. Level of Services (LOS)</b> .....	<b>20</b>
<b>Section 5. IDAMP Projects, Operations &amp; Maintenance(O&amp;M) Strategy</b> .....	<b>29</b>
<b>Section 6. Financial and Economic Analysis</b> .....	<b>46</b>
<b>Annexure</b> .....	<b>49</b>

## List of Tables

Table 1: Asset Summary .....	15
Table 2: Condition of Existing Assets .....	17
Table 3: Current & Target LOS .....	20
Table 4: IDAMP Projects .....	29
Table 5: Project Detail .....	32
Table 6: Financial Projections .....	48

# 01 Introduction

---

## Section 1. Introduction

### 1.1. Context

Punjab's urban metropolises are growing at an alarming rate thereby accelerating the demand at the municipal service levels. The gap between supply and demand in terms of quality of services at the municipal level rings a bell at the corridors of stakeholders both at government and local levels. Accordingly, the study seeks to identify viable business solutions for effective service deliveries. In particular, this report investigates the conditions of assets, both moveable and immovable, at the MC level to elucidate the foundation for the development of IDAMP.

Infrastructure plays a pivotal role in achievement of service delivery objectives of public sector entities. Without long term planning and optimal management of infrastructure, risk of failure to meet the service delivery program increases significantly. Thus, infrastructure management is a critical concern for the sustainability of public sector entities.

Keeping in view the importance of infrastructure, an IDAMP Framework has been developed which spells out the principles for effective development and management of asset portfolio in order to achieve service delivery objectives, prescribes a consistent approach and a common methodology for development and management of assets and provides guidelines to ensure informed decision making by Municipal Committees for investment in and management of those assets which help the achievement of the service delivery objectives.

### 1.2. Scope

This document has been prepared for Integrated Development and Asset Management Planning of Municipal Committee (MC) Vehari. Thus, this document is confined to the planning and management of assets of MC Vehari.

### 1.3. Brief Methodology for IDAMP Development

The methodology employed for the preparation of the Integrated Development and Asset Management Plan (IDAMP) involved several key steps, which are summarized as follows:

### 1. Development of Asset Inventory Database

The first step in the IDAMP methodology was to develop a comprehensive asset inventory by PMDFC. This included identifying different asset categories and collecting relevant attribute data. Further, data available at PMDFC and MCs was thoroughly reviewed to ensure accurate and synchronized documentation. This involved cross-referencing and aligning the available data with the requirements of the project. This served as a fundamental basis for integrated asset management.

### 2. Asset Condition Analysis

It was imperative to have a clear picture of the physical condition of assets and current level of service. Decisions regarding maintenance, rehabilitation and renewal revolved around these two aspects. Asset physical condition analysis was used to determine the need and timing of some preventative or corrective maintenance to ensure desired Level of Service and prevent service breakdown. Below is given the different categories of condition together with reasons/actions for the applicable condition:

Category	Asset Condition	Actions Required
<b>A</b>	Excellent	Routine Maintenance
<b>B</b>	Good	Minor Repair
<b>C</b>	Fair	Major Repair
<b>D</b>	Poor	Rehabilitation
<b>E</b>	Failing	Replacement

### 3. Current and Target Level of Services (LOS)

To ensure optimal service delivery, an analysis of asset divergence was conducted to assess the alignment between the existing asset inventory and the desired level of service (LOS). This step involved identifying the current level of services, setting target LOS, evaluating the service delivery gap, assessing asset condition assessment, and planning for necessary asset improvements accordingly.

Gap analysis reports and energy audit reports (where available) were reviewed to identify and define the existing infrastructure assets. These reports provided insights into the gaps and deficiencies in the current infrastructure and helped in formulating appropriate strategies for improvement. Further, sectoral plans for infrastructure investments were carefully reviewed to ensure synchronization with the target level of service.

Additionally, community consultative sessions were conducted to gather valuable insights into the needs and desires of the local community. Furthermore, it was made a priority to consult with the management and staff of the respective MCs during our field visits. Please refer **Annexure F** for details.

#### 4. Identification of Projects

Once the inventory and performance targets were updated, project proposals were developed to bridge the service delivery gap. Project were identified based on asset types, for rehabilitation/replacement of existing assets or the creation of new assets. The project proposals encompassed project identification, preparation, and appraisal, ensuring that steps were taken to achieve the target LOS.

Preliminary estimates for capital expenditure and Operating and Maintenance (O&M) costs of identified projects were made. Considering the project scope, capital cost of the projects incorporated both the initial one-off costs such as engineering cost, project construction cost, development cost, procurement cost of equipment, machinery & other assets, utility set up cost, and any other costs to be incurred during the construction period. O&M cost to be incurred during operational phases of the project, which included preventive maintenance cost, electricity and other utility cost, administrative expenses, payroll cost and other overheads etc.

Following matrix is used for the computation of O&M costs:

Sr.	Sectors/ Projects	Annual O&M Cost (%age of Capital Cost)
1	Water Supply	5%
2	Filtration Plants	10%
3	GST (Ground Storage Tank) /OHR	2.50%
4	Sewerage Network	2.50%
5	Roads	5%
6	Street Lights	2.50%
7	Parks, Playgrounds, Open Spaces	2.50%
8	Buildings	0.5%
9	Bus stand	2.50%
10	Slaughterhouse	2.50%

Sr.	Sectors/ Projects	Annual O&M Cost (%age of Capital Cost)
11	Storm water drainage;	1%
12	Municipal libraries;	0.5%
13	Solarization	0.5%

## 5. Financial Capacity Analysis

Analyzing potential financial sources was a crucial step to finance capital investments. This involved examining local capital revenues, planned operating surplus, provincial government transfers, and donor grants as potential funding sources. This analysis provided insights into the available financial capacity to support selected projects, guiding decision-making regarding project selection and phasing.

## 6. Project Screening & Phasing

Projects were screened and phased over a three-year period based on specific criteria. Projects were evaluated against each of the following factors and assigned scores:

- Project purpose and service delivery improvement
- Public Response/Community and citizens feedback
- Environment and Social Impacts
- Socio-economic impacts analysis
- Ease of implementation

Relative scoring criteria was used for the phasing, wherein projects achieving the highest scores are prioritized in the first year, subject to the availability of finances. Similarly, the scores are reviewed to determine the phasing of projects in the second and third years. This approach ensures the prioritized implementation of projects based on their relative merits.

### 1.4. Technical Inputs, Assumptions and Limitations



- The initial information of existing assets was obtained from PMDFC and MC Vehari. The data was obtained from multiple sources including Asset Management Information System. Additionally, energy audit reports, shape files, and gap analysis reports were also used to supplement the initial information.
- Asset inventory forms were designed to compile the asset attribute and condition information in consultation with the PMDFC management. The baseline data used for carrying out the condition assessment of assets was sourced from various reports provided by the PMDFC and MC Vehari. It primarily consisted of information related to the existing assets, including their names, numbers, residual life, technical specifications and other attributes of assets.
- Site surveys were also conducted to verify the information and collect any missing information. The compiled information was then shared with the MC Vehari management for their verification and endorsement.
- Age was the primary factor considered for assessing the condition of the water and sewerage network.
- The determination of the current and target level of service has been formulated through a consultative process involving relevant MC staff, and the analysis of data obtained from energy audit reports and gap analysis reports. For the computation of current level of service, following sources were consulted:
  - Served and built-up areas for different sectors were calculated from the relevant sectors' maps;
  - Total population of MC was taken from the census report of Pakistan Bureau of Statistics (PBS) while applying population growth rates for the incremental period;
  - Daily water supplied to the distribution system was calculated on the basis of capacity of tubewell and average daily operational hours of tubewell;
  - Non revenue water was computed by considering actual revenue collected by MC and total connections in the served area;
  - Total number of pipe leakages of the water distribution network was computed on the basis of number of complaints received by MC. It was assumed that one complaint represented one pipe leakage;
  - Total number of sewerage blockages was computed on the basis of number of complaints received by MC. It was assumed that one complaint represented one sewerage blockage; and
  - The total annual operating expenses for each sector were determined based on the expenditure report provided by the MC staff, which covered nine (9) months' worth of data. To obtain the annual operating expenses, an extrapolation method was used to estimate the remaining three (3) months' expenditures.

- Target level of services were determined considering the findings from condition assessment, findings of energy audit reports, findings from gap analysis reports, consultative sessions with MC management and community.
- PMDFC has actively engaged in community consultative sessions to gather valuable insights into the needs and desires of the local community. Furthermore, we have made it a priority to consult with the management and staff of the respective Municipal Committees (MCs) during our field visits. This collaborative approach has allowed us to gain valuable perspectives from those directly involved in the day-to-day operations of the MCs and the feedback and insights gathered from these consultative sessions, both with the community and MC stakeholders, have been carefully analyzed and incorporated into the IDAMPs of the respective MCs.
- Projects (repair/ rehabilitation/ new creation) were identified in consultation with the respective Asset Managers keeping in view the service delivery gaps.
- Rrough cost estimates (Capital and Operational & Maintenance) was performed on the basis of Market Rating System (MRS) and Non MRS rates of items.
- Identified projects were evaluated on the basis of project screening and phasing criteria prescribed in the IDAMP Framework.
- The cost and book values of the MC assets have been provided by PMDFC staff.

# 02 Overview – Municipal Committee Vehari

---

## **Section 2. Overview – Municipal Committee Vehari**

### **2.1. Introduction**

Vehari District is a district in the Punjab province of Pakistan - the city of Vehari is the capital of the district.[1] The district was created in 1976 out of the three tehsils of Multan District (Vehari, Burewala and Mailsi). The name Vehari means low lying settlement by a flood water channel. The district lies along the right bank of the river Sutlej which forms its southern boundary. Vehari District is the result of construction of the Pakpattan canal from Sulemanki Head Works on the Sutlej and the institution of Nili Bar colony project in 1925, so called because of the hints of blue in the water of the Sutlej.<sup>1</sup>

### **2.2. Functions of Municipal Committee Vehari**

Section 31(p) of the Local Government Act, 2022, the Municipal Committees to provide, manage, operate, maintain and improve municipal infrastructure and services, including:

- water supply and control and development of water sources
- sewage and sewage treatment and disposal
- storm water drainage
- sanitation and solid waste collection and disposal of solid wastes, treatment and disposal including landfill site and recycling plants
- roads and streets
- public transport and mass transit systems, construction of express ways, flyovers, bridges, roads, under passes, traffic planning, engineering and management including traffic signaling systems, signs on roads, street markings
- firefighting
- street lighting
- parks, playgrounds, open spaces
- parking stands

---

<sup>1</sup> <https://mcvehari.lgpunjab.org.pk/about-us/history/>

- graveyards
- arboriculture/ tree afforestation;
- parking places;
- transport stations, stops, stands and terminals;
- slaughterhouses;
- municipal libraries;
- community and cultural centers;
- land use planning;
- building control; and
- environmental protection

# 03 Existing Asset Inventory Analysis

---

## Section 3. Existing Asset Inventory Analysis

Over the years, MC Vehari has accumulated a large inventory of assets through development schemes and direct procurements. However, a centralized record of assets had not been maintained due to absence of a proper asset management system. Furthermore, as the development work used to be carried out through 'schemes', the asset generated through schemes could not be identified and classified into appropriate asset categories.

### 3.1. Existing Assets Summary

The summary of existing assets of MC Vehari based on its' functions is presented below:

**Table 1: Asset Summary**

Sr No.	Asset Category	Asset Sub-Category	Unit	Total
1	Water Supply System	Tube wells	No.	23
		Water Supply Network	Meter	178867
		OHR	No.	7
		GST	No.	10
		Filtration Plants	No.	18
		Intermediate Pumping Station	No.	8
		Movable Assets (Vehicles/Machinery)	No.	1
2	Sewerage System	Sewerage Network	Meter	149497
		Disposal Stations	No.	8
		Movable Assets (Vehicles/Machinery)	No.	82
4	Recreational	Park	No.	27
5	SWM Resource	Dumping site	No.	1
		Movable Assets (Vehicles/Machinery)	No.	442
6	Bus Stands	Bus Stand	No.	1
7	Buildings	Residential Building	No.	12

Sr No.	Asset Category	Asset Sub-Category	Unit	Total
		Offices	No.	1
		Other Bulidings	No.	14
8	Public Places	Slaughter Houses	No.	1
		Others	No.	2
9	Shops	Shops	No.	977
10	Land	Open Plots	No.	2
11	Office Vehicles	Office Vehicles	No.	11
12	Street Lights	Street Lights	No.	2732
13	Roads	Roads	Km	23.8

The detail of the assets is provided in **Annexure A**.



### 3.2. Condition of Existing Assets

The condition of assets of MC is presented below:

**Table 2: Condition of Existing Assets**

Asset Category	Asset Sub-Category	Asset Condition					Unit	Total
		Excellent (A)	Good (B)	Fair (C)	Poor (D)	Failing (E)		
Water Supply System	Tube wells	-	5	2	7	9	No.	23
	Water Supply Network	-	178867	-	-	-	Meter	178867
	OHR	-	1	3	3	-	No.	7
	GST	-	4	6	-	-	No.	10
	Filtration Plants	-	13	4	1	-	No.	18
	Intermediate Pumping Station	-	-	8	-	-	No.	8
	Movable Assets (Vehicles/Machinery)	-	-	-	1	-	No.	1
Sewerage System	Sewerage Network	11369	20612	13532	-	103984	Meter	149497
	Disposal Stations	-	1	2	5	-	No.	8
	Movable Assets (Vehicles/Machinery)	-	6	76	-	-	No.	82
Recreational	Park	-	3	9	10	5	No.	27
SWM Resource	Dumping site	-	-	-	1	-	No.	1
	Movable Assets (Vehicles/Machinery)	424	8	5	5	-	No.	442
Bus Stands	Bus Stand	-	-	1	-	-	No.	1
Buildings	Residential Building	-	-	12	-	-	No.	12
	Offices	-	1	-	-	-	No.	1
	Other Buildings	-	-	14	-	-	No.	14
Public Places	Slaughter Houses	-	-	1	-	-	No.	1

Asset Category	Asset Sub-Category	Asset Condition					Unit	Total
		Excellent (A)	Good (B)	Fair (C)	Poor (D)	Failing (E)		
	Others	-	1	1	-	-	No.	2
Shops	Shops	-	977		-	-	No.	977
Land	Open Plots	-	-	2	-	-	No.	2
Office Vehicles	Office Vehicles	-	-	6	5	-	No.	11
Street Lights	Street Lights	1501	-	-	-	1231	No.	2732
Roads	Roads	-	-	1	22.8	-	Km	23.8

# 04 Level of Services (LOS)

---

## Section 4. Level of Services (LOS)

Assets are planned and managed for the service delivery to the consumers. Therefore it is pertinent to assess the current service level and set out the desired service level over a certain period by keeping in view the community needs and demands. In order to measure the service levels, indicators are designed on which periodic assessments of the level of service are carried out.

A set of Level of Service (LOS) indicators has been prescribed for the MCs for achievement of the service delivery objectives. The MCs shall compute their existing LOS and set the target LOS for the next three years. Target LOS shall be used as key performance indicators to assess the performance of assets and monitor the extent of service delivery by the MCs.

The Current and Target level of service for MC Vehari are provided here under:

**Table 3: Current & Target LOS**

Functions of MCs (municipal services)	Level of Service Indicators	Description	Current LOS	Target LOS for three years	Project Name	Timeframe (FY)
Water supply and control and development of water sources;	Water Supply Coverage %	Percentage of area, where water supply network is available in comparison to total built up area.	58%	70%	Improvement & Rehabilitation of Water Supply system in Vehari City	2023-2024
	Water Supply Coverage by private wells %	Percentage of area, where residents have own water sources.	42%	30%		
	Water production GPCD	Total daily water supplied to the distribution system (ex-treatment plant and including purchased water, if any) expressed by population served per day.	9	20.0		
	Non-revenue water %	Difference between total water produced (ex -treatment plant) and total water sold expressed as a percentage of total water produced.	96%	96%		
	Unit operational cost - water sold (production cost at consumer end) (PKR)	Total annual operating expenses divided by the total annual volume of water sold.	0.02	0.02		

Functions of MCs (municipal services)	Level of Service Indicators	Description	Current LOS	Target LOS for three years	Project Name	Timeframe (FY)
	Water supply staff per 1000 water connections (Number)	Total number of water supply staff expressed as per thousand water connections.	5.9	5.9		
	Salary cost as proportion of Operating costs	Total annual salary costs (including salaries, wages, pensions, other benefits, etc.) Expressed as a percentage of total annual operating costs.	50%	50%		
	Power and Electricity Costs as proportion of Operating Costs	Total annual power/electricity costs of the utility expressed as a percentage of total annual operating costs.	34%	29%	Solarization of Tubewells and Water Supply System	2023-2024
	Unfit water samples % (not conforming with the requirements of NEQ)	Total number of unfit water samples (not conforming with the requirements of NEQ) expressed as a percentage of total samples taken	N/A	N/A		
	Continuity of Service Hrs. / Day	Average hours of service per day for water supply. (Average operational hours of tube well per day)	8	8		
	Operational cost coverage (Ratio)	Total annual operational revenues/Total annual operating cost.	1%	1.15%	Solarization of Tubewells and Water Supply System	2023-2024
Sewage and sewage treatment and disposal;	Sewerage Coverage %	Population with sewerage services (direct service connection) as a percentage of the total population. (Total served area as a percentage of the total built up area)	43%	68%	Improvement of Existing Sewerage System and Disposal Stations for Vehari City	2023-2026
	Risk of crown failure	Whether there is an indication of crown failure?	Yes	No		

Functions of MCs (municipal services)	Level of Service Indicators	Description	Current LOS	Target LOS for three years	Project Name	Timeframe (FY)
	Sewerage blockages (Blockages/KM)	Total number of blockages/ complaints per year expressed per km of sewers	14	7.07		
	Sewerage staff per 1000 sewerage connections (Number)	Total number of sewerage staff expressed as per thousand sewerage connections	5.30	5.30		
	Wastewater Treatment – Primary (%)	Proportion of collected sewage that receives primary treatment only, i.e., involving settlement with the intention of removing solids, but not biological treatment. Both lagoon and mechanical treatment can be included, where appropriate.	0%	100%	Improvement of Existing Sewerage System and Disposal Stations for Vehari City	2023-2026
	Wastewater Treatment – Secondary (%)	Proportion of collected sewage that receives at least secondary treatment, i.e., removing oxygen demand as well as solids, normally biological. Both lagoon and mechanical treatment can be included, where appropriate.	0%	100%		
	Sewerage Complaints (%)	Total number of sewerage complaints per year expressed as a percentage of the total number of sewerage connections.	2%	1%		
Storm water drainage;	Storm water drainage coverage (%)	The percentage of MC area that the drainage system protects from flooding.	43%	68%		
Sanitation and <b>solid waste collection and disposal of solid wastes</b> , treatment and disposal including landfill site and recycling plants;	Collection efficiency (%)	Total amount of solid waste collected expressed as a percentage of total solid waste produced.	58%	58%		
	Disposal efficiency (%)	Total amount of solid waste disposed off expressed as a percentage of total solid waste collected.	100%	100%		

Functions of MCs (municipal services)	Level of Service Indicators	Description	Current LOS	Target LOS for three years	Project Name	Timeframe (FY)
	Door-to-door	Percentage of area with door-to-door solid waste collection.	0%	0%		
	Primary SWM Coverage each day in localities	Percentage of area from which the sanitary staff sweeps & collects waste each day	58%	58%		
	Primary SWM Coverage each day in Roads	Primary SWM Coverage each day in Roads	58%	58%		
	Open Collection Points	Open Collection Points	7	7		
	Secondary collection machinery	Secondary collection machinery	12	12		
	Adequacy of parking facilities for SWM vehicles	Adequacy of parking facilities for SWM vehicles	Yes	Yes		
	Waste transported in covered vehicles	Waste transported in covered vehicles	No	No		
	Private Sector involved in Secondary Collection	Private Sector involved in Secondary Collection	No	No		
	Sufficiency of existing dumping area (Landfill site).	Sufficiency of existing dumping area (Landfill site).	Yes	Yes		
	Mechanism for Final Disposal	Is there any mechanism for Final Disposal?	No (Land fill Site)	No (Land fill Site)		
Roads and streets;	Roads with condition "A" (Excellent) %	Roads with condition "A" expressed as a percentage of length of roads.	0%	0%	Improvement and Rehabilitation of Roads in MC Vehari.	2023-2024
	Roads with condition "B" (Good) %	Roads with condition "B" expressed as a percentage of length of roads.	0%	50%		
	Roads with condition "C" (Fair) %	Roads with condition "C" expressed as a percentage of length of roads.	4%	4%		
	Roads with condition "D" (Poor) %	Roads with condition "D" expressed as a percentage of length of roads.	96%	46%		
	Roads with condition "E" (Failing) %	Roads with condition "E" expressed as a percentage of length of roads.	0%	0%		

Functions of MCs (municipal services)	Level of Service Indicators	Description	Current LOS	Target LOS for three years	Project Name	Timeframe (FY)
Streetlighting;	Streetlight coverage. (%)	Percentage of area/roads with streetlights.	15.1%	15.1%		
	Working Streetlight %	Percentage of working streetlights as of total streetlights.	55%	100%	Replacement of LED lights in Vehari City	2025-2026
Parks, Playgrounds, Open spaces;	Open spaces as percentage of total MC area. %	Open spaces as percentage of total MC area. %	0%	0%		
	Playgrounds as percentage of total MC area. %	Playgrounds as percentage of total MC area. %	0%	0%		
	Parks with condition "A" (Excellent) %	Parks with condition "A" expressed as a percentage of total number of parks.	0%	0%	Improvement & Rehabilitation of Parks	2025-2026
	Parks with condition "B" (Good) %	Parks with condition "B" expressed as a percentage of total number of parks.	11%	37%		
	Parks with condition "C" (Fair) %	Parks with condition "C" expressed as a percentage of total number of parks.	33%	33%		
	Parks with condition "D" (Poor) %	Parks with condition "D" expressed as a percentage of total number of parks.	37%	29%		
	Parks with condition "E" (Failing) %	Parks with condition "E" expressed as a percentage of total number of parks.	19%	0%		
	Parks as percentage of total MC area. %	Parks as percentage of total MC area. %	0.5%	0.5%		
Graveyards;	Graveyards as percentage of total MC area. %	Graveyards as percentage of total MC area. %	0%	0%		
	Graveyards with condition "A" (Excellent) %	Total area of graveyards with condition "A" expressed as a percentage of total area of graveyards.	0%	0%		
	Graveyards with condition "B" (Good) %	Total area of graveyards with condition "B" expressed as a percentage of total area of graveyards.	0%	0%		



Functions of MCs (municipal services)	Level of Service Indicators	Description	Current LOS	Target LOS for three years	Project Name	Timeframe (FY)
	Graveyards with condition "C" (Fair) %	Total area of graveyards with condition "C" expressed as a percentage of total area of graveyards.	0%	0%		
	Graveyards with condition "D" (Poor) %	Total area of graveyards with condition "D" expressed as a percentage of total area of graveyards.	0%	0%		
	Graveyards with condition "E" (Failing) %	Total area of graveyards with condition "E" expressed as a percentage of total area of graveyards.	0%	0%		
Transport stations, stops, stands and terminals;	Ratio of bus stations to the total length of roads	Ratio of bus stations to the total length of roads	1:53	1:53		
	Adequacy of facilities at bus stands	Adequacy of facilities at bus stands	No	Yes	Improvement and Rehabilitation of Bus Stand	2024-2025
Slaughterhouses;	Adequacy of slaughterhouses	Adequacy of slaughterhouses keeping in view the population of the MC	Yes	Yes		
	Adequacy of facilities in slaughterhouses	Adequacy of facilities in slaughterhouses in terms of tools, disinfectants, refrigeration/ storage systems, drainage, and disposal facility, etc.	No	Yes	Rehabilitation of slaughterhouse	2025-2026
Municipal libraries;	Total number of Libraries per 100,000 persons	Total number of Libraries per 100,000 persons	1 : 167,036	1 : 167,036		
	Adequacy of facilities in library	Adequacy of facilities in library in terms of books, computers, furniture, air-conditioning, lighting, drinking water etc.	Yes	Yes		
Buildings;	Buildings with condition "A" (Excellent) %	Total number of buildings with condition "A" expressed as a percentage of total number of buildings.	0%	0%		
	Buildings with condition "B" (Good) %	Total number of buildings with condition "B" expressed as a percentage of total number of buildings.	4%	4%		

Functions of MCs (municipal services)	Level of Service Indicators	Description	Current LOS	Target LOS for three years	Project Name	Timeframe (FY)
	Buildings with condition "C" (Fair) %	Total number of buildings with condition "C" expressed as a percentage of total number of buildings.	96%	96%		
	Buildings with condition "D" (Poor) %	Total number of buildings with condition "D" expressed as a percentage of total number of buildings.	0%	0%		
	Buildings with condition "E" (Failing) %	Total number of buildings with condition "E" expressed as a percentage of total number of buildings.	0%	0%		
	Solar Penetration Index (SPI) %	The Solar Penetration Index (SPI) measures the percentage of MC office buildings that have successfully undergone solarization.	0%	100%	Solarization of the municipal buildings	2023-2024

**Notes:**

- While achieving the target level of service, MC shall ensure conformance with applicable laws and regulations including but not limited to land use planning, building control, environmental and social considerations.
- Environmental and social considerations are provided in Annex D.
- For certain service levels, the existing level of service is sustained during the term of IDAMP i.e. three years, despite the recognized need for enhancements. This circumstance arises due to various factors, including but not limited to funding constraints, the reluctance of asset owners to initiate required modifications and the lack of suitable land availability. Nevertheless, it is crucial to emphasize that the preparation and revision of the IDAMP is an ongoing process. As a result, the target level of service in these areas may be redefined in the future, facilitating the implementation of potential improvements.
- The calculation of daily water supplied to the distribution system has considered the capacity of tubewells, in combination with the average hours of service per day for water supply.

- In order to reduce the reduction in non-revenue water, certain initiatives are required such as capacity building for MC staff, the installation of water meters, tariff revisions, regulatory reforms, among other measures. It's important to note that the percentage of non-revenue water may not necessarily improve solely with an increase in water production.
- As regards to landfilling, developing regional landfill sites, rather than smaller units for each city, would be advisable.

# 05 IDAMP Projects

---

## Section 5. IDAMP Projects

Based on the asset condition analysis and target level of services, the following projects have been identified in respect of various asset categories. Preliminary cost estimates for the project, encompassing both capital and operational & maintenance expenses, were calculated using the current Market Rating System (MRS) and Non-MRS rates for items. It's important to note that this estimation does not factor in inflation. Further, the coding scheme adopted to allot codes to the projects and the proposed projects' screening and phasing evaluation is given in Annexure B and C respectively.

**Table 4: IDAMP Projects**

Sr. No.	Project ID	Project Name	Asset Category	Total Capital Cost	2023-24		2024-25		2025-26		Project Screening (Score)
					Capital	O&M	Capital	O&M	Capital	O&M	
(Millions)											
1	03-15-01-02-01	Improvement & Rehabilitation of Water Supply system in Vehari City	Water Supply	300.00	300.00	15.00	-	15.00	-	15.00	87
2	03-15-01-01-01	Improvement & Rehabilitation of Water Supply system in Vehari City	Water Supply	16.50	16.50	0.83	-	0.83	-	0.83	87
3	03-15-01-06-01	Construction of Underground Water Storage Tank	Water Supply	500.00	250.00	-	250.00	12.50	-	12.50	87
4	03-15-02-02-01	Improvement of Existing Sewerage System and Disposal Stations for Vehari City	Sewerage	900.00	225.00	-	450.00	-	225.00	22.50	84
5	03-15-05-04-01	Improvement and Rehabilitation of Bus Stand	Bus Stand	40.80	-	-	40.80	1.02	-	1.02	71
6	03-15-04-03-01	Replacement of LED lights in Vehari City	Streetlights	17.80	-	-	-	-	17.80	0.45	59

Sr. No.	Project ID	Project Name	Asset Category	Total Capital Cost	2023-24		2024-25		2025-26		Project Screening (Score)
					Capital	O&M	Capital	O&M	Capital	O&M	
					(Millions)						
7	03-15-05-01-01	Improvement & Rehabilitation of Parks	Parks	50.00	-	-	50.00	1.25	-	1.25	70
8	03-15-05-06-01	Rehabilitation of slaughter house	Slaughterhouse	27.30	-	-	-	-	27.30	0.68	62
9	03-15-06-04-01	Solarization of the municipal buildings	Buildings	300.00	300.00	1.50	-	1.50	-	1.50	80
10	03-15-01-01-02	Solarization of Tubewells and Water Supply System	Water Supply	160.00	160.00	0.80	-	0.80	-	0.80	80
11	03-15-04-01-01	Improvement and Rehabilitation of Jinnah Road, Zoo Road & Gol Chowk in MC Vehari Package-I	Roads	160.00	160.00	7.80	-	7.80	-	7.80	81
12	03-15-04-01-02	Improvement and Rehabilitation of Sharqi Colony Road & Seed Farm in Vehari Package-II	Roads	160.00	160.00	6.71	-	6.71	-	6.71	81
13	03-15-04-01-03	Improvement and Rehabilitation of Muhammad Bakery Road in MC Vehari Package-III	Roads	160.00	160.00	3.12	-	3.12	-	3.12	81
14	03-15-04-01-04	Improvement and Rehabilitation of of Railway Crossing to Canal Road & Club Road to Chungi No.6 and People Colony Road Vehari Package-IV	Roads	160.00	160.00	8.13	-	8.13	-	8.13	81

Sr. No.	Project ID	Project Name	Asset Category	Total Capital Cost	2023-24		2024-25		2025-26		Project Screening (Score)
					Capital	O&M	Capital	O&M	Capital	O&M	
					(Millions)						
15	03-15-02-02-02	Solarization of Tubewells and Disposal Stations in Vehari City	Sewerage	190.25	190.25	0.95	-	0.95	-	0.95	80
16	03-15-03-03-01	SWM Vehicle Parking Shed	Solid Waste Management System	36.0	36.0	2.0		2.0		2.0	16
17	03-15-01-01-03	Energy Management Plan	Water Supply	6.53	6.53	0		0		0	17
<b>Total.</b>				<b>4,185.18</b>	<b>3,124.28</b>	<b>46.84</b>	<b>790.80</b>	<b>61.61</b>	<b>270.10</b>	<b>85.24</b>	

### 5.1. Detail of proposed projects:

The following section provides high-level particulars of the identified projects, serving as a point of reference for creating planning documents and PC forms<sup>2</sup>:

**Table 5: Project Detail**

Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
1	03-15-01-02-01	Improvement & Rehabilitation of Water Supply system in Vehari City	Water Supply	1) Rehabilitation of the components of existing water supply system to attain full efficiency out of these installations. 2) Supply of adequate quantity of water in water shortage areas. 3) Improvement of service delivery level in the entire city. 4) Augmentation of the source capacity 5) Equal distribution of water in the entire system 6) Improvement of terminal pressure at remote ends of the distribution system 7) Reduction of water borne diseases. 8) Improvement in local and province economy.	Replacement of outlived water supply distribution system, Rehabilitation of Tubewells, Construction of Transmission Mains	300	15	Vehari City

<sup>2</sup> <https://www.pc.gov.pk/web/downloads/pc>



Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
2	03-15-01-06-01	Construction of Underground Water Storage Tank	Water Supply	<p>The main objectives are</p> <ul style="list-style-type: none"> <li>- To supply safe drinking water ub sufficient quantity at doorsteps of consumers with reasonable cost</li> <li>- To encouraging personal hygiene anad household cleanliness of users</li> <li>- Reduction of water borne diseases</li> <li>- Reduction in medical expenditures</li> <li>- Improvement in environment of the city</li> </ul>	<ul style="list-style-type: none"> <li>Design and Engineering</li> <li>Site Preparation</li> <li>Excavation and Earthwork</li> <li>Foundation Works</li> <li>Masonry Works</li> <li>Coation and Insulation</li> <li>Piping and Connection</li> <li>Concrete Works</li> </ul>	500	12.5	Vehari City
3	03-15-01-01-01	Improvemant & Rehabilitation of Water Supply system in Vehari City	Water Supply	<ol style="list-style-type: none"> <li>1) Rehabilitation of the components of existing water supply system to attain full efficiency out of these installations.</li> <li>2) Supply of adequate quantity of water in water shortage areas.</li> <li>3) Improvement of service delivery level in the entire city.</li> <li>4) Augmentation of the source capacity</li> <li>5) Equal distribution of water in the entire system</li> <li>6) Improvement of terminal pressure at remote ends of the distribution system</li> <li>7) Reduction of water borne diseases.</li> <li>8) Improvement in local and province economy.</li> </ol>	<ul style="list-style-type: none"> <li>- Replacement of 3 pumpsets</li> <li>- Installation of capacitors</li> </ul>	16.5	0.825	Vehari City

Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
4	03-15-02-02-01	Improvement of Existing Sewerage System and Disposal Stations for Vehari City	Sewerage	The Project has the following objectives; 1. To implement prioritized, need based and most cost-effective municipal service infrastructure sub projects for the year 2032. 2. To improve the service delivery level for the entire growing population of the city. 3. Protecting drinking water sources from contamination by waterborne waste 4. Improvement of the environment of the city making it livable. 5. To improve the economic growth of the city.	Construction of WWTP, Rehabilitation of 4 Disposal Stations, Replacement of Outlived Pipes, Replacement of Crown Failure Pipelines	900	22.5	Vehari City
5	03-15-05-04-01	Improvement and Rehabilitation of Bus Stand	Bus Stand	1. Provision of disciplined travelling facilities to the people. 2. Provision of waiting facilities for the travelers in the form of respectable sitting, ablution & prayer, drinking water, toilets, shopping and ticketing. 3. Provision of car parking facilities to the public, 4. Rickshaw stand facilities 5. Revenue generation from shops and parking lot 6. Improvement in the air pollution in city area due to parking and waiting by the buses 7. Reduction in the traffic congestion created by buses at various locations of the city 8. Effective protection of the buses against the solar radiation and Ultraviolet	'- General Bus Stand main building along with all allied facilities - Drainage System - Illumination and electrical works - Boundary wall and gates -Construction of Mosque	40.8	1.02	Club Road, Vehari

Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
				rays, rain, hail, wind, and dust. 9. Slowing down the deterioration of buses, therefore reducing the amount of maintenance. 10. Improvement in the economic growth potential of the city.				

Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
6	03-15-04-03-01	Replacement of LED lights in Vehari City	Streetlights	<p>Enhance public safety and security by providing adequate lighting.</p> <p>Improve visibility for motorists and pedestrians.</p> <p>Increase the overall quality of street lighting.</p> <p>Reduce energy consumption and operating costs.</p> <p>Promote energy efficiency and sustainability.</p> <p>Improve the aesthetics of the area.</p> <p>Enhance the functionality of the street lighting system.</p> <p>Improve reliability and reduce maintenance downtime.</p> <p>Ensure compliance with regulatory requirements.</p> <p>Increase the lifespan of the street lighting system.</p>	<p>1. R1 Ludden Road: - Quaid e Azam Chowk to Bhatta Shadi Khan</p> <p>2. R2 Multan Road: - Khanewal Chowk to Peer Murad Road</p> <p>3. R3 Purana Lorry Adda Road: -Khanewal Chowk to V-Chowk</p> <p>4. R4 Burewala Road: -V Chowk to new Sabzi Mandi</p> <p>5. R5 Jinnah Road: -V Chowk to Khanewal Road</p> <p>6. R6 Club Road: -Quaid-e-Azam Chowk to Masjid Bagh wali</p>	17.8	0.45	<p>1. R1 Ludden Road: - Quaid e Azam Chowk to Bhatta Shadi Khan</p> <p>2. R2 Multan Road: - Khanewal Chowk to Peer Murad Road</p> <p>3. R3 Purana Lorry Adda Road: - Khanewal Chowk to V-Chowk</p> <p>4. R4 Burewala Road: -V Chowk to new Sabzi Mandi</p> <p>5. R5 Jinnah Road: -V Chowk to Khanewal Road</p> <p>6. R6 Club Road: - Quaid-e-Azam Chowk to Masjid Bagh wali</p>

Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
7	03-15-05-01-01	Improvement & Rehabilitation of Parks	Parks	<ol style="list-style-type: none"> <li>1. To reduce urban heat island effect.</li> <li>2. To provide active and passive recreational opportunities</li> <li>3. To contribute to the health and wellness of a community</li> <li>4. To create valuable green space</li> <li>5. To combat air pollution caused by vehicles and industries</li> <li>6. Improvement in environments of the city making them livable.</li> <li>7. Improvement in local and province economy.</li> <li>8. Improvement in the economic growth potential of the city.</li> </ol>	All parks required 1 Swings 2 Drinking water coolers 3 Washroom Renovations 4 Prayer Room 5 Dust Bins 6 Exercise Facility 7 Tuck Shop 8 Gazebo	50	1.25	Vehari City
8	03-15-05-06-01	Rehabilitation of slaughter house	Slaughterhouse	Ensure compliance with sanitation and hygiene standards. Improve the welfare and treatment of animals. Enhance public health and safety. Increase the efficiency of the slaughter process. Reduce operating costs and increase profitability. Upgrade facilities and equipment to meet modern standards. Minimize the impact on the environment. Ensure compliance with regulatory requirements. Improve working conditions for employees. Improve the overall performance of the slaughterhouse.	<ul style="list-style-type: none"> <li>• Boundary wall and gate</li> <li>• Doctor's room</li> <li>• Slaughtering hall</li> <li>• Evisceration hall</li> <li>• Meat cutting room</li> <li>• Blood collection arrangements</li> <li>• Water supply systems</li> <li>• Skin storage room</li> <li>• Waste water disposal system</li> <li>• Solid waste collection and disposal system</li> <li>• Health and Hygiene SOPs</li> <li>• Separate Facility for Sick Animals</li> </ul>	27.3	0.68	Vehari City

Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
					<ul style="list-style-type: none"> <li>Tools Disinfectant System</li> </ul>			
9	03-15-06-04-01	Solarization of the municipal buildings	Buildings	The primary objectives of solarization are as follows: a) Enhance Sustainability: By generating clean and renewable energy, the project can reduce its environmental impact and contribute to sustainable development. b) Reduce Carbon Footprint: Solar PV systems produce electricity with zero greenhouse gas emissions, helping to mitigate climate change and improve air quality. c) Cut Down Energy Costs: Utilizing solar energy can significantly reduce reliance on conventional grid electricity, resulting in long-term cost savings and improved financial viability.	Solarization of the municipal buildings based on the site load and installation capacity assessment	300	1.5	Vehari City

Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
10	03-15-01-01-02	Solarization of Tubewells and Water Supply System	Water Supply	<p>The primary objectives of solarization are as follows:</p> <p>a) Enhance Sustainability: By generating clean and renewable energy, the project can reduce its environmental impact and contribute to sustainable development.</p> <p>b) Reduce Carbon Footprint: Solar PV systems produce electricity with zero greenhouse gas emissions, helping to mitigate climate change and improve air quality.</p> <p>c) Cut Down Energy Costs: Utilizing solar energy can significantly reduce reliance on conventional grid electricity, resulting in long-term cost savings and improved financial viability.</p>	Solarization of the tubewells based on the site load and installation capacity assessment. Tubewell solarization project scope involves converting conventional water pumping systems into solar-powered ones to ensure sustainable and energy-efficient water supply for rural needs.	160	0.8	Vehari City
11	03-15-04-01-01	Improvement and Rehabilitation of Jinnah Road, Zoo Road & Gol Chowk in MC Vehari Package-I	Roads	<p>The Project has the following objectives;</p> <ol style="list-style-type: none"> <li>1. Improvement of service delivery level of the municipal services in the sector of communication.</li> <li>2. Better travelling facilities for the commuters.</li> <li>3. Reduction in road accidents.</li> <li>4. Saving in travelling and repair cost of the vehicles.</li> <li>5. Reduction in annual maintenance charges of roads and parks</li> <li>6. Better lit roads and streets adding to security of people travelling at night.</li> <li>7. Improvement in environments of the city making them livable.</li> <li>8. Improvement in local and province</li> </ol>	<ul style="list-style-type: none"> <li>· Geometric Improvement</li> <li>· Rehabilitation of Existing Pavement Structure</li> <li>· Pavement Marking</li> <li>· Street Lighting</li> <li>· Improvement of drainage system</li> </ul>	156.05	7.8025	<ol style="list-style-type: none"> <li>1. Jinnah Road</li> <li>2. Zoo Road</li> </ol>

Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
				economy. 9. Improvement in the economic growth potential of the city.				
12	03-15-04-01-02	Improvement and Rehabilitation of Sharqi Colony Road & Seed Farm in Vehari Package-II	Roads	The Project has the following objectives; 1. Improvement of service delivery level of the municipal services in the sector of communication. 2. Better travelling facilities for the commuters. 3. Reduction in road accidents. 4. Saving in travelling and repair cost of the vehicles. 5. Reduction in annual maintenance charges of roads and parks 6. Better lit roads and streets adding to security of people travelling at night. 7. Improvement in environments of the city making them livable. 8. Improvement in local and province economy. 9. Improvement in the economic growth potential of the city.	<ul style="list-style-type: none"> <li>· Geometric Improvement</li> <li>· Rehabilitation of Existing Pavement Structure</li> <li>· Pavement Marking</li> <li>· Street Lighting</li> <li>· Improvement of drainage system</li> </ul>	134.26	6.713	1. Sharqi Colony Road 2. Seed Farm Road
13	03-15-04-01-03	Improvement and Rehabilitation of Muhammad Bakery Road in MC Vehari Package-III	Roads	The Project has the following objectives; 1. Improvement of service delivery level of the municipal services in the sector of communication. 2. Better travelling facilities for the commuters. 3. Reduction in road accidents. 4. Saving in travelling and repair cost of	<ul style="list-style-type: none"> <li>· Geometric Improvement</li> <li>· Rehabilitation of Existing Pavement Structure</li> <li>· Pavement Marking</li> <li>· Street Lighting</li> <li>· Improvement of</li> </ul>	62.42	3.121	Muhammadi Bakery Road



Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
				<p>the vehicles.</p> <p>5. Reduction in annual maintenance charges of roads and parks</p> <p>6. Better lit roads and streets adding to security of people travelling at night.</p> <p>7. Improvement in environments of the city making them livable.</p> <p>8. Improvement in local and province economy.</p> <p>9. Improvement in the economic growth potential of the city.</p>	drainage system			
14	03-15-04-01-04	Improvement and Rehabilitation of of Railway Crossing to Canal Road & Club Road to Chungi No.6 and People Colony Road Vehari Package-IV	Roads	<p>The Project has the following objectives;</p> <p>1. Improvement of service delivery level of the municipal services in the sector of communication.</p> <p>2. Better travelling facilities for the commuters.</p> <p>3. Reduction in road accidents.</p> <p>4. Saving in travelling and repair cost of the vehicles.</p> <p>5. Reduction in annual maintenance charges of roads and parks</p> <p>6. Better lit roads and streets adding to security of people travelling at night.</p> <p>7. Improvement in environments of the city making them livable.</p> <p>8. Improvement in local and province economy.</p> <p>9. Improvement in the economic growth potential of the city.</p>	<ul style="list-style-type: none"> <li>· Geometric Improvement</li> <li>· Rehabilitation of Existing Pavement Structure</li> <li>· Pavement Marking</li> <li>· Street Lighting</li> <li>· Improvement of drainage system</li> </ul>	162.52	8.126	<p>1. Railway Crossing to Canal Road &amp; Club Road to Chungi No.6 Chowk</p> <p>2. People Colony Road</p>

Sr. No.	Project ID	Project Name	Service Sector	Project Objectives	Project Scope	Capital Cost (PKR million)	Recurrent Annual O&M Cost (PKR million)	Project Location
15	03-15-02-02-02	Solarization of Tubewells and Disposal Stations in Vehari City	Sewerage	The primary objectives of solarization are as follows: a) Enhance Sustainability: By generating clean and renewable energy, the project can reduce its environmental impact and contribute to sustainable development. b) Reduce Carbon Footprint: Solar PV systems produce electricity with zero greenhouse gas emissions, helping to mitigate climate change and improve air quality. c) Cut Down Energy Costs: Utilizing solar energy can significantly reduce reliance on conventional grid electricity, resulting in long-term cost savings and improved financial viability.	Solarization of the Tubewells and Disposal Stations based on the site load and installation capacity assessment	190.245	0.951225	Vehari city

**5.2. Operations and Maintenance (O&M) Strategy:**

The Operations and Maintenance (O&M) Strategy outlined in this Integrated Development and Asset Management Plan (IDAMP) ensures the effective management and sustainability of critical infrastructure assets, including sewerage, water supply, and solid waste machinery. Each component of the O&M strategy is designed to optimize asset performance and support ongoing service delivery.

**1. Sewerage Operations and Maintenance**

- **Preventive Maintenance:** Regular inspection, cleaning, and repair of sewer lines, manholes, and treatment facilities to prevent blockages and ensure uninterrupted flow.
- **Emergency Response:** Establishment of rapid response protocols for addressing sewerage system failures and overflows to minimize public health and environmental risks.

- **Pump Station Management:** Routine maintenance of sewerage pumping stations to optimize performance and extend equipment lifespan.
- **Asset Monitoring:** Implementation of real-time monitoring systems to track sewerage system performance and identify potential issues proactively.
- **Budget Allocations:** All O&M expenses for sewerage infrastructure are based on the IDAMP guidelines, with a detailed list of expenses provided in Annexure G,H &I.

## 2. Water Supply Operations and Maintenance

- **Water Quality Management:** Regular testing and treatment of water sources to maintain compliance with quality standards and ensure safe drinking water supply.
- **Distribution Network Maintenance:** Inspection and repair of pipelines, valves, and pumps to minimize leaks and pressure fluctuations in the water distribution network.
- **Reservoir and Pump House Operations:** Scheduled maintenance of water reservoirs and pump houses to optimize operational efficiency and reduce energy consumption.
- **Leak Detection:** Utilization of advanced leak detection technologies to identify and repair water leaks promptly.
- **Budget Allocations:** O&M expenditures for water supply infrastructure are aligned with the IDAMP framework, as detailed in Annexure XYZ.

## 3. Solid Waste Machinery Operations and Maintenance

- **Equipment Servicing:** Routine servicing and lubrication of solid waste machinery, including compactors, shredders, and sorting equipment, to optimize performance and reduce downtime.
- **Waste Collection Fleet Management:** Maintenance and repair of waste collection vehicles to ensure reliable and efficient solid waste collection services.
- **Landfill Management:** Regular monitoring and maintenance of landfill sites to mitigate environmental impacts and ensure compliance with waste disposal regulations.
- **Recycling Infrastructure Maintenance:** Inspection and upkeep of recycling facilities and equipment to support sustainable waste management practices.
- **Budget Allocations:** O&M expenses related to solid waste management are calculated based on IDAMP guidelines, with a comprehensive breakdown provided in Annexure G,H &I..

In conclusion, the integrated Operations and Maintenance (O&M) Strategy within the IDAMP framework underscores our commitment to effective asset management and service delivery. By prioritizing preventive maintenance, rapid response capabilities, and continuous monitoring while aligning expenditures with the IDAMP, we ensure the long-term reliability and sustainability of essential infrastructure services. This proactive approach supports our mission to provide quality public services while optimizing resource utilization and minimizing operational risks.

# 06 Financial and Economic Analysis

---

## Section 6. Financial and Economic Analysis

In this chapter, financial and economic analysis has been carried out for the new project proposed under IDAMP to assess its economic and financial viability and determine its do-ability by reference to its financial resources required next three financial years.

### 1.1. Qualitative Assessment

The qualitative benefits of the proposed projects are as under:

- (i) **The benefits of municipal project – Engines of Growth:** Among other benefits, municipal projects generate employment opportunities and create a positive impact on the standard of living. Few projects proposed under IDAMP are mega projects which would create their own economy, boost manufacturing & trading, create need for commerce value chain.
- (ii) **Environmental Up-gradation:** Development of wastewater treatment plant would provide primary and secondary treatment, thereby have a positive bearing on environment. Further, all projects will especially focus environmental considerations during construction and operational phases. Further green areas, trees and plantations will provide not only refreshing view but will enhance the environmental conditions and help climate stabilization.
- (iii) **Employment Opportunities:** The Project is likely to create employment opportunities for over 1,000 people during construction and about 500 people at operational stage in addition to indirect employment generation.
- (iv) **Improvement in Service Delivery of Water Supply:** Replacement of water supply system would improve the water quality for the target population, thus will help to improve public health index.
- (v) **Rehabilitation of Parks - Creation of Social Hub in the Locality:** These projects will provide a recreational facility to the residents of the catchment area of respective parks thus improve the visitors count of the parks and create social harmony and extended connectivity in the people.
- (vi) **Saving in Fuel Consumption and Improved Connectivity -** Rehabilitation of roads infrastructure would not only improve the service delivery level of the municipal services but also result in few road accidents, potential savings in travelling and repair cost of the vehicles, reduction in annual maintenance charges of roads and parks. Moreover, better lit roads and streets would add to security of people travelling at night.
- (vii) **Generation of Business Opportunities:** Projects will open new corridors for small- and large-scale businesses right from the construction phase and onwards throughout the life of the Project.

(viii) **Revenue Generation:** Local government is estimated to generate direct and indirect revenue from the projects.

## 1.2. Quantitative Assessment of the Project

Various basis has been used, primarily relying on the results of the financial model which has been developed to conduct the financial analysis that assesses the viability and sustainability of this Project. Free Cash Flows (FCF) of the Project have been used to determine the key financial indicators of the projects.

Using the free cash flow model, given below are the key financial indicators for project appraisal:

- (i) **Net Present Value (NPV)** of the projects is calculated which represents in present value terms the net benefit that accrues from the Project after meeting its capital cost requirements as well as the cost of operations and other expenditures.
- (ii) **Financial Internal rate of return (FIRR)** of the projects is calculated While representing an average return and its comparison with the required rate of return, which is taken as KIBOR rate
- (iii) **Payback period** of the Project is estimated duly incorporating construction and operational period over the useful life of asset.
- (iv) **Cost benefit analysis** of the projects is made to determine the ratio of cumulative benefits versus cumulative cost of each project over its useful life.

### 1.3. Annual Financial Projections

The annual financial projection of Municipal Committee Vehari is given below:

**Table 6: Financial Projections**

Sr. No.	Asset Category	2023-24		2024-25		2025-26	
		Capital	O&M	Capital	O&M	Capital	O&M
1	Water Supply	726.50	16.63	250.00	29.13	-	29.13
2	Sewerage	415.25	0.95	450.00	0.95	225.00	23.45
3	Bus Stand	-	-	40.80	1.02	-	1.02
4	Streetlights	-	-	-	-	17.80	0.45
5	Parks	-	-	50.00	1.25	-	1.25
6	Slaughterhouse	-	-	-	-	27.30	0.68
7	Buildings	300.00	1.50	-	1.50	-	1.50
8	Roads	640.00	25.76	-	25.76	-	25.76
<b>Total.</b>		<b>2,081.75</b>	<b>44.84</b>	<b>790.80</b>	<b>59.61</b>	<b>270.10</b>	<b>83.24</b>

Capital cost of the projects incorporates both the initial one-off costs such as engineering cost, project construction cost, development cost, procurement cost of equipment, machinery & other assets, utility set up cost, and any other costs to be incurred during the construction period.

Operating and maintenance (O&M) cost shall be incurred during operational phases of the project. Operation and maintenance cost includes electricity and other utility cost, administrative expenses, maintenance cost, payroll cost and other overheads etc.




# Annexure


---

## Annexure A. Detail of Assets

### 1. Water Supply:

#### Key Components of a Water Supply System

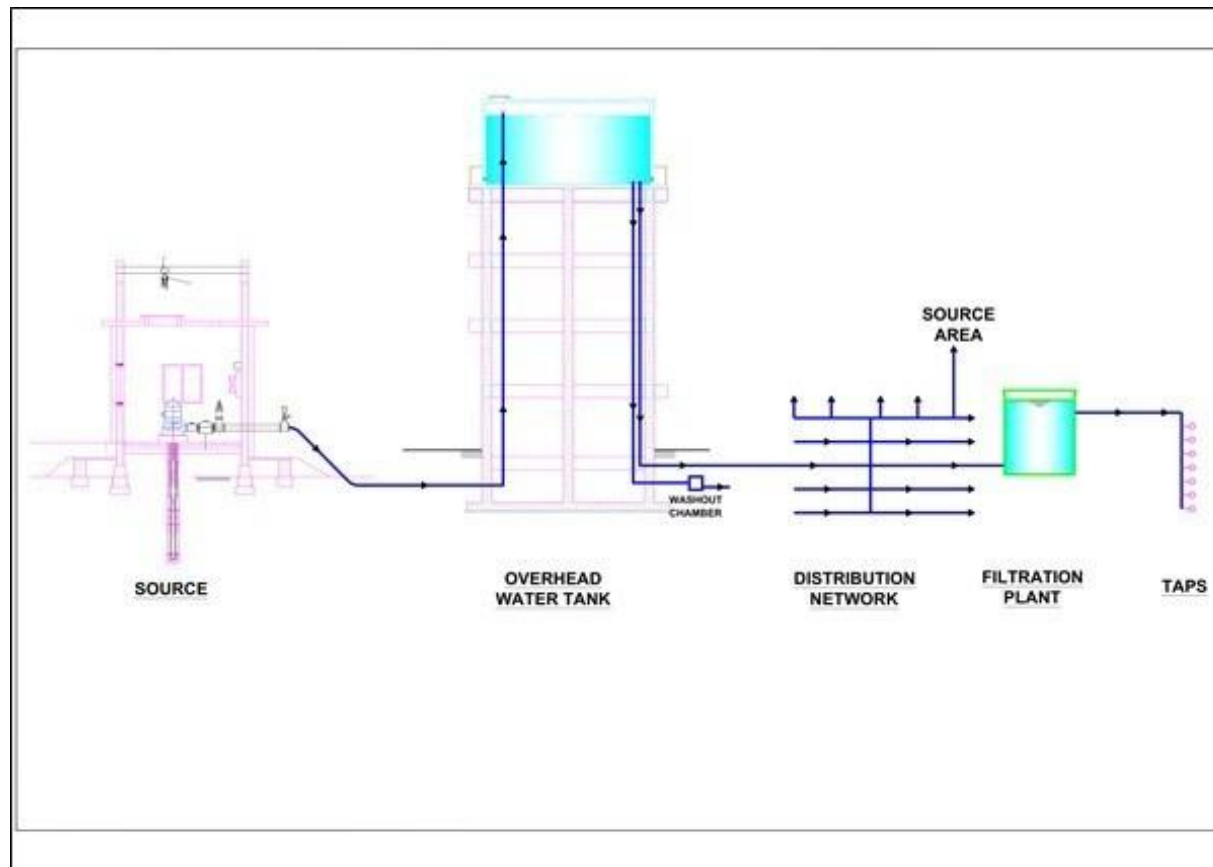

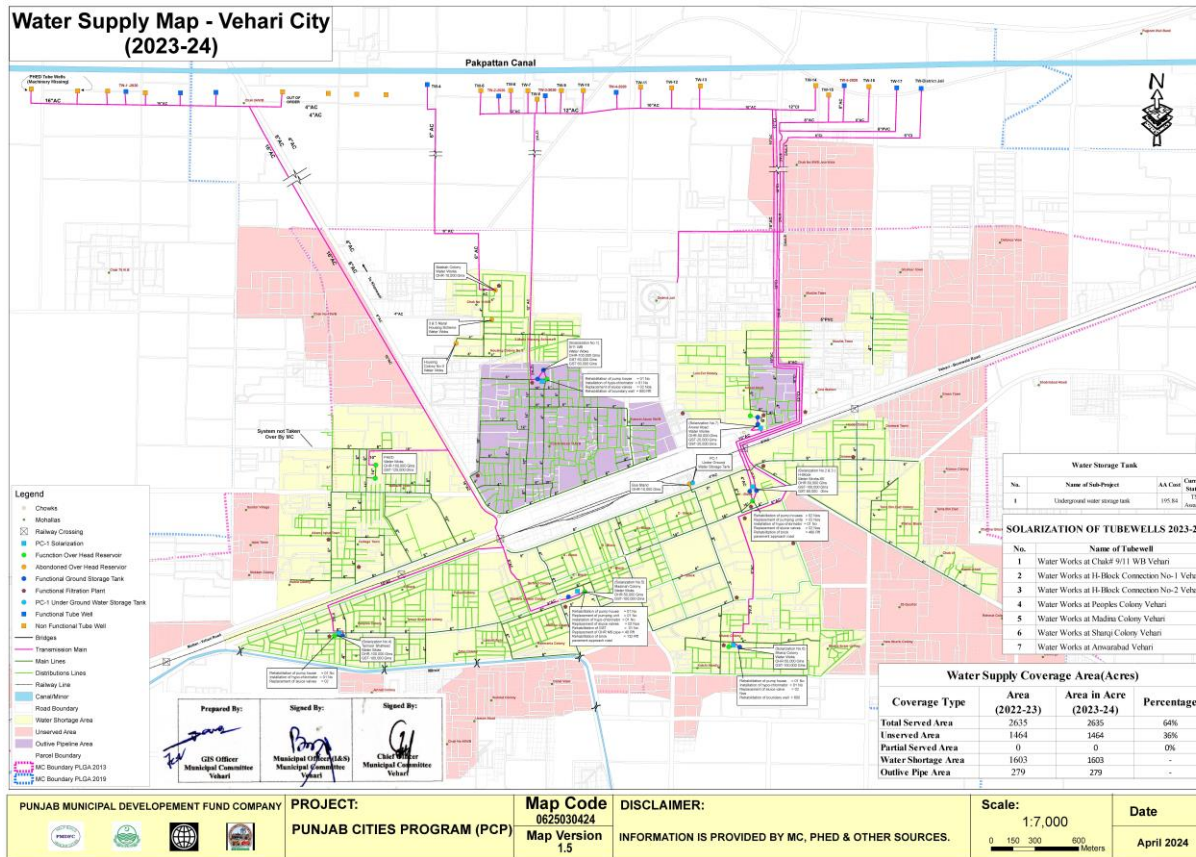

**A. Tube well**

Sr #	Name	Age (Years)		Condition	Status	Book Value (PKR Million)	Discharge (cusec)	Pump Make	Motor Make	Motor hp
		Civil Structure	Pump							
1	24 WB New 1/21	2	2	Good	Functional	11	1	KSB	Siemens	40
2	24 WB Tube well #03	34	33	Poor	Functional	0	1	KSB	Siemens	40
3	24 WB Tube well #02	21	2	Fair	Functional	9	1	KSB	Siemens	50
4	22 WB Tube well #04	14	14	Fair	Functional	0.5	0.5	KSB	Siemens	20
5	22 WB Tube well #05	34	17	Poor	Non-Functional	0.2	1	KSB	Siemens	40
6	22 WB New 2/21	2	2	Good	Functional	10.5	1	KSB	Siemens	40
7	22 WB Tube well #06	21	21	Poor	Non-Functional	0.25	1	KSB	PECO	25
8	22 WB Tube well #07	14	14	Poor	Non-Functional	0.45	1	FPI	Siemens	50
9	22 WB Tube well #08	14	14	Poor	Non-Functional	0.5	1	KSB	No Motor	
10	22 WB New 3/21	2	2	Good	Functional	10.7	1	KSB	Siemens	40
11	22 WB Tube well #09	14	14	Failing	Non-Functional	0.4	Abandoned			
12	22 WB Tube well #10	34	34	Failing	Non-Functional	0	Abandoned			
13	22 WB New 4/21	2	2	Good	Functional	10.1	1	KSB	Siemens	40
14	22 WB Tube well #11	34	34	Failing	Non-Functional	0	Abandoned			
15	22 WB Tube well #12	21	21	Poor	Non-Functional	0.27	1	KSB	PECO	40



Sr #	Name	Age (Years)		Condition	Status	Book Value (PKR Million)	Discharge (cusec)	Pump Make	Motor Make	Motor hp
		Civil Structure	Pump							
16	22 WB Tube well #13	21	21	Failing	Non-Functional	0.29	1	KSB	PECO	40
17	22 WB Tube well #14	14	14	Failing	Non-Functional	0.47	1	FPI	Siemens	50
18	22 WB Tube well #15	34	34	Failing	Non-Functional	0	Abandoned			
19	22 WB New 5/21	2	2	Good	Functional	10.6	1	KSB	Siemens	40
20	22 WB Tube well #16	34	34	Failing	Non-Functional	0	Abandoned			
21	22 WB Tube well #17	14	14	Poor	Functional	0.5	1	PECO	PECO	40
22	24 WB Tube well #01	34	34	Failing	Non-Functional	0	Abandoned			
23	24 WB Tube well #05	32	32	Failing	Non-Functional	0	Abandoned			

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		24 WB New 1/21		
Location	Latitude	30.076734		
	Longitude	72.316524		
Address		24 WB Pak Pattan canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2020		
Installation Year of Pump		2020		
Capital Cost of Machinery				
Operational Hours		16		
Delivery Pipe	Dia	8		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1450		
Housing Dia (inches)		12		
Bore Depth (ft.)		250		
Head (ft.)		200		
Impeller Installation Depth (ft.)		100		

Vehari, Punjab, Pakistan  
Unnamed Road, Vehari, Punjab, Pakistan  
Lat: 30.076734°  
Long: 72.316524°  
04/05/23 02:58 PM GMT +05:00

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment				Asset Code: _____ Date: 04-05-2023
Paint of Pumping Unit		Good			
Number of Valves	Gate Valve	1			
	Non-Returning Valve	1			
Base Plate	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	50				
Sanctioned Load (Kwh)	30				
Motor Power (HP)	40				
Motor Make	Siemens				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No remarks					



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023





Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		24 WB Tube well #03		
Location	Latitude	30.076826		
	Longitude	72.318844		
Address		24 WB Pak Pattan canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		1989		
Installation Year of Pump		1990		
Capital Cost of Machinery				
Operational Hours		8		
Delivery Pipe	Dia	5		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1450		
Housing Dia (inches)		12		
Bore Depth (ft.)		400		
Head (ft.)		200		
Impeller Installation Depth (ft.)		120		



GPS Map Camera  
Vehari, Punjab, Pakistan  
Vehari - Kacha Khuh Rd, Vehari, Punjab, Pakistan  
Lat: 30.076826°  
Long: 72.318844°  
04/05/23 03:08 PM GMT +05:00


Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
Paint of Pumping Unit		Poor			
Number of Valves	Gate Valve	1			
	Non-Returning Valve	1 Sluice valve			
Base Plate		Yes	No		
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)		50			
Sanctioned Load (Kwh)		30			
Motor Power (HP)		40			
Motor Make		Siemens			
MCU		Yes	No		
Earthing of Motor		Yes	No		
Power Wiring		Yes	No		
Service Cable		Yes	No		
Earthing of MCU		Yes	No		
Energy Meter		Yes	No		
Water Meter		Yes	No		
PFI Equipment		Yes	No		
Generator		Yes	No		
Change Over		Yes	No		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		24 WB Tube well #02		
Location			30.076826	
			72.318844	
Address		24 WB Pak Pattan canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2021		
Installation Year of Pump		2021		
Capital Cost of Machinery				
Operational Hours		16		
Delivery Pipe	Dia	8		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1450		
Housing Dia (inches)		12		
Bore Depth (ft.)		400		
Head (ft.)		200		
Impeller Installation Depth (ft.)		120		





Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____	
					Date: 04-05-2023	
Paint of Pumping Unit		Fair				
Number of Valves	Gate Valve	1				
	Non-Returning Valve	1				
Base Plate		Yes	No			
Electro-Mechanical Equipment Details						
Transformer Capacity (kVA)		50				
Sanctioned Load (Kwh)		37				
Motor Power (HP)		50				
Motor Make		Siemens				
MCU		Yes	No			
Earthing of Motor		Yes	No			
Power Wiring		Yes	No			
Service Cable		Yes	No			
Earthing of MCU		Yes	No			
Energy Meter		Yes	No			
Water Meter		Yes	No			
PFI Equipment		Yes	No			
Generator		Yes	No			
Change Over		Yes	No			
Overall Rating						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
Remarks / Requirements						
<ul style="list-style-type: none"> <li>• _____</li> <li>• _____</li> <li>• _____</li> </ul>						



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		22 WB Tube well #04		
Location	Latitude	30.076826		
	Longitude	72.318844		
Address		22 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2009		
Installation Year of Pump		2009		
Capital Cost of Machinery				
Operational Hours		2		
Delivery Pipe	Dia	6		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		0.5		
Rotational Speed (RPM)		1450		
Housing Dia (inches)		12		
Bore Depth (ft.)		400		
Head (ft.)		200		
Impeller Installation Depth (ft.)		120		



Integrated Development and Asset Management Plan (IDAMP)							
Municipal Committee Vehari							
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023			
Paint of Pumping Unit		Poor					
Number of Valves	Gate Valve	1					
	Non-Returning Valve	1					
Base Plate		Yes	No				
<b>Electro-Mechanical Equipment Details</b>							
Transformer Capacity (kVA)		25					
Sanctioned Load (Kwh)		15					
Motor Power (HP)		20					
Motor Make		Siemens					
MCU	Yes	No					
Earthing of Motor	Yes	No					
Power Wiring	Yes	No					
Service Cable	Yes	No					
Earthing of MCU	Yes	No					
Energy Meter	Yes	No					
Water Meter	Yes	No					
PFI Equipment	Yes	No					
Generator	Yes	No					
Change Over	Yes	No					
<b>Overall Rating</b>							
Average Score	1	2	3	4	5		
Asset Condition	Excellent	Good	Fair	Poor	Failing		
Category	A	B	C	D	E		
<b>Remarks / Requirements</b>							
<ul style="list-style-type: none"> <li>• _____</li> <li>• _____</li> <li>• _____</li> </ul>							





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		22 WB Tube well #05		
Location	Latitude	30.076476		
	Longitude	72.352736		
Address		22 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well				
Installation Year of Pump				
Capital Cost of Machinery				
Operational Hours		0		
Delivery Pipe	Dia	6		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		0.5		
Rotational Speed (RPM)		1450		
Housing Dia (inches)		12		
Bore Depth (ft.)		400		
Head (ft.)		200		
Impeller Installation Depth (ft.)		120		

GPS Map Camera  
Vehari, Punjab, Pakistan  
Unnamed Road, Vehari, Punjab, Pakistan  
Lat 30.076476°  
Long 72.352736°  
04/05/23 03:36 PM GMT +05:00

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Poor			
Number of Valves	Gate Valve	1			
	Non-Returning Valve	1 Flex Valve			
Base Plate	Yes	No			
Electro-Mechanical Equipment Details					
Transformer Capacity (kVA)	100				
Sanctioned Load (Kwh)	30				
Motor Power (HP)	40				
Motor Make	Siemens				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
No Remarks					



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		22 WB New 2/21		
Location	Latitude	30.076376		
	Longitude	72.354107		
Address		22 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2021		
Installation Year of Pump		2021		
Capital Cost of Machinery				
Operational Hours		9		
Delivery Pipe	Dia	8		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1450		
Housing Dia (inches)		12		
Bore Depth (ft.)		250		
Head (ft.)		200		
Impeller Installation Depth (ft.)		100		



Vehari, Punjab, Pakistan  
Unnamed Road, Vehari, Punjab, Pakistan  
Lat: 30.076376°  
Long: 72.354107°  
04/05/23 03:49 PM GMT +05:00

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Good			
Number of Valves	Gate Valve	1			
	Non-Returning Valve	1			
Base Plate	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	100				
Sanctioned Load (Kwh)	30				
Motor Power (HP)	40				
Motor Make	Siemens				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

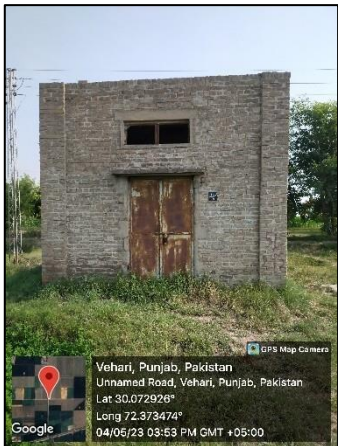Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
Asset Detail				Pictures	
Name		22 WB Tube well #06			
Location	Latitude	30.072926			
	Longitude	72.373474			
Address		22 WB Pak Pattan Canal			
Area (Marla)		1			
Working Status		<b>Abandoned</b>			
Installation Year of Tube Well					
Installation Year of Pump					
Capital Cost of Machinery					
Operational Hours					
Delivery Pipe	Dia				
	Material				
Chlorinator		Yes	No		
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule	
Apron Around Pump House		Yes	No		
Hoisting Girder		Yes	No		
Civil Structure Condition		Good	Fair	Bad	
Approach to Pump House		Good	Fair	Bad	
Pump Details					
Pump Type		Turbine			
Pump Make		KSB			
Discharge Capacity (Cusec)		1			
Rotational Speed (RPM)		1450			
Housing Dia (inches)					
Bore Depth (ft.)					
Head (ft.)					
Impeller Installation Depth (ft.)					







Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Poor			
Number of Valves	Gate Valve				
	Non-Returning Valve				
Base Plate	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	Nil				
Sanctioned Load (Kwh)	19				
Motor Power (HP)	25				
Motor Make	PECO				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

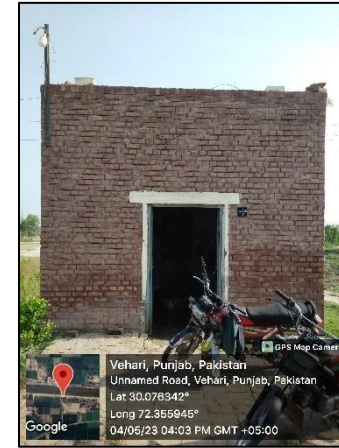Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
Asset Detail				Pictures	
Name		22 WB Tube well #07			
Location	Latitude	30.076342			
	Longitude	72.355945			
Address		22 WB Pak Pattan Canal			
Area (Marla)		1			
Working Status		Functional	Non- Functional		
Installation Year of Tube Well		2009			
Installation Year of Pump		2009			
Capital Cost of Machinery					
Operational Hours					
Delivery Pipe	Dia	8			
	Material	MS			
Chlorinator		Yes	No		
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule	
Apron Around Pump House		Yes		No	
Hoisting Girder		Yes		No	
Civil Structure Condition		Good	Fair	Bad	
Approach to Pump House		Good	Fair	Bad	
Pump Details					
Pump Type		Turbine			
Pump Make		FPI			
Discharge Capacity (Cusec)		1			
Rotational Speed (RPM)		1460			
Housing Dia (inches)		12			
Bore Depth (ft.)		400			
Head (ft.)		200			
Impeller Installation Depth (ft.)		120			




Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Poor			
Number of Valves	Gate Valve	1			
	Non-Returning Valve	1			
Base Plate	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	100 (Shared)				
Sanctioned Load (Kwh)	37				
Motor Power (HP)	50				
Motor Make	Siemens				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		22 WB Tube well #08		
Location	Latitude	30.076337		
	Longitude	72.356806		
Address		22 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2009		
Installation Year of Pump		2009		
Capital Cost of Machinery				
Operational Hours				
Delivery Pipe	Dia	8		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1465		
Housing Dia (inches)		12		
Bore Depth (ft.)		400		
Head (ft.)		200		
Impeller Installation Depth (ft.)		120		

Vehari, Punjab, Pakistan  
Unnamed Road, Vehari, Punjab, Pakistan  
Lat: 30.076337°  
Long: 72.356806°  
04/05/23 04:07 PM GMT +05:00


Integrated Development and Asset Management Plan (IDAMP)							
Municipal Committee Vehari							
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023			
Paint of Pumping Unit		Good					
Number of Valves	Gate Valve	1					
	Non-Returning Valve	0					
Base Plate		Yes	No				
Electro-Mechanical Equipment Details							
Transformer Capacity (kVA)		100					
Sanctioned Load (Kwh)		No Motor					
Motor Power (HP)							
Motor Make							
MCU		Yes	No				
Earthing of Motor		Yes	No				
Power Wiring		Yes	No				
Service Cable		Yes	No				
Earthing of MCU		Yes	No				
Energy Meter		Yes	No				
Water Meter		Yes	No				
PFI Equipment		Yes	No				
Generator		Yes	No				
Change Over		Yes	No				
Overall Rating							
Average Score	1	2	3	4	5		
Asset Condition	Excellent	Good	Fair	Poor	Failing		
Category	A	B	C	D	E		
Remarks / Requirements							
<ul style="list-style-type: none"> <li>No motor was installed to run the pump.</li> </ul>							



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023





Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		22 WB New 3/21		
Location	Latitude	30.076240		
	Longitude	72.357834		
Address		22 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2021		
Installation Year of Pump		2021		
Capital Cost of Machinery				
Operational Hours		15		
Delivery Pipe	Dia	8		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1450		
Housing Dia (inches)		12		
Bore Depth (ft.)		250		
Head (ft.)		200		
Impeller Installation Depth (ft.)		100		


Vehari, Punjab, Pakistan  
Unnamed Road, Vehari, Punjab, Pakistan  
Lat: 30.07624°  
Long: 72.357834°  
04/05/23 04:16 PM GMT +05:00



Integrated Development and Asset Management Plan (IDAMP)							
Municipal Committee Vehari							
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023			
Paint of Pumping Unit		Good					
Number of Valves	Gate Valve	1					
	Non-Returning Valve	1					
Base Plate		Yes	No				
Electro-Mechanical Equipment Details							
Transformer Capacity (kVA)		100					
Sanctioned Load (Kwh)		30					
Motor Power (HP)		40					
Motor Make		Siemens					
MCU		Yes	No				
Earthing of Motor		Yes	No				
Power Wiring		Yes	No				
Service Cable		Yes	No				
Earthing of MCU		Yes	No				
Energy Meter		Yes	No				
Water Meter		Yes	No				
PFI Equipment		Yes	No				
Generator		Yes	No				
Change Over		Yes	No				
Overall Rating							
Average Score	1	2	3	4	5		
Asset Condition	Excellent	Good	Fair	Poor	Failing		
Category	A	B	C	D	E		
Remarks / Requirements							
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>							

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
Asset Detail				Pictures	
Name		22 WB Tube well #09			
Location	Latitude	30.076258			
	Longitude	72.358427			
Address		22 WB Pak Pattan Canal			
Area (Marla)		1			
Working Status		<b>Abandoned</b>			
Installation Year of Tube Well		2009			
Installation Year of Pump		2009			
Capital Cost of Machinery					
Operational Hours					
Delivery Pipe	Dia				
	Material				
Chlorinator		Yes	No		
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule	
Apron Around Pump House		Yes		No	
Hoisting Girder		Yes		No	
Civil Structure Condition		Good	Fair	Bad	
Approach to Pump House		Good	Fair	Bad	
Pump Details					
Pump Type					
Pump Make					
Discharge Capacity (Cusec)					
Rotational Speed (RPM)					
Housing Dia (inches)					
Bore Depth (ft.)					
Head (ft.)					
Impeller Installation Depth (ft.)					

Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____	
					Date: 04-05-2023	
Paint of Pumping Unit						
Number of Valves	Gate Valve					
	Non-Returning Valve					
Base Plate		Yes	No			
<b>Electro-Mechanical Equipment Details</b>						
Transformer Capacity (kVA)						
Sanctioned Load (Kwh)						
Motor Power (HP)						
Motor Make						
MCU		Yes	No			
Earthing of Motor		Yes	No			
Power Wiring		Yes	No			
Service Cable		Yes	No			
Earthing of MCU		Yes	No			
Energy Meter		Yes	No			
Water Meter		Yes	No			
PFI Equipment		Yes	No			
Generator		Yes	No			
Change Over		Yes	No			
<b>Overall Rating</b>						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
<b>Remarks / Requirements</b>						
<ul style="list-style-type: none"> <li>Pump room was empty and closed.</li> </ul>						



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		22 WB Tube well #10		
Location	Latitude	30.076147		
	Longitude	72.359137		
Address		22 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		<b>Abandoned</b>		
Installation Year of Tube Well				
Installation Year of Pump				
Capital Cost of Machinery				
Operational Hours				
Delivery Pipe	Dia			
	Material			
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type				
Pump Make				
Discharge Capacity (Cusec)				
Rotational Speed (RPM)				
Housing Dia (inches)				
Bore Depth (ft.)				
Head (ft.)				
Impeller Installation Depth (ft.)				





Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Paint of Pumping Unit</b>					
<b>Number of Valves</b>	<b>Gate Valve</b>				
	<b>Non-Returning Valve</b>				
<b>Base Plate</b>	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
<b>Transformer Capacity (kVA)</b>					
<b>Sanctioned Load (Kwh)</b>					
<b>Motor Power (HP)</b>					
<b>Motor Make</b>					
<b>MCU</b>	Yes	No			
<b>Earthing of Motor</b>	Yes	No			
<b>Power Wiring</b>	Yes	No			
<b>Service Cable</b>	Yes	No			
<b>Earthing of MCU</b>	Yes	No			
<b>Energy Meter</b>	Yes	No			
<b>Water Meter</b>	Yes	No			
<b>PFI Equipment</b>	Yes	No			
<b>Generator</b>	Yes	No			
<b>Change Over</b>	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>Pump room was empty and closed.</li> </ul>					





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail				Pictures
Name		22 WB New 4/21		
Location	Latitude	30.076091		
	Longitude	72.359984		
Address		22 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2021		
Installation Year of Pump		2021		
Capital Cost of Machinery				
Operational Hours		18		
Delivery Pipe	Dia	8		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1460		
Housing Dia (inches)		12		
Bore Depth (ft.)		250		
Head (ft.)		200		
Impeller Installation Depth (ft.)		120		



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Good			
Number of Valves	Gate Valve	1			
	Non-Returning Valve	1			
Base Plate	Yes	No			
Electro-Mechanical Equipment Details					
Transformer Capacity (kVA)	50				
Sanctioned Load (Kwh)	30				
Motor Power (HP)	40				
Motor Make	Siemens				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
Asset Detail				Pictures	
Name		22 WB Tube well #11			
Location	Latitude	30.076104			
	Longitude	72.361020			
Address		22 WB Pak Pattan Canal			
Area (Marla)		1			
Working Status		<b>Abandoned</b>			
Installation Year of Tube Well					
Installation Year of Pump					
Capital Cost of Machinery					
Operational Hours					
Delivery Pipe	Dia				
	Material				
Chlorinator		Yes	No		
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule	
Apron Around Pump House		Yes	No		
Hoisting Girder		Yes	No		
Civil Structure Condition		Good	Fair	Bad	
Approach to Pump House		Good	Fair	Bad	
Pump Details					
Pump Type					
Pump Make					
Discharge Capacity (Cusec)					
Rotational Speed (RPM)					
Housing Dia (inches)					
Bore Depth (ft.)					
Head (ft.)					
Impeller Installation Depth (ft.)					

Integrated Development and Asset Management Plan (IDAMP)							
Municipal Committee Vehari							
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023			
<b>Paint of Pumping Unit</b>							
<b>Number of Valves</b>	<b>Gate Valve</b>						
	<b>Non-Returning Valve</b>						
<b>Base Plate</b>		Yes	No				
<b>Electro-Mechanical Equipment Details</b>							
<b>Transformer Capacity (kVA)</b>							
<b>Sanctioned Load (Kwh)</b>							
<b>Motor Power (HP)</b>							
<b>Motor Make</b>							
<b>MCU</b>		Yes	No				
<b>Earthing of Motor</b>		Yes	No				
<b>Power Wiring</b>		Yes	No				
<b>Service Cable</b>		Yes	No				
<b>Earthing of MCU</b>		Yes	No				
<b>Energy Meter</b>		Yes	No				
<b>Water Meter</b>		Yes	No				
<b>PFI Equipment</b>		Yes	No				
<b>Generator</b>		Yes	No				
<b>Change Over</b>		Yes	No				
<b>Overall Rating</b>							
Average Score	1	2	3	4	5		
Asset Condition	Excellent	Good	Fair	Poor	Failing		
Category	A	B	C	D	E		
<b>Remarks / Requirements</b>							
<ul style="list-style-type: none"> <li>Pump house was locked and not accessible.</li> </ul>							

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023



Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		22 WB Tube well #12		
Location	Latitude	30.076028		
	Longitude	72.361788		
Address		22 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well				
Installation Year of Pump		2002		
Capital Cost of Machinery				
Operational Hours				
Delivery Pipe	Dia	6		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1460		
Housing Dia (inches)		8		
Bore Depth (ft.)		250		
Head (ft.)		200		
Impeller Installation Depth (ft.)		100		





Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Poor			
Number of Valves	Gate Valve	0			
	Non-Returning Valve	1 Flex Valve			
Base Plate	Yes	No			
Electro-Mechanical Equipment Details					
Transformer Capacity (kVA)	50				
Sanctioned Load (Kwh)	30				
Motor Power (HP)	40				
Motor Make	PECO				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>• Pump and motor are functional but main distribution line connection is required to count this Tube Well into the system.</li> </ul>					





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		22 WB Tube well #13		
Location	Latitude	30.075863		
	Longitude	72.362892		
Address		22 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2002		
Installation Year of Pump		2002		
Capital Cost of Machinery				
Operational Hours				
Delivery Pipe	Dia			
	Material			
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1450		
Housing Dia (inches)				
Bore Depth (ft.)		400		
Head (ft.)		150		
Impeller Installation Depth (ft.)		180		





Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Poor			
Number of Valves	Gate Valve				
	Non-Returning Valve				
Base Plate	Yes	No			
Electro-Mechanical Equipment Details					
Transformer Capacity (kVA)	50				
Sanctioned Load (Kwh)	30				
Motor Power (HP)	40				
Motor Make	PECO				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>Pumping equipment needs to be replaced or repaired</li> <li>Pump room was locked and hence non accessible</li> </ul>					

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
Asset Detail				Pictures	
Name		22 WB Tube well #14			
Location	Latitude	30.075937			
	Longitude	72.363038			
Address		22 WB (EAST)			
Area (Marla)		1			
Working Status		Functional	Non- Functional		
Installation Year of Tube Well		2009			
Installation Year of Pump		2009			
Capital Cost of Machinery					
Operational Hours					
Delivery Pipe	Dia	8			
	Material	MS			
Chlorinator		Yes	No		
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule	
Apron Around Pump House		Yes	No		
Hoisting Girder		Yes	No		
Civil Structure Condition		Good	Fair	Bad	
Approach to Pump House		Good	Fair	Bad	
Pump Details					
Pump Type		Turbine			
Pump Make		FPI			
Discharge Capacity (Cusec)		1			
Rotational Speed (RPM)		1460			
Housing Dia (inches)		12			
Bore Depth (ft.)		400			
Head (ft.)		200			
Impeller Installation Depth (ft.)		120			



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Poor			
Number of Valves	Gate Valve	1			
	Non-Returning Valve	1 Flex Valve			
Base Plate	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	-				
Sanctioned Load (Kwh)	37				
Motor Power (HP)	50				
Motor Make	Siemens				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					






Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

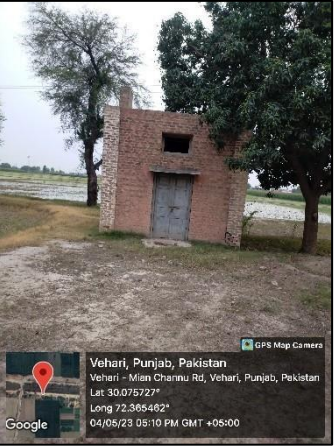


Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
Asset Detail				Pictures	
Name		22 WB Tube well #15			
Location	Latitude	30.075727			
	Longitude	72.365462			
Address		22 WB (EAST)			
Area (Marla)		1			
Working Status		<b>Abandoned</b>			
Installation Year of Tube Well					
Installation Year of Pump					
Capital Cost of Machinery					
Operational Hours					
Delivery Pipe	Dia				
	Material				
Chlorinator		Yes	No		
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule	
Apron Around Pump House		Yes	No		
Hoisting Girder		Yes	No		
Civil Structure Condition		Good	Fair	Bad	
Approach to Pump House		Good	Fair	Bad	
Pump Details					
Pump Type					
Pump Make					
Discharge Capacity (Cusec)					
Rotational Speed (RPM)					
Housing Dia (inches)					
Bore Depth (ft.)					
Head (ft.)					
Impeller Installation Depth (ft.)					

Integrated Development and Asset Management Plan (IDAMP)							
Municipal Committee Vehari							
Form: IDAMP-A1		Tube Well Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023			
Paint of Pumping Unit							
Number of Valves	Gate Valve						
	Non-Returning Valve						
Base Plate		Yes	No				
<b>Electro-Mechanical Equipment Details</b>							
Transformer Capacity (kVA)							
Sanctioned Load (Kwh)							
Motor Power (HP)							
Motor Make							
MCU		Yes	No				
Earthing of Motor		Yes	No				
Power Wiring		Yes	No				
Service Cable		Yes	No				
Earthing of MCU		Yes	No				
Energy Meter		Yes	No				
Water Meter		Yes	No				
PFI Equipment		Yes	No				
Generator		Yes	No				
Change Over		Yes	No				
<b>Overall Rating</b>							
Average Score	1	2	3	4	5		
Asset Condition	Excellent	Good	Fair	Poor	Failing		
Category	A	B	C	D	E		
<b>Remarks / Requirements</b>							
<ul style="list-style-type: none"> <li>Pump room was empty.</li> </ul>							

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023



Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail				Pictures
Name		22 WB New 5/21		
Location	Latitude	30.075685		
	Longitude	72.366181		
Address		22 WB (EAST)		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2021		
Installation Year of Pump		2021		
Capital Cost of Machinery				
Operational Hours		8		
Delivery Pipe	Dia	8		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		KSB		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1450		
Housing Dia (inches)		12		
Bore Depth (ft.)		250		
Head (ft.)		200		
Impeller Installation Depth (ft.)		100		

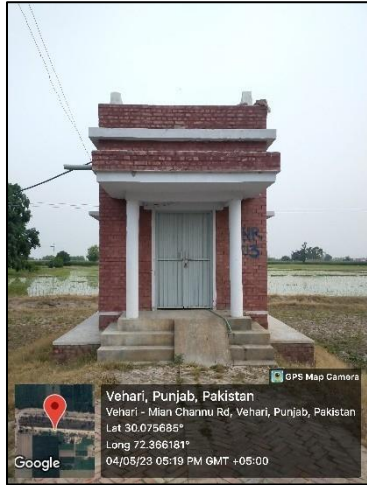

GPS Map Camera  
 Vehari, Punjab, Pakistan  
 Vehari - Milan Channu Rd, Vehari, Punjab, Pakistan  
 Lat 30.075685°  
 Long 72.366181°  
 04/05/23 05:19 PM GMT +05:00

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Good			
Number of Valves	Gate Valve	1			
	Non-Returning Valve	1			
Base Plate	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	50				
Sanctioned Load (Kwh)	30				
Motor Power (HP)	40				
Motor Make	Siemens				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
Asset Detail				Pictures	
Name		22 WB Tube well #16			
Location	Latitude	30.075703			
	Longitude	72.366663			
Address		22 WB (EAST)			
Area (Marla)		1			
Working Status		<b>Abandoned</b>			
Installation Year of Tube Well					
Installation Year of Pump					
Capital Cost of Machinery					
Operational Hours					
Delivery Pipe	Dia				
	Material				
Chlorinator		Yes	No		
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule	
Apron Around Pump House		Yes	No		
Hoisting Girder		Yes	No		
Civil Structure Condition		Good	Fair	Bad	
Approach to Pump House		Good	Fair	Bad	
Pump Details					
Pump Type					
Pump Make					
Discharge Capacity (Cusec)					
Rotational Speed (RPM)					
Housing Dia (inches)					
Bore Depth (ft.)					
Head (ft.)					
Impeller Installation Depth (ft.)					

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Paint of Pumping Unit</b>					
<b>Number of Valves</b>	<b>Gate Valve</b>				
	<b>Non-Returning Valve</b>				
<b>Base Plate</b>	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
<b>Transformer Capacity (kVA)</b>					
<b>Sanctioned Load (Kwh)</b>					
<b>Motor Power (HP)</b>					
<b>Motor Make</b>					
<b>MCU</b>	Yes	No			
<b>Earthing of Motor</b>	Yes	No			
<b>Power Wiring</b>	Yes	No			
<b>Service Cable</b>	Yes	No			
<b>Earthing of MCU</b>	Yes	No			
<b>Energy Meter</b>	Yes	No			
<b>Water Meter</b>	Yes	No			
<b>PFI Equipment</b>	Yes	No			
<b>Generator</b>	Yes	No			
<b>Change Over</b>	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>Pump room was empty</li> </ul>					





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail				Pictures
Name		22 WB Tube well #17		
Location	Latitude	30.075570		
	Longitude	72.369286		
Address		22 WB (EAST)		
Area (Marla)		1		
Working Status		Functional	Non- Functional	
Installation Year of Tube Well		2009		
Installation Year of Pump		2009		
Capital Cost of Machinery				
Operational Hours		12		
Delivery Pipe	Dia	6		
	Material	MS		
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type		Turbine		
Pump Make		PECO		
Discharge Capacity (Cusec)		1		
Rotational Speed (RPM)		1450		
Housing Dia (inches)		12		
Bore Depth (ft.)		400		
Head (ft.)		200		
Impeller Installation Depth (ft.)		120		





Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Paint of Pumping Unit		Poor			
Number of Valves	Gate Valve	1			
	Non-Returning Valve	1			
Base Plate	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	50				
Sanctioned Load (Kwh)	30				
Motor Power (HP)	40				
Motor Make	PECO				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

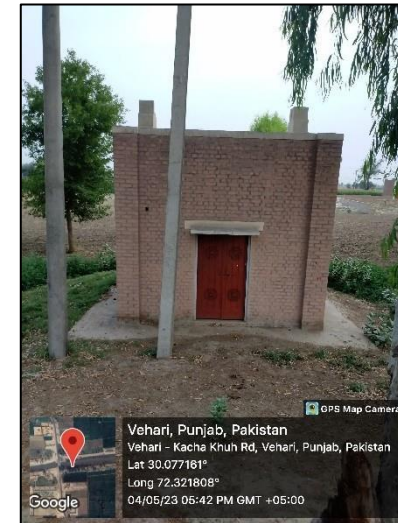Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1		Tube Well Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
Asset Detail				Pictures	
Name		24 WB Tube well #01			
Location	Latitude	30.077190			
	Longitude	72.321838			
Address		24 WB Pak Pattan Canal			
Area (Marla)		1			
Working Status		<b>Abandoned</b>			
Installation Year of Tube Well					
Installation Year of Pump					
Capital Cost of Machinery					
Operational Hours					
Delivery Pipe	Dia				
	Material				
Chlorinator		Yes	No		
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule	
Apron Around Pump House		Yes	No		
Hoisting Girder		Yes	No		
Civil Structure Condition		Good	Fair	Bad	
Approach to Pump House		Good	Fair	Bad	
Pump Details					
Pump Type					
Pump Make					
Discharge Capacity (Cusec)					
Rotational Speed (RPM)					
Housing Dia (inches)					
Bore Depth (ft.)					
Head (ft.)					
Impeller Installation Depth (ft.)					



Integrated Development and Asset Management Plan (IDAMP)							
Municipal Committee Vehari							
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023			
<b>Paint of Pumping Unit</b>							
<b>Number of Valves</b>	<b>Gate Valve</b>						
	<b>Non-Returning Valve</b>						
<b>Base Plate</b>	Yes	No					
<b>Electro-Mechanical Equipment Details</b>							
<b>Transformer Capacity (kVA)</b>							
<b>Sanctioned Load (Kwh)</b>							
<b>Motor Power (HP)</b>							
<b>Motor Make</b>							
<b>MCU</b>	Yes	No					
<b>Earthing of Motor</b>	Yes	No					
<b>Power Wiring</b>	Yes	No					
<b>Service Cable</b>	Yes	No					
<b>Earthing of MCU</b>	Yes	No					
<b>Energy Meter</b>	Yes	No					
<b>Water Meter</b>	Yes	No					
<b>PFI Equipment</b>	Yes	No					
<b>Generator</b>	Yes	No					
<b>Change Over</b>	Yes	No					
<b>Overall Rating</b>							
Average Score	1	2	3	4	5		
Asset Condition	Excellent	Good	Fair	Poor	Failing		
Category	A	B	C	D	E		
<b>Remarks / Requirements</b>							
<ul style="list-style-type: none"> <li>Pump room was empty</li> </ul>							



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 Sign & Date: 30 May 2023
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1	Tube Well Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		24 WB Tube well #05		
Location	Latitude	30.076961		
	Longitude	72.320475		
Address		24 WB Pak Pattan Canal		
Area (Marla)		1		
Working Status		<b>Abandoned</b>		
Installation Year of Tube Well				
Installation Year of Pump				
Capital Cost of Machinery				
Operational Hours				
Delivery Pipe	Dia			
	Material			
Chlorinator		Yes	No	
Chlorination Schedule		Once in a Year	After 6 Months	No Schedule
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Bad
Approach to Pump House		Good	Fair	Bad
Pump Details				
Pump Type				
Pump Make				
Discharge Capacity (Cusec)				
Rotational Speed (RPM)				
Housing Dia (inches)				
Bore Depth (ft.)				
Head (ft.)				
Impeller Installation Depth (ft.)				






Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Tube Well Asset Condition Assessment				Asset Code: _____ Date: 04-05-2023
Paint of Pumping Unit					
Number of Valves	Gate Valve				
	Non-Returning Valve				
Base Plate	Yes	No			
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)					
Sanctioned Load (Kwh)					
Motor Power (HP)					
Motor Make					
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>Pump room was empty</li> </ul>					



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A1	Tube Well Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
Data Collected By:	Designation:	 Sign & Date: 30 May 2023
Data Checked By:	Designation:	 Sign & Date: 30 May 2023

**B.**

### C. Filtration Plant

Sr #	Name	Age (Years)	Condition	Status	Book Value (PKR Million)	Type	Filtration Capacity (Liters/hour)
1	Anwarabad	10	Good	Functional	2.7	UF	2000
2	Grid Station	2	Good	Functional	3	RO	1000
3	Ayesha Park Danewal	2	Good	Functional	3	RO	1000
4	Officer Colony	6	Good	Functional	2.5	RO	1000
5	Tariq bin Ziad	15	Good	Functional	0.4	RO	1000
6	H-Block	21	Good	Functional	0.15	RO	1000
7	Chandni Chowk	7	Poor	Functional	2	RO	1000
8	DHQ	17	Good	Functional	0.34	UF	2000
9	Sharqi Colony	6	Good	Functional	2.5	RO	1000
10	Madina Colony	15	Good	Functional	0.4	RO	1000
11	Liaqat Pura	6	Good	Functional	2.5	RO	1000
12	X-Block	6	Good	Functional	2.5	RO	1000
13	Taimoor Shaheed Colony	6	Good	Functional	3.3	UF	2000
14	Railway Phatak	5	Good	Functional	3	RO	1000
15	College Town	7	Fair	Functional	2.2	RO	1000
16	Family Park	7	Fair	Functional	2.2	RO	1000
17	Chak 9/11	16	Fair	Functional	0.33	UF	2000
18	Makkah Town	17	Fair	Functional	0.3	RO	1000



Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023	
Name	Anwarabad		
Location	Latitude		30.051119
	Longitude		72.362667
Address	Anwarabad		
Installation Year	2012		
Installing Agency	MC		
O&M Agency	MC		
Filtration Capacity (Liter/Hour)	2275		
Operational Hours	24		
No. of Taps	07		
Effluent Test (If Available)	Not Available		
Latest water quality analysis carried out?	-		
If yes, which lab and parameters?	-		
Findings of water quality analysis?	-		
In case of any parameter above the permissible limit, which steps are taken to provide safe water?	-		
Plant Type	RO	UV	
Source of Water	Local Tube Well	Public Water Supply	
Working Status	Functional	Non-Functional	
Pumping Unit	Yes	No	
Control Panel	Yes	No	
Service Cable	Yes	No	


Integrated Development And Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment			Asset Code: _____	Date: 04-05-2023
<b>Ultraviolet Lamp/Chlorinator</b>	Yes	No			
<b>Takeaway Hall Condition</b>	Good	Fair	Poor		
<b>Building Structure Condition</b>	Good	Fair	Poor		
<b>Approach to Pump House</b>	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>		
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>		




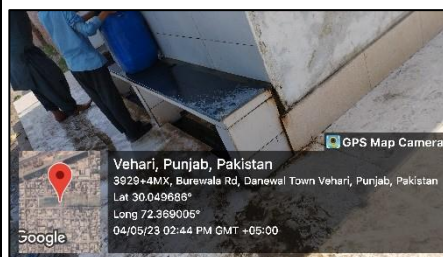
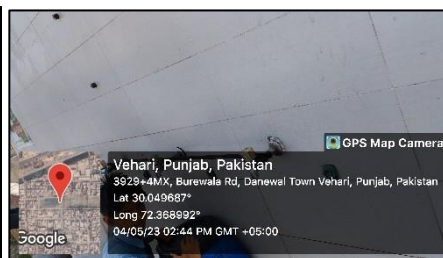
Integrated Development And Asset Management Plan (IDAMP)	
Municipal Committee Vehari	

Form: IDAMP-A4		Water Filtration Plant Asset Condition Assessment		Asset Code: _____
				Date: 04-05-2023
Name		Grid Station		
Location	Latitude	30.050747		
	Longitude	72.365126		
Address		Grid Station, Burewala Road		
Installation Year		2021		
Installing Agency		PCP		
O&M Agency		MC		
Filtration Capacity (Liter/Hour)		2275		
Operational Hours		6		
No. of Taps		6		
Effluent Test (If Available)		Not Available		
Latest water quality analysis carried out?		-		
If yes, which lab and parameters?		-		
Findings of water quality analysis?		-		
In case of any parameter above the permissible limit, which steps are taken to provide safe water?		-		
Plant Type	RO	UV		
Source of Water	Local Tube Well	Public Water Supply		
Working Status	Functional	Non-Functional		
Pumping Unit	Yes	No		
Control Panel	Yes	No		
Service Cable	Yes	No		
Ultraviolet Lamp/Chlorinator	Yes	No		
Takeaway Hall Condition	Good	Fair	Poor	
Building Structure Condition	Good	Fair	Poor	
Approach to Pump House	Good	Fair	Poor	


Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
No Remarks					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	



Integrated Development And Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
Name	Ayesha Park	Pictures
Location	Latitude	30.049687
	Longitude	72.368992
Address	Ayesha Park, Danewal	
Installation Year	2021	
Installing Agency	PCP	
O&M Agency	MC	
Filtration Capacity (Liter/Hour)	2275	
Operational Hours	8	
No. of Taps	6	
Effluent Test (If Available)	Not Available	
		




Latest water quality analysis carried out?	-				
If yes, which lab and parameters?	-				
Findings of water quality analysis?	-				
In case of any parameter above the permissible limit, which steps are taken to provide safe water?	-				
Plant Type	RO	UV			
Source of Water	Local Tube Well	Public Water Supply			
Working Status	Functional	Non-Functional			
Pumping Unit	Yes	No			
Control Panel	Yes	No			
Service Cable	Yes	No			
Ultraviolet Lamp/Chlorinator	Yes	No			
Takeaway Hall Condition	Good	Fair	Poor		
Building Structure Condition	Good	Fair	Poor		
Approach to Pump House	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
Data Collected By: Mr. Abdullah	Designation: Team Member		 Sign & Date: 30 May 2023		



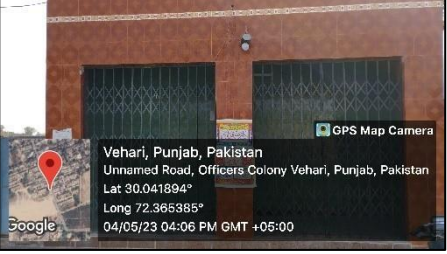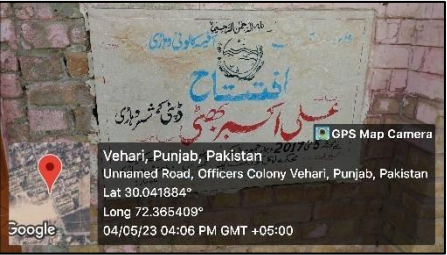

Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023
------------------------------	------------------------	---



Integrated Development And Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<b>Name</b>	Officer colony	<div style="text-align: center; background-color: #c8e6c9; padding: 5px;"><b>Pictures</b></div>  
<b>Location</b>		
<b>Latitude</b>	30.041854	
<b>Longitude</b>	72.365362	
<b>Address</b>	Officer colony, Vehari	
<b>Installation Year</b>	2017	
<b>Installing Agency</b>	Local Govt.	
<b>O&amp;M Agency</b>	MC	
<b>Filtration Capacity (Liter/Hour)</b>	2275	
<b>Operational Hours</b>	6	
<b>No. of Taps</b>	8	
<b>Effluent Test (If Available)</b>	Not Available	
<b>Latest water quality analysis carried out?</b>	-	
<b>If yes, which lab and parameters?</b>	-	
<b>Findings of water quality analysis?</b>	-	
<b>In case of any parameter above the permissible limit, which steps are taken to provide safe water?</b>	-	
<b>Plant Type</b>	RO      UV	


Source of Water	Local Tube Well	Public Water Supply			
Working Status	Functional	Non-Functional			
Pumping Unit	Yes	No			
Control Panel	Yes	No			
Service Cable	Yes	No			
Ultraviolet Lamp/Chlorinator	Yes	No			
Takeaway Hall Condition	Good	Fair			
Building Structure Condition	Good	Fair	Poor		
Approach to Pump House	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

<b>Integrated Development And Asset Management Plan (IDAMP)</b>					
<b>Municipal Committee Vehari</b>					
Form: IDAMP-A4		Water Filtration Plant Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
Name		Tariq bin Ziad Colony		<b>Pictures</b>	
Location	Latitude	30.042919			

	Longitude	72.371854			
Address	Tariq bin Ziad Colony, Vehari				
Installation Year	2008				
Installing Agency	Local Govt.				
O&M Agency	MC				
Filtration Capacity (Liter/Hour)	2275				
Operational Hours	6				
No. of Taps	6				
Effluent Test (If Available)	Not Available				
Latest water quality analysis carried out?	-				
If yes, which lab and parameters?	-				
Findings of water quality analysis?	-				
In case of any parameter above the permissible limit, which steps are taken to provide safe water?	-				
Plant Type	RO	UV			
Source of Water	Local Tube Well	Public Water Supply			
Working Status	Functional	Non-Functional			
Pumping Unit	Yes	No			
Control Panel	Yes	No			
Service Cable	Yes	No			
Ultraviolet Lamp/Chlorinator	Yes	No			
Takeaway Hall Condition	Good	Fair	Poor		
Building Structure Condition	Good	Fair	Poor		
Approach to Pump House	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E





Remarks / Requirements		
No Remarks		
Data Collected By: Mr. Abdullah	Designation: Team Member	 Sign & Date: 30 May 2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023	
Name	H-Block	<div style="background-color: #d9ead3; padding: 5px; border: 1px solid black;"> <b>Pictures</b> </div> 	
Location	Latitude		30.044999
	Longitude		72.361593
Address	H-Block, Vehari		
Installation Year	2002 (Upgradation 2022)		
Installing Agency	MC		
O&M Agency	MC		
Filtration Capacity (Liter/Hour)	2275		
Operational Hours	6		
No. of Taps	6		
Effluent Test (If Available)	Not Available		
Latest water quality analysis carried out?	-		
If yes, which lab and parameters?	-		

Findings of water quality analysis?	-				
In case of any parameter above the permissible limit, which steps are taken to provide safe water?	-				
Plant Type	RO	UV			
Source of Water	Local Tube Well	Public Water Supply			
Working Status	Functional	Non-Functional			
Pumping Unit	Yes	No			
Control Panel	Yes	No			
Service Cable	Yes	No			
Ultraviolet Lamp/Chlorinator	Yes	No			
Takeaway Hall Condition	Good	Fair	Poor		
Building Structure Condition	Good	Fair	Poor		
Approach to Pump House	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					





---

<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>


Integrated Development And Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
<b>Name</b>		Chandni Chowk
<b>Location</b>	<b>Latitude</b>	30.044762
	<b>Longitude</b>	72.361417
<b>Address</b>		Chandni Chowk, Vehari
<b>Installation Year</b>		2016
<b>Installing Agency</b>		Local Govt.
<b>O&amp;M Agency</b>		MC
<b>Filtration Capacity (Liter/Hour)</b>		2275
<b>Operational Hours</b>		24
<b>No. of Taps</b>		7
<b>Effluent Test (If Available)</b>		Not Available
<b>Latest water quality analysis carried out?</b>		-
<b>If yes, which lab and parameters?</b>		-
<b>Findings of water quality analysis?</b>		-
<b>In case of any parameter above the permissible limit, which steps are taken to provide safe water?</b>		-
<b>Plant Type</b>	RO	UV
<b>Source of Water</b>	Local Tube Well	Public Water Supply
<b>Working Status</b>	Functional	Non-Functional
<b>Pumping Unit</b>	Yes	No
<b>Control Panel</b>	Yes	No
<b>Service Cable</b>	Yes	No
<b>Ultraviolet Lamp/Chlorinator</b>	Yes	No





<b>Takeaway Hall Condition</b>	Good	Fair	Poor	
<b>Building Structure Condition</b>	Good	Fair	Poor	
<b>Approach to Pump House</b>	Good	Fair	Poor	
<b>Overall Rating</b>				
Average Score	1	2	3	4
Asset Condition	Excellent	Good	Fair	Poor
Category	A	B	C	D
<b>Remarks / Requirements</b>				
No Remarks				
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>	



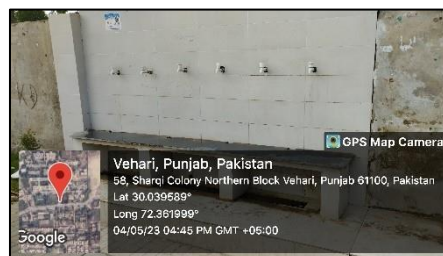

Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Name		DHQ	
Location	Latitude	30.039589	
	Longitude	72.361999	
Address		DHQ, Vehari	
Installation Year		2006	
Installing Agency		Building Department	
O&M Agency		MC	
Filtration Capacity (Liter/Hour)		2275	
Operational Hours		24	
No. of Taps		6	
Effluent Test (If Available)		Not Available	
Latest water quality analysis carried out?		-	
If yes, which lab and parameters?		-	
Findings of water quality analysis?		-	
In case of any parameter above the permissible limit, which steps are taken to provide safe water?		-	
Plant Type	RO	UV	
Source of Water	Local Tube Well	Public Water Supply	
Working Status	Functional	Non-Functional	
Pumping Unit	Yes	No	
Control Panel	Yes	No	
Service Cable	Yes	No	
Ultraviolet Lamp/Chlorinator	Yes	No	
Takeaway Hall Condition	Good	Fair	Poor


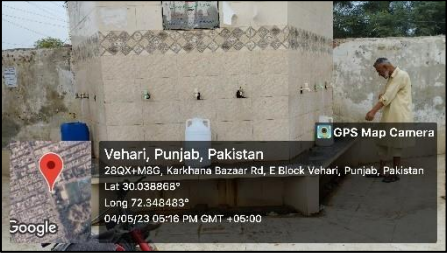




<b>Building Structure Condition</b>	Good	Fair	Poor		
<b>Approach to Pump House</b>	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
<b>Name</b>		Sharqi Colony	
<b>Location</b>	<b>Latitude</b>	30.036671	
	<b>Longitude</b>	72.360607	
<b>Address</b>		Sharqi Colony, Vehari	
<b>Installation Year</b>		2017	
<b>Installing Agency</b>		MC	
<b>O&amp;M Agency</b>		MC	
<b>Filtration Capacity (Liter/Hour)</b>		2275	
<b>Operational Hours</b>		6	
<b>No. of Taps</b>		6	
<b>Effluent Test (If Available)</b>		Not Available	
<b>Latest water quality analysis carried out?</b>		-	
<b>If yes, which lab and parameters?</b>		-	
<b>Findings of water quality analysis?</b>		-	
<b>In case of any parameter above the permissible limit, which steps are taken to provide safe water?</b>		-	
<b>Plant Type</b>	RO	UV	
<b>Source of Water</b>	Local Tube Well	Public Water Supply	
<b>Working Status</b>	Functional	Non-Functional	
<b>Pumping Unit</b>	Yes	No	
<b>Control Panel</b>	Yes	No	
<b>Service Cable</b>	Yes	No	
<b>Ultraviolet Lamp/Chlorinator</b>	Yes	No	
<b>Takeaway Hall Condition</b>	Good	Fair	Poor




<b>Building Structure Condition</b>	Good	Fair	Poor		
<b>Approach to Pump House</b>	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	



Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
<b>Name</b>		Madina Colony	
<b>Location</b>	<b>Latitude</b>	30.038923	
	<b>Longitude</b>	72.348545	
<b>Address</b>		Madina Colony, Vehari	
<b>Installation Year</b>		2008	
<b>Installing Agency</b>		MC	
<b>O&amp;M Agency</b>		MC	
<b>Filtration Capacity (Liter/Hour)</b>		2275	
<b>Operational Hours</b>		6	
<b>No. of Taps</b>		9	
<b>Effluent Test (If Available)</b>		Not Available	
<b>Latest water quality analysis carried out?</b>		-	
<b>If yes, which lab and parameters?</b>		-	
<b>Findings of water quality analysis?</b>		-	
<b>In case of any parameter above the permissible limit, which steps are taken to provide safe water?</b>		-	
<b>Plant Type</b>	RO	UV	
<b>Source of Water</b>	Local Tube Well	Public Water Supply	
<b>Working Status</b>	Functional	Non-Functional	
<b>Pumping Unit</b>	Yes	No	
<b>Control Panel</b>	Yes	No	
<b>Service Cable</b>	Yes	No	
<b>Ultraviolet Lamp/Chlorinator</b>	Yes	No	
		<b>Pictures</b>	
			
			

<b>Takeaway Hall Condition</b>	Good	Fair	Poor		
<b>Building Structure Condition</b>	Good	Fair	Poor		
<b>Approach to Pump House</b>	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

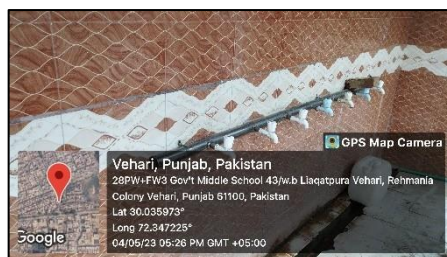

Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4		Water Filtration Plant Asset Condition Assessment	
		Asset Code: _____	
		Date: 04-05-2023	
Name		Liaqat Pura	
Location	Latitude	30.035973	
	Longitude	72.347225	
Address		School #02, Vehari	
Installation Year		2017	
Installing Agency		MC	
O&M Agency		MC	
Filtration Capacity (Liter/Hour)		2275	
Operational Hours		6	
No. of Taps		7	
Effluent Test (If Available)		Not Available	
Latest water quality analysis carried out?		-	
If yes, which lab and parameters?		-	
Findings of water quality analysis?		-	
In case of any parameter above the permissible limit, which steps are taken to provide safe water?		-	
Plant Type	RO	UV	
Source of Water	Local Tube Well	Public Water Supply	
Working Status	Functional	Non-Functional	
Pumping Unit	Yes	No	
Control Panel	Yes	No	
Service Cable	Yes	No	





<b>Ultraviolet Lamp/Chlorinator</b>	Yes		No		
<b>Takeaway Hall Condition</b>	Good	Fair	Poor		
<b>Building Structure Condition</b>	Good	Fair	Poor		
<b>Approach to Pump House</b>	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>	




Integrated Development And Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
Name	X-Block	
Location	Latitude	30.038534
	Longitude	72.337340
Address	X-Block, Taimoor Shaheed Colony	
Installation Year	2017	
Installing Agency	Local Community	
O&M Agency	MC	
Filtration Capacity (Liter/Hour)	2275	
Operational Hours	6	
No. of Taps	7	
Effluent Test (If Available)	Not Available	
Latest water quality analysis carried out?	-	
If yes, which lab and parameters?	-	
Findings of water quality analysis?	-	
In case of any parameter above the permissible limit, which steps are taken to provide safe water?	-	
Plant Type	RO	UV
Source of Water	Local Tube Well	Public Water Supply
Working Status	Functional	Non-Functional
Pumping Unit	Yes	No
Control Panel	Yes	No
Service Cable	Yes	No
Ultraviolet Lamp/Chlorinator	Yes	No


## Pictures






<b>Takeaway Hall Condition</b>	Good	Fair	Poor		
<b>Building Structure Condition</b>	Good	Fair	Poor		
<b>Approach to Pump House</b>	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	




Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4		Water Filtration Plant Asset Condition Assessment	
		Asset Code: _____	
		Date: 04-05-2023	
<b>Name</b>		Taimoor Shaheed Colony	
<b>Location</b>	<b>Latitude</b>	30.036656	
	<b>Longitude</b>	72.333155	
<b>Address</b>		Taimoor Shaheed Colony, Vehari	
<b>Installation Year</b>		2017	
<b>Installing Agency</b>		MC	
<b>O&amp;M Agency</b>		MC	
<b>Filtration Capacity (Liter/Hour)</b>		2275	
<b>Operational Hours</b>		24	
<b>No. of Taps</b>		9	
<b>Effluent Test (If Available)</b>		Not Available	
<b>Latest water quality analysis carried out?</b>		-	
<b>If yes, which lab and parameters?</b>		-	
<b>Findings of water quality analysis?</b>		-	
<b>In case of any parameter above the permissible limit, which steps are taken to provide safe water?</b>		-	
<b>Plant Type</b>	RO	UV	
<b>Source of Water</b>	Local Tube Well	Public Water Supply	
<b>Working Status</b>	Functional	Non-Functional	
<b>Pumping Unit</b>	Yes	No	
<b>Control Panel</b>	Yes	No	
<b>Service Cable</b>	Yes	No	
<b>Ultraviolet Lamp/Chlorinator</b>	Yes	No	







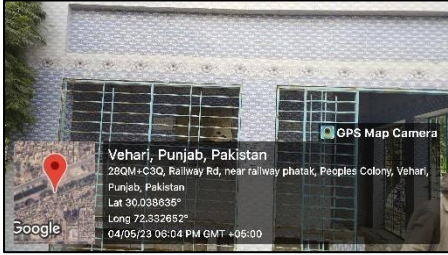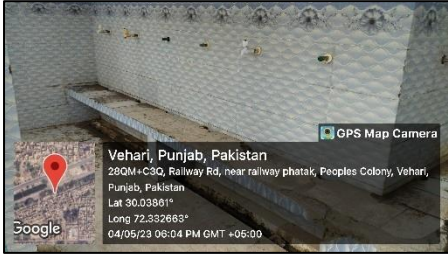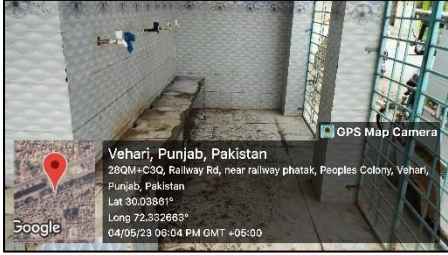

<b>Takeaway Hall Condition</b>	Good	Fair	Poor		
<b>Building Structure Condition</b>	Good	Fair	Poor		
<b>Approach to Pump House</b>	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>	

Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
<b>Name</b>		Railway Phatak	
<b>Location</b>	<b>Latitude</b>	30.038610	
	<b>Longitude</b>	72.332663	
<b>Address</b>		Railway Phatak, Vehari	
<b>Installation Year</b>		2018	
<b>Installing Agency</b>		MC	
<b>O&amp;M Agency</b>		MC	
<b>Filtration Capacity (Liter/Hour)</b>		2275	
<b>Operational Hours</b>		6	
<b>No. of Taps</b>		11	
<b>Effluent Test (If Available)</b>		Not Available	
<b>Latest water quality analysis carried out?</b>		-	
<b>If yes, which lab and parameters?</b>		-	
<b>Findings of water quality analysis?</b>		-	
<b>In case of any parameter above the permissible limit, which steps are taken to provide safe water?</b>		-	
<b>Plant Type</b>	RO	UV	
<b>Source of Water</b>	Local Tube Well	Public Water Supply	
<b>Working Status</b>	Functional	Non-Functional	
<b>Pumping Unit</b>	Yes	No	
<b>Control Panel</b>	Yes	No	
<b>Service Cable</b>	Yes	No	
		<b>Pictures</b>	
			
			
			



<b>Ultraviolet Lamp/Chlorinator</b>	Yes		No		
<b>Takeaway Hall Condition</b>	Good	Fair	Poor		
<b>Building Structure Condition</b>	Good	Fair	Poor		
<b>Approach to Pump House</b>	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>	




Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
<b>Form:</b> IDAMP-A4	<b>Water Filtration Plant</b> Asset Condition Assessment		<b>Asset Code:</b> _____ <b>Date:</b> 04-05-2023
<b>Name</b>	College Town		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.044046	
	<b>Longitude</b>	72.335992	
<b>Address</b>	College Town, Vehari		



Installation Year	2016 (Upgradation 2020)				
Installing Agency	MC				
O&M Agency	MC				
Filtration Capacity (Liter/Hour)	2275				
Operational Hours	6				
No. of Taps	6				
Effluent Test (If Available)	Not Available				
Latest water quality analysis carried out?	-				
If yes, which lab and parameters?	-				
Findings of water quality analysis?	-				
In case of any parameter above the permissible limit, which steps are taken to provide safe water?	-				
Plant Type	RO	UV			
Source of Water	Local Tube Well	Public Water Supply			
Working Status	Functional	Non-Functional			
Pumping Unit	Yes	No			
Control Panel	Yes	No			
Service Cable	Yes	No			
Ultraviolet Lamp/Chlorinator	Yes	No			
Takeaway Hall Condition	Good	Fair	Poor		
Building Structure Condition	Good	Fair	Poor		
Approach to Pump House	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					






No Remarks		
Data Collected By: Mr. Abdullah	Designation: Team Member	 Sign & Date: 30 May 2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023



Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023	
Name	Family Park		
Location	Latitude		30.046777
	Longitude		72.342252
Address	Famioly Park, Vehari		
Installation Year	2016		
Installing Agency	Local Govt.		
O&M Agency	MC		
Filtration Capacity (Liter/Hour)	2275		
Operational Hours	6		
No. of Taps	8		
Effluent Test (If Available)	Not Available		
Latest water quality analysis carried out?	-		
If yes, which lab and parameters?	-		



Findings of water quality analysis?	-				
In case of any parameter above the permissible limit, which steps are taken to provide safe water?	-				
Plant Type	RO	UV			
Source of Water	Local Tube Well	Public Water Supply			
Working Status	Functional	Non-Functional			
Pumping Unit	Yes	No			
Control Panel	Yes	No			
Service Cable	Yes	No			
Ultraviolet Lamp/Chlorinator	Yes	No			
Takeaway Hall Condition	Good	Fair	Poor		
Building Structure Condition	Good	Fair	Poor		
Approach to Pump House	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
Data Collected By: Mr. Abdullah	Designation: Team Member		 Sign & Date: 30 May 2023		
Data Checked By: Mr. M. Fiaz	Designation: Team Lead		 Sign & Date: 30 May 2023		





Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A4	Water Filtration Plant Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Name	Chak 9/11		<div style="text-align: center;"><b>Pictures</b></div>   
Location	Latitude	30.052262	
	Longitude	72.345911	
Address	Chak 9/11, Vehari		
Installation Year	2007		
Installing Agency	MC		
O&M Agency	MC		
Filtration Capacity (Liter/Hour)	2275		
Operational Hours	24		
No. of Taps	9		
Effluent Test (If Available)	Not Available		
Latest water quality analysis carried out?	-		
If yes, which lab and parameters?	-		
Findings of water quality analysis?	-		
In case of any parameter above the permissible limit, which steps are taken to provide safe water?	-		
Plant Type	RO	UV	
Source of Water	Local Tube Well	Public Water Supply	
Working Status	Functional	Non-Functional	
Pumping Unit	Yes	No	
Control Panel	Yes	No	

Service Cable	Yes		No		
Ultraviolet Lamp/Chlorinator	Yes		No		
Takeaway Hall Condition	Good	Fair	Poor		
Building Structure Condition	Good	Fair	Poor		
Approach to Pump House	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

Integrated Development And Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A4		Water Filtration Plant Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
Name		Makkah Town		Pictures	
Location	Latitude	30.057818			
	Longitude	72.343563			
Address		Makkah Town, Vehari			
Installation Year		2006 (Renovation 2020)			


Installing Agency	MC				
O&M Agency	MC				
Filtration Capacity (Liter/Hour)	2275				
Operational Hours	6				
No. of Taps	9				
Effluent Test (If Available)	Not Available				
Latest water quality analysis carried out?	-				
If yes, which lab and parameters?	-				
Findings of water quality analysis?	-				
In case of any parameter above the permissible limit, which steps are taken to provide safe water?	-				
Plant Type	RO	UV			
Source of Water	Local Tube Well	Public Water Supply			
Working Status	Functional	Non-Functional			
Pumping Unit	Yes	No			
Control Panel	Yes	No			
Service Cable	Yes	No			
Ultraviolet Lamp/Chlorinator	Yes	No			
Takeaway Hall Condition	Good	Fair	Poor		
Building Structure Condition	Good	Fair	Poor		
Approach to Pump House	Good	Fair	Poor		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					






Data Collected By: Mr. Abdullah	Designation: Team Member	 Sign & Date: 30 May 2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

#### D. OHR

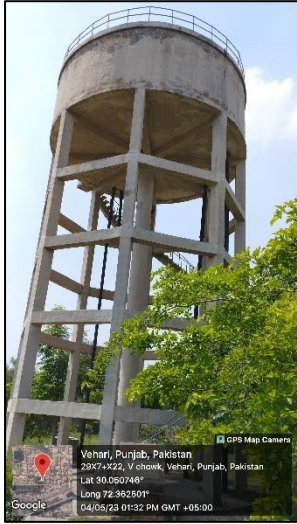Sr #	Name	Age (Years)	Condition	Status	Book Value (PKR Million)	Capacity
1	Anwarabad	16	Fair	Functional	1.4	50,000
2	Water Works H-Block Main City	61	Poor	Functional	0	50,000
3	Sharqi Colony	31	Poor	Functional	0	30,000
4	Water Works Madina Colony	25	Fair	Functional	0.85	50,000
5	Water Works Taimoor Shaheed Colony	47	Poor	Functional	0	100,000
6	Water Works College Town	12	Good	Functional	4	125,000
7	Water Works Chak 9/11	43	Fair	Functional	0	100,000

Integrated Development And Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A2		Over Head Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
Name		Anwarabad		<div style="text-align: center;">  </div>	
Location	Latitude	30.050903			
	Longitude	72.362477			
Address		Anwarabad, Vehari			
Year of Construction		2007			
Capacity (UK Gallons)		50,000			
Cleaning Frequency (Per Year)		Nil			
Type of Structure		Frame			
Structure Condition		Good	Fair		Poor
Tank Conditions		Good	Fair		Poor
Number of Valves	Sluice Valve	4			
	Non-Returning Valve	1			
Working Status		Functional	Non-Functional		
Rising Main	Dia	8"			
	Material	MS			
Delivery Main	Dia	8"			
	Material	MS			
Overflow & Scour Pipe	Dia	6"			
	Material	MS			
Sluice Valve	Rising Main	Yes	No		
	Delivery Main	Yes	No		
	Scour Pipe	Yes	No		
	Overflow Pipe	Yes	No		
Stair Case		Yes	No		
Apron Around OHR		Yes	No		
Tank Top Railing		Yes	No		
Top Indication Light		Yes	No		


Integrated Development And Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A2	Over Head Reservoir Asset Condition Assessment			Asset Code: _____	Date: 04-05-2023
Lightening Arrester	Yes	No			
Boundary Wall & Gate	Yes	No			
Overflow Disposal Arrangements	Yes	No			
Approach to OHR	Good	Fair	Bad		
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	

Integrated Development And Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A2	Over Head Reservoir Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023



Integrated Development And Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A2	Over Head Reservoir Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
Name	Water Works H- Block	Pictures
Location	Latitude	30.045282
	Longitude	72.361868
Address	H-Block main city, Vehari	
Year of Construction	1962	
Capacity (UK Gallons)	50,000	
Cleaning Frequency (Per Year)	Nil	
Type of Structure	Masonry	
Structure Condition	Good	Fair
Tank Conditions	Good	Fair
Number of Valves	Sluice Valve	4
	Non-Returning Valve	1
Working Status	Functional	Non-Functional
Rising Main	Dia	8"





Integrated Development And Asset Management Plan (IDAMP)					
	<b>Material</b>	MS			
<b>Delivery Main</b>	<b>Dia</b>	8"			
	<b>Material</b>	MS			
<b>Overflow &amp; Scour Pipe</b>	<b>Dia</b>	8"			
	<b>Material</b>	MS			
<b>Sluice Valve</b>	<b>Rising Main</b>	Yes	No		
	<b>Delivery Main</b>	Yes	No		
	<b>Scour Pipe</b>	Yes	No		
	<b>Overflow Pipe</b>	Yes	No		
<b>Stair Case</b>	Yes	No			
<b>Apron Around OHR</b>	Yes	No			
<b>Tank Top Railing</b>	Yes	No			
<b>Top Indication Light</b>	Yes	No			
<b>Lightening Arrester</b>	Yes	No			
<b>Boundary Wall &amp; Gate</b>	Yes	No			
<b>Overflow Disposal Arrangements</b>	Yes	No			
<b>Approach to OHR</b>	Good	Fair	Bad		
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>	



Integrated Development And Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A2		Over Head Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
Name		Sharqi Colony			
Location	Latitude	30.036469			
	Longitude	72.360748			
Address		Sharqi Colony, Vehari			
Year of Construction		1991			
Capacity (UK Gallons)		30,000			
Cleaning Frequency (Per Year)		Nil			
Type of Structure		Frame			
Structure Condition		Good	Fair		Poor
Tank Conditions		Good	Fair		Poor
Number of Valves	Sluice Valve	4			
	Non-Returning Valve	1			
Working Status		Functional	Non-Functional		
Rising Main	Dia	8"			
	Material	MS			
Delivery Main	Dia	8"			
	Material	MS			
Overflow & Scour Pipe	Dia	6"			
	Material	MS			
Sluice Valve	Rising Main	Yes	No		
	Delivery Main	Yes	No		
	Scour Pipe	Yes	No		
	Overflow Pipe	Yes	No		
Stair Case		Yes	No		
Apron Around OHR		Yes	No		
Tank Top Railing		Yes	No		
Top Indication Light		Yes	No		

Integrated Development And Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A2	Over Head Reservoir Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Lightening Arrester	Yes	No			
Boundary Wall & Gate	Yes	No			
Overflow Disposal Arrangements	Yes	No			
Approach to OHR	Good	Fair	Bad		
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	


Integrated Development And Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A2	Over Head Reservoir Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Name		Water Works Madina Colony		Pictures	
Location	Latitude	30.036647			



	Longitude	72.360803			
Address		Madina Colony, Vehari			
Year of Construction		1998			
Capacity (UK Gallons)		50,000			
Cleaning Frequency (Per Year)		Nil			
Type of Structure		Frame			
Structure Condition		Good	Fair	Poor	
Tank Conditions		Good	Fair	Poor	
Number of Valves	Sluice Valve	4			
	Non-Returning Valve	1			
Working Status		Functional	Non-Functional		
Rising Main	Dia	12"			
	Material	MS			
Delivery Main	Dia	12"			
	Material	MS			
Overflow & Scour Pipe	Dia	8"			
	Material	MS			
Sluice Valve	Rising Main	Yes	No		
	Delivery Main	Yes	No		
	Scour Pipe	Yes	No		
	Overflow Pipe	Yes	No		
Stair Case		Yes	No		
Apron Around OHR		Yes	No		
Tank Top Railing		Yes	No		
Top Indication Light		Yes	No		
Lightening Arrester		Yes	No		
Boundary Wall & Gate		Yes	No		
Overflow Disposal Arrangements		Yes	No		
Approach to OHR		Good	Fair	Bad	
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing



Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>	

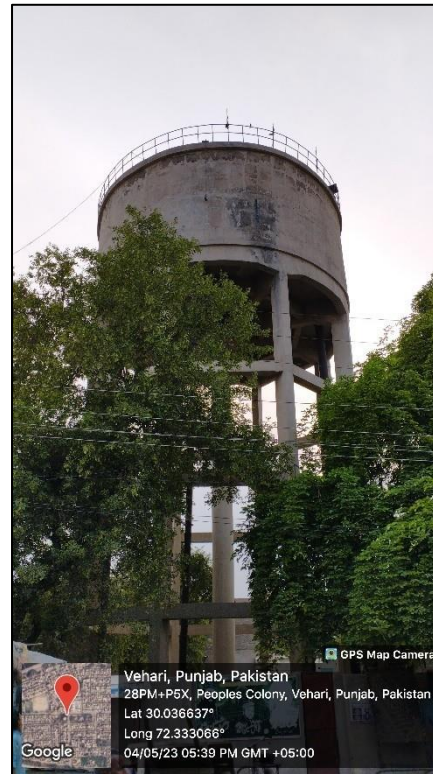Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A2		Over Head Reservoir Asset Condition Assessment	
		Asset Code: _____ Date: 04-05-2023	
Name		Water Works Taimoor Shaheed Colony	
Location	Latitude	30.036637	
	Longitude	72.333066	
Address		Taimoor Shaheed Colony, Vehari	
Year of Construction		1976	
Capacity (UK Gallons)		100,000	
Cleaning Frequency (Per Year)		Nil	
Type of Structure		Frame	
Structure Condition		Good	Fair
Tank Conditions		Good	Fair
Number of Valves	Sluice Valve	4	
	Non-Returning Valve	1	
Working Status		Functional	Non-Functional
Rising Main	Dia	12"	
	Material	MS	
Delivery Main	Dia	16"	
	Material	MS	
Overflow & Scour Pipe	Dia	8"	
	Material	MS	
Sluice Valve	Rising Main	Yes	No
	Delivery Main	Yes	No
	Scour Pipe	Yes	No
	Overflow Pipe	Yes	No
Stair Case		Yes	No
Apron Around OHR		Yes	No
Tank Top Railing		Yes	No





<b>Top Indication Light</b>	Yes	No			
<b>Lightening Arrester</b>	Yes	No			
<b>Boundary Wall &amp; Gate</b>	Yes	No			
<b>Overflow Disposal Arrangements</b>	Yes	No			
<b>Approach to OHR</b>	Good	Fair	Bad		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	


Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
<b>Form:</b> IDAMP-A2	<b>Over Head Reservoir</b> Asset Condition Assessment		<b>Asset Code:</b> _____ <b>Date:</b> 04-05-2023
<b>Name</b>	Water Works College Town		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.045154	
	<b>Longitude</b>	72.339086	
<b>Address</b>	College Town, Vehari		
<b>Year of Construction</b>	2011		
<b>Capacity (UK Gallons)</b>	125,000		



Cleaning Frequency (Per Year)		Nil			
Type of Structure		Frame			
Structure Condition		Good	Fair	Poor	
Tank Conditions		Good	Fair	Poor	
Number of Valves	Sluice Valve	4			
	Non-Returning Valve	1			
Working Status		Functional	Non-Functional		
Rising Main	Dia	12"			
	Material	MS			
Delivery Main	Dia	12"			
	Material	MS			
Overflow & Scour Pipe	Dia	8"			
	Material	MS			
Sluice Valve	Rising Main	Yes	No		
	Delivery Main	Yes	No		
	Scour Pipe	Yes	No		
	Overflow Pipe	Yes	No		
Stair Case		Yes	No		
Apron Around OHR		Yes	No		
Tank Top Railing		Yes	No		
Top Indication Light		Yes	No		
Lightening Arrester		Yes	No		
Boundary Wall & Gate		Yes	No		
Overflow Disposal Arrangements		Yes	No		
Approach to OHR		Good	Fair	Bad	
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					




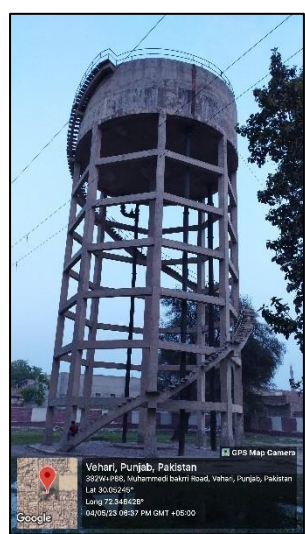

Data Collected By: Mr. Abdullah	Designation: Team Member	 Sign & Date: 30 May 2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023


Integrated Development And Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A2	Over Head Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Name		Water Works 9/11 Chak	
Location	Latitude	30.052549	
	Longitude	72.346497	
Address		Chak 9/11, Vehari	
Year of Construction		1980	
Capacity (UK Gallons)		100,000	
Cleaning Frequency (Per Year)		Nil	
Type of Structure		Frame	
Structure Condition		Good <input type="checkbox"/> Fair <input checked="" type="checkbox"/> Poor <input type="checkbox"/>	
Tank Conditions		Good <input type="checkbox"/> Fair <input checked="" type="checkbox"/> Poor <input type="checkbox"/>	
Number of Valves	Sluice Valve	4	
	Non-Returning Valve	1	
Working Status		Functional <input checked="" type="checkbox"/> Non-Functional <input type="checkbox"/>	
Rising Main	Dia	10"	
	Material	MS	
Delivery Main	Dia	12"	

	<b>Material</b>	MS			
<b>Overflow &amp; Scour Pipe</b>	<b>Dia</b>	10"			
	<b>Material</b>	MS			
<b>Sluice Valve</b>	<b>Rising Main</b>	Yes	No		
	<b>Delivery Main</b>	Yes	No		
	<b>Scour Pipe</b>	Yes	No		
	<b>Overflow Pipe</b>	Yes	No		
<b>Stair Case</b>	Yes	No			
<b>Apron Around OHR</b>	Yes	No			
<b>Tank Top Railing</b>	Yes	No			
<b>Top Indication Light</b>	Yes	No			
<b>Lightening Arrester</b>	Yes	No			
<b>Boundary Wall &amp; Gate</b>	Yes	No			
<b>Overflow Disposal Arrangements</b>	Yes	No			
<b>Approach to OHR</b>	Good	Fair	Bad		
<b>Overall Rating</b>					
<b>Average Score</b>	1	2	3	4	5
<b>Asset Condition</b>	Excellent	Good	Fair	Poor	Failing
<b>Category</b>	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>		
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>		

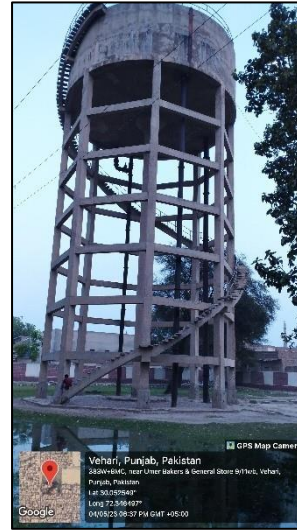



### E. GST

Sr #	Name	Age (Years)	Condition	Status	Book Value (PKR Million)	Capacity
1	Anwarabad 01	16	Good	Functional	0.4	25,000
2	Anwarabad 02	16	Good	Functional	0.4	25,000
3	Water Works H-Block 01	47	Fair	Functional	0	80,000
4	Water Works H-Block 02	15	Fair	Functional	2	100,000
5	Sharqi Colony	32	Fair	Functional	0.1	30,000
6	Water Works Madina Colony	3	Good	Functional	4.5	150,000
7	Water Works Taimoor Shaheed Colony	27	Fair	Functional	0.6	125,000
8	Water Works College Town	12	Good	Functional	1.5	80,000
9	Water Works Chak 9/11 01	43	Fair	Functional	0	50,000
10	Water Works Chak 9/11 02	43	Fair	Functional	0	50,000


Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023		
<b>Name</b>		Anwarabad 01		<b>Pictures</b>		
<b>Location</b>	<b>Latitude</b>	30.050737				
	<b>Longitude</b>	72.362538				
<b>Address</b>		Anwarabad, Vehari				
<b>Year of Construction</b>		2007				
<b>Capacity (UK Gallons)</b>		25,000				
<b>Cleaning Frequency (Per Year)</b>		Nil				
<b>Type of Structure</b>		Masonry				
<b>Structure Condition</b>		Good	Fair			Bad
<b>Number of Valves</b>	<b>Sluice Valve</b>	1				
	<b>Non-Returning Valve</b>	0				
<b>Working Status</b>		Functional	Non-Functional			
<b>Incoming Main</b>	<b>Dia</b>	6"				
	<b>Material</b>	MS				
<b>Delivery Main</b>	<b>Dia</b>	8"				
	<b>Material</b>	MS				
<b>Cover Slab Condition</b>		Good	Fair	Poor		
<b>Approach Road Condition</b>		Good	Fair	Poor		
<b>Boundary Wall &amp; Gate</b>		Yes	No			
<b>Overall Rating</b>						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
<b>Remarks / Requirements</b>						
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>						



---

<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>

Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023		
Name		Anwarabad 02		Pictures		
Location	Latitude	30.050717				
	Longitude	72.362552				
Address		Anwarabad, Vehari				
Year of Construction		2007				
Capacity (UK Gallons)		25,000				
Cleaning Frequency (Per Year)		Nil				
Type of Structure		Masonry				
Structure Condition		Good	Fair			Bad
Number of Valves	Sluice Valve	1				
	Non-Returning Valve	0				
Working Status		Functional	Non-Functional			
Incoming Main	Dia	6"				
	Material	MS				
Delivery Main	Dia	8"				
	Material	MS				
Cover Slab Condition		Good	Fair	Poor		
Approach Road Condition		Good	Fair	Poor		
Boundary Wall & Gate		Yes	No			
Overall Rating						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
Remarks / Requirements						
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>						


---


<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>

Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023		
Name		Water Works H-Block 01		Pictures		
Location	Latitude	30.046054				
	Longitude	72.361718				
Address		H-Block main city, Vehari				
Year of Construction		1976				
Capacity (UK Gallons)		80,000				
Cleaning Frequency (Per Year)		Nil				
Type of Structure		Masonry				
Structure Condition		Good	Fair			Bad
Number of Valves	Sluice Valve	4				
	Non-Returning Valve	2				
Working Status		Functional	Non-Functional			
Incoming Main	Dia	8"				
	Material	MS				
Delivery Main	Dia	8"				
	Material	MS				
Cover Slab Condition		Good	Fair			Poor
Approach Road Condition		Good	Fair	Poor		
Boundary Wall & Gate		Yes	No			
<b>Overall Rating</b>						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
<b>Remarks / Requirements</b>						
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>						




---

Data Collected By: Mr. Abdullah	Designation: Team Member	 Sign & Date: 30 May 2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023


Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023		
Name		Water Works H-Block 02		Pictures		
Location	Latitude	30.045569				
	Longitude	72.361632				
Address		H-Block main city, Vehari				
Year of Construction		2008				
Capacity (UK Gallons)		100,000				
Cleaning Frequency (Per Year)		Nil				
Type of Structure		Masonry				
Structure Condition		Good	Fair			Bad
Number of Valves	Sluice Valve	3				
	Non-Returning Valve	3				
Working Status		Functional	Non-Functional			
Incoming Main	Dia	6"				
	Material	MS				
Delivery Main	Dia	5"				
	Material	MS				
Cover Slab Condition		Good	Fair	Poor		
Approach Road Condition		Good	Fair	Poor		
Boundary Wall & Gate		Yes	No			
Overall Rating						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
Remarks / Requirements						
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>						


---

Data Collected By: Mr. Abdullah	Designation: Team Member	 Sign & Date: 30 May 2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023		
Name		Sharqi Colony		Pictures		
Location	Latitude	30.036432				
	Longitude	72.361043				
Address		Sharqi Colony, Vehari				
Year of Construction		1991				
Capacity (UK Gallons)		30,000				
Cleaning Frequency (Per Year)		Nil				
Type of Structure		Masonry				
Structure Condition		Good	Fair			Bad
Number of Valves	Sluice Valve	1				
	Non-Returning Valve	2				
Working Status		Functional	Non-Functional			
Incoming Main	Dia	8"				
	Material	MS				
Delivery Main	Dia	8"				
	Material	MS				
Cover Slab Condition		Good	Fair	Poor		
Approach Road Condition		Good	Fair	Poor		
Boundary Wall & Gate		Yes	No			
Overall Rating						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
Remarks / Requirements						
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>						



---

<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment			Asset Code: _____
					Date: 04-05-2023
<b>Name</b>		Water Works Madina Colony			<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.038603			
	<b>Longitude</b>	72.348599			
<b>Address</b>		Madina Colony, Vehari			
<b>Year of Construction</b>		2020			
<b>Capacity (UK Gallons)</b>		150,000			
<b>Cleaning Frequency (Per Year)</b>		Nil			
<b>Type of Structure</b>		Masonry			
<b>Structure Condition</b>		Good	Fair	Bad	
<b>Number of Valves</b>	<b>Sluice Valve</b>	4			
	<b>Non-Returning Valve</b>	2			
<b>Working Status</b>		Functional	Non-Functional		
<b>Incoming Main</b>	<b>Dia</b>	8"			
	<b>Material</b>	MS			
<b>Delivery Main</b>	<b>Dia</b>	8"			
	<b>Material</b>	MS			
<b>Cover Slab Condition</b>		Good	Fair	Poor	
<b>Approach Road Condition</b>		Good	Fair	Poor	
<b>Boundary Wall &amp; Gate</b>		Yes	No		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					



---


<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Water Works Taimoor Shaheed Colony		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.036637			
	<b>Longitude</b>	72.333115			
<b>Address</b>		Taimoor Shaheed Colony, Vehari			
<b>Year of Construction</b>		1996			
<b>Capacity (UK Gallons)</b>		125,000			
<b>Cleaning Frequency (Per Year)</b>		Nil			
<b>Type of Structure</b>		Masonry			
<b>Structure Condition</b>		Good	Fair	Bad	
<b>Number of Valves</b>	<b>Sluice Valve</b>	2			
	<b>Non-Returning Valve</b>	1			
<b>Working Status</b>		Functional	Non-Functional		
<b>Incoming Main</b>	<b>Dia</b>	12"			
	<b>Material</b>	MS			
<b>Delivery Main</b>	<b>Dia</b>	10"			
	<b>Material</b>	MS			
<b>Cover Slab Condition</b>		Good	Fair	Poor	
<b>Approach Road Condition</b>		Good	Fair	Poor	
<b>Boundary Wall &amp; Gate</b>		Yes	No		
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					





---

<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>



Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023		
Name		Water Works College Town		Pictures		
Location	Latitude	30.045147				
	Longitude	72.339088				
Address		College Town, Vehari				
Year of Construction		2011				
Capacity (UK Gallons)		80,000				
Cleaning Frequency (Per Year)		Nil				
Type of Structure		Masonry				
Structure Condition		Good	Fair			Bad
Number of Valves	Sluice Valve	2				
	Non-Returning Valve	2				
Working Status		Functional	Non-Functional			
Incoming Main	Dia	12"				
	Material	MS				
Delivery Main	Dia	12"				
	Material	MS				
Cover Slab Condition		Good	Fair	Poor		
Approach Road Condition		Good	Fair	Poor		
Boundary Wall & Gate		Yes	No			
Overall Rating						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
Remarks / Requirements						
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>						


---

<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
Name		Water Works Chak 9/11 01		Pictures	
Location	Latitude	30.052430			
	Longitude	72.346298			
Address		Chak 9/11, Vehari			
Year of Construction		1980			
Capacity (UK Gallons)		50,000			
Cleaning Frequency (Per Year)		Nil			
Type of Structure		Masonry			
Structure Condition		Good	Fair	Bad	
Number of Valves	Sluice Valve	2			
	Non-Returning Valve	1			
Working Status		Functional	Non-Functional		
Incoming Main	Dia	12"			
	Material	MS			
Delivery Main	Dia	10"			
	Material	MS			
Cover Slab Condition		Good	Fair	Poor	
Approach Road Condition		Good	Fair	Poor	
Boundary Wall & Gate		Yes	No		
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					

---

<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>

Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A3		Ground Storage Reservoir Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023		
Name		Water Works Chak 9/11 02		Pictures		
Location	Latitude	30.052459		 <p>Vehari, Punjab, Pakistan 382W+P88, Muhammedi bakri Road, Vehari, Punjab, Pakistan Lat 30.052459° Long 72.346305° 04/05/23 06:30 PM GMT +05:00</p>		
	Longitude	72.346305				
Address		Chak 9/11, Vehari				
Year of Construction		1980				
Capacity (UK Gallons)		50,000				
Cleaning Frequency (Per Year)		Nil				
Type of Structure		Masonry				
Structure Condition		Good	Fair			Bad
Number of Valves	Sluice Valve	1				
	Non-Returning Valve	1				
Working Status		Functional	Non-Functional			
Incoming Main	Dia	12"				
	Material	MS				
Delivery Main	Dia	10"				
	Material	MS				
Cover Slab Condition		Good	Fair	Poor		
Approach Road Condition		Good	Fair	Poor		
Boundary Wall & Gate		Yes	No			
Overall Rating						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
Remarks / Requirements						
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>						

---



<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>


### E. Intermediate Pumping Station

Sr. No.	Location	Total No. of pumps	Type	Capacity (cusecs)	Total capacity (cusecs)	Working hour per day	Age (Years)	Condition	Status
1	Anwarabad Water Works 1	1	Centrifugal	2	2	3	21	Fair	Functional
2	Anwarabad Water Works 2	2	Centrifugal	0.5	1	3	21	Fair	Functional
3	Water Works H-Block 01	2	Centrifugal	1	2	3	21	Fair	Functional
4	Water Works H-Block 02	3	Centrifugal	0.25	0.75	3	47	Fair	Functional
5	Sharqi Colony	2	Centrifugal	0.75	1.5	3	31	Fair	Functional
6	Water Works Madina Colony	2	Centrifugal	1	2	3	24	Fair	Functional
7	Chak 9/11 Water Works 01	2	Centrifugal	2	4	3	42	Fair	Functional
8	Chak 9/11 Water Works 02	2	Centrifugal	2	4	3	42	Fair	Functional




Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Intermediate Pumping Station Asset Condition Assessment		Asset Code: _____ Date: 02-05-2023
Asset Detail			Pictures	
Name		Anwarabad Water Works 1		
Location	Latitude	30.050903		
	Longitude	72.362477		
Address		Anwarabad, Vehari		
Area (Marla)		2		
Working Status		Functional	Non- Functional	
Construction Year of Water Works		2002		
Installation Year of Pump		2002		
Capital Cost of Machinery				
Operational Hours		3	3	
Delivery Pipe	Dia	6"		
	Material	MS		
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Poor
Approach to Pump House		Good	Fair	Poor
Pump Details				
		Pump A		
Pump Type		Centrifugal		
Pump Make		KSB		
Discharge Capacity (Cusec)		2		
Rotational Speed (RPM)		1470		
Head (ft.)		100		
Paint of Pumping Unit		Fair		
Number of Valves	Gate Valve	2		
	Non-Returning Valve	2		
Base Plate		Yes	No	

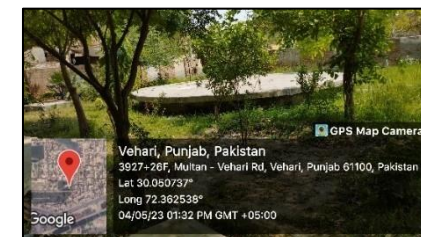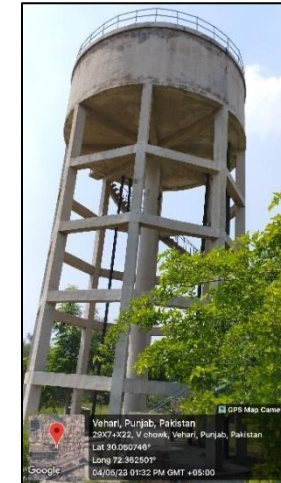



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Intermediate Pumping Station Asset Condition Assessment				Asset Code: _____ Date: 02-05-2023
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	100				
Sanctioned Load (Kwh)	61				
Motor Power (HP)	50				
Motor Make	Siemens				
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	




Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form: IDAMP-A1</b>	<b>Intermediate Pumping Station Asset Condition Assessment</b>	Asset Code: _____ Date: 02-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1	Intermediate Pumping Station Asset Condition Assessment			Asset Code: _____ Date: 02-05-2023
Asset Detail			Pictures	
<b>Name</b>		Anwarabad Water Works 2		
<b>Location</b>	<b>Latitude</b>	30.050903		
	<b>Longitude</b>	72.362477		
<b>Address</b>		Anwarabad, Vehari		
<b>Area (Marla)</b>		2		
<b>Working Status</b>		Functional	Non- Functional	
<b>Construction Year of Water Works</b>		2007		
<b>Installation Year of Pump</b>		2007	2007	
<b>Capital Cost of Machinery</b>				
<b>Operational Hours</b>		3	3	
<b>Delivery Pipe</b>	<b>Dia</b>	6"		
	<b>Material</b>	MS		
<b>Apron Around Pump House</b>		Yes	No	
<b>Hoisting Girder</b>		Yes	No	
<b>Civil Structure Condition</b>		Good	Fair	Poor
<b>Approach to Pump House</b>		Good	Fair	Poor
Pump Details				
		Pump A	Pump B	
<b>Pump Type</b>		Centrifugal	Centrifugal	
<b>Pump Make</b>		KSB	KSB	
<b>Discharge Capacity (Cusec)</b>		0.5	0.5	
<b>Rotational Speed (RPM)</b>		1470	1470	
<b>Head (ft.)</b>		100	100	
<b>Paint of Pumping Unit</b>		Fair	Fair	
<b>Number of Valves</b>	<b>Gate Valve</b>	2		2
	<b>Non-Returning Valve</b>	2		2
<b>Base Plate</b>		Yes	No	Yes
		No	Yes	No

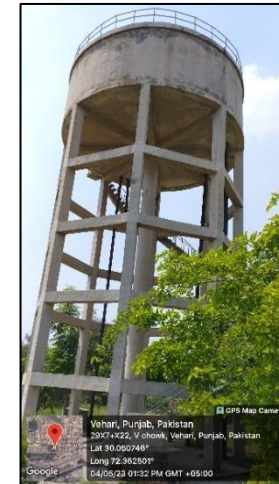


Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Intermediate Pumping Station Asset Condition Assessment				Asset Code: _____ Date: 02-05-2023
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	50				
Sanctioned Load (Kwh)	31				
Motor Power (HP)	20	20			
Motor Make	Siemens	Siemens			
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	




Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form:</b> IDAMP-A1	<b>Intermediate Pumping Station</b> <b>Asset Condition Assessment</b>	<b>Asset Code:</b> _____ <b>Date:</b> 02-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Intermediate Pumping Station Asset Condition Assessment		Asset Code: _____ Date: 02-05-2023
Asset Detail			Pictures	
Name		Water Works H-Block 01		
Location	Latitude	30.045282		
	Longitude	72.361868		
Address		H-Block main city, Vehari		
Area (Marla)		2		
Working Status		Functional	Non- Functional	
Construction Year of Water Works		2002		
Installation Year of Pump		2020	2020	
Capital Cost of Machinery				
Operational Hours		3	3	
Delivery Pipe	Dia	6"	6"	
	Material	MS	MS	
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Poor
Approach to Pump House		Good	Fair	Poor
Pump Details				
		Pump A	Pump B	
Pump Type		Centrifugal	Centrifugal	
Pump Make		KSB	KSB	
Discharge Capacity (Cusec)		1	1	
Rotational Speed (RPM)		1470	1470	
Head (ft.)		100	100	
Paint of Pumping Unit		Fair	Fair	
Number of Valves	Gate Valve	2	2	
	Non-Returning Valve	2	2	
Base Plate		Yes	Yes	







Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Intermediate Pumping Station Asset Condition Assessment				Asset Code: _____ Date: 02-05-2023
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	100 (Combined)				
Sanctioned Load (Kwh)	65				
Motor Power (HP)	25			25	
Motor Make	Siemens			Siemens	
MCU	Yes			No	
Earthing of Motor	Yes			No	
Power Wiring	Yes			No	
Service Cable	Yes			No	
Earthing of MCU	Yes			No	
Energy Meter	Yes			No	
Water Meter	Yes			No	
PFI Equipment	Yes			No	
Generator	Yes			No	
Change Over	Yes			No	
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	




Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form: IDAMP-A1</b>	<b>Intermediate Pumping Station Asset Condition Assessment</b>	Asset Code: _____ Date: 02-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023



Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Intermediate Pumping Station Asset Condition Assessment		Asset Code: _____ Date: 02-05-2023
Asset Detail				Pictures
Name		Water Works H-Block 02		
Location	Latitude	30.045282		
	Longitude	72.361868		
Address		H-Block main city, Vehari		
Area (Marla)		2		
Working Status		Functional	Non- Functional	
Construction Year of Water Works		1976		
Installation Year of Pump		1992	1992	1992
Capital Cost of Machinery				
Operational Hours		3	3	3
Delivery Pipe	Dia	6"	6"	6"
	Material	MS	MS	MS
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Poor
Approach to Pump House		Good	Fair	Poor
Pump Details				
		Pump A	Pump B	Pump C
Pump Type		Centrifugal	Centrifugal	Centrifugal
Pump Make		KSB	PECO	KSB
Discharge Capacity (Cusec)		0.25	0.25	0.25
Rotational Speed (RPM)		1470	1470	1470
Head (ft.)		100	100	100
Paint of Pumping Unit		Fair	Fair	Fair
Number of Valves	Gate Valve	2	2	2
	Non-Returning Valve	2	2	2
Base Plate		Yes	Yes	Yes






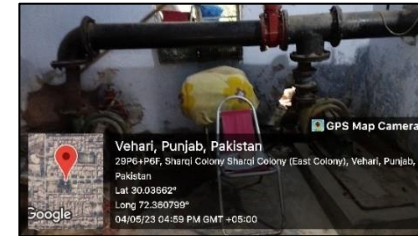
Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Intermediate Pumping Station Asset Condition Assessment				Asset Code: _____ Date: 02-05-2023
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	100 (Combined)				
Sanctioned Load (Kwh)	65				
Motor Power (HP)	15	15	15		
Motor Make	Siemens	Siemens	Siemens		
MCU	Yes		No		
Earthing of Motor	Yes		No		
Power Wiring	Yes		No		
Service Cable	Yes		No		
Earthing of MCU	Yes		No		
Energy Meter	Yes		No		
Water Meter	Yes		No		
PFI Equipment	Yes		No		
Generator	Yes		No		
Change Over	Yes		No		
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	


Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form: IDAMP-A1</b>	<b>Intermediate Pumping Station Asset Condition Assessment</b>	Asset Code: _____ Date: 02-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Intermediate Pumping Station Asset Condition Assessment		Asset Code: _____ Date: 02-05-2023
Asset Detail			Pictures	
Name		Sharqi Colony		
Location	Latitude	30.036432		
	Longitude	72.361043		
Address		Sharqi Colony, Vehari		
Area (Marla)		2		
Working Status		Functional	Non- Functional	
Construction Year of Water Works		1992		
Installation Year of Pump		1992	1992	
Capital Cost of Machinery				
Operational Hours		3	3	
Delivery Pipe	Dia	6"		
	Material	MS		
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Poor
Approach to Pump House		Good	Fair	Poor
Pump Details				
		Pump A	Pump B	
Pump Type		Centrifugal	Centrifugal	
Pump Make		PECO	PECO	
Discharge Capacity (Cusec)		0.75	0.75	
Rotational Speed (RPM)		1470	1470	
Head (ft.)		100	100	
Paint of Pumping Unit		Fair	Fair	
Number of Valves	Gate Valve	2	2	
	Non-Returning Valve	2	2	
Base Plate		Yes	Yes	

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Intermediate Pumping Station Asset Condition Assessment			Asset Code: _____ Date: 02-05-2023	
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)			50		
Sanctioned Load (Kwh)			61		
Motor Power (HP)	20			20	
Motor Make	PECO			PECO	
MCU	Yes			No	
Earthing of Motor	Yes			No	
Power Wiring	Yes			No	
Service Cable	Yes			No	
Earthing of MCU	Yes			No	
Energy Meter	Yes			No	
Water Meter	Yes			No	
PFI Equipment	Yes			No	
Generator	Yes			No	
Change Over	Yes			No	
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	





Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form: IDAMP-A1</b>	<b>Intermediate Pumping Station Asset Condition Assessment</b>	Asset Code: _____ Date: 02-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Intermediate Pumping Station Asset Condition Assessment		Asset Code: _____ Date: 02-05-2023
Asset Detail			Pictures	
Name		Water Works Madina Colony		
Location	Latitude	30.038603		
	Longitude	72.348599		
Address		Madina Colony, Vehari		
Area (Marla)		2		
Working Status		Functional	Non- Functional	
Construction Year of Water Works		1999		
Installation Year of Pump		2020	1997	
Capital Cost of Machinery				
Operational Hours		3	3	
Delivery Pipe	Dia	6"		
	Material	MS		
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Poor
Approach to Pump House		Good	Fair	Poor
Pump Details				
		Pump A	Pump B	
Pump Type		Centrifugal	Centrifugal	
Pump Make		KSB	PECO	
Discharge Capacity (Cusec)		1	1	
Rotational Speed (RPM)		1470	1470	
Head (ft.)		100	100	
Paint of Pumping Unit		Poor	Poor	
Number of Valves	Gate Valve	2	2	
	Non-Returning Valve	2	2	
Base Plate		Yes	Yes	


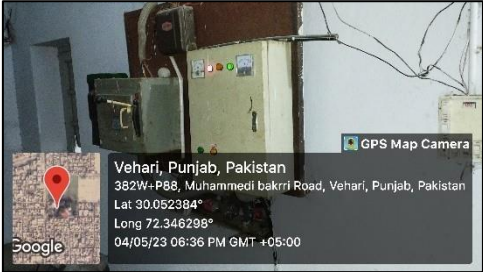







Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Intermediate Pumping Station Asset Condition Assessment				Asset Code: _____ Date: 02-05-2023
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	50				
Sanctioned Load (Kwh)	39				
Motor Power (HP)	25	25			
Motor Make	Siemens	PECO			
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form: IDAMP-A1</b>	<b>Intermediate Pumping Station Asset Condition Assessment</b>	Asset Code: _____ Date: 02-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023


Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Intermediate Pumping Station Asset Condition Assessment		Asset Code: _____ Date: 02-05-2023
Asset Detail			Pictures	
Name		Chak 9/11 Water Works 01		
Location	Latitude	30.052459		
	Longitude	72.346305		
Address		Chak 9/11, Vehari		
Area (Marla)		2		
Working Status		Functional	Non- Functional	
Construction Year of Water Works		1981		
Installation Year of Pump		2020	2020	
Capital Cost of Machinery				
Operational Hours		3	3	
Delivery Pipe	Dia	6"		
	Material	MS		
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Poor
Approach to Pump House		Good	Fair	Poor
Pump Details				
		Pump A	Pump B	
Pump Type		Centrifugal	Centrifugal	
Pump Make		KSB	KSB	
Discharge Capacity (Cusec)		2	2	
Rotational Speed (RPM)		1470	1470	
Head (ft.)		100	100	
Paint of Pumping Unit		Fair	Fair	
Number of Valves	Gate Valve	2	2	
	Non-Returning Valve	2	2	
Base Plate		Yes	Yes	






Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Intermediate Pumping Station Asset Condition Assessment				Asset Code: _____
					Date: 02-05-2023
<b>Electro-Mechanical Equipment Details</b>					
Transformer Capacity (kVA)	100				
Sanctioned Load (Kwh)	61				
Motor Power (HP)	50	50			
Motor Make	Siemens	Siemens			
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
• No Remarks					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form: IDAMP-A1</b>	<b>Intermediate Pumping Station Asset Condition Assessment</b>	Asset Code: _____ Date: 02-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A1		Intermediate Pumping Station Asset Condition Assessment		Asset Code: _____ Date: 02-05-2023
Asset Detail			Pictures	
Name		Chak 9/11 Water Works 02		
Location	Latitude	30.052459		
	Longitude	72.346305		
Address		Chak 9/11, Vehari		
Area (Marla)		2		
Working Status		Functional	Non- Functional	
Construction Year of Water Works		1981		
Installation Year of Pump		2020	2020	
Capital Cost of Machinery				
Operational Hours		3	3	
Delivery Pipe	Dia	6"	6"	
	Material	MS	MS	
Apron Around Pump House		Yes	No	
Hoisting Girder		Yes	No	
Civil Structure Condition		Good	Fair	Poor
Approach to Pump House		Good	Fair	Poor
Pump Details				
		Pump A	Pump B	
Pump Type		Centrifugal	Centrifugal	
Pump Make		KSB	KSB	
Discharge Capacity (Cusec)		2	2	
Rotational Speed (RPM)		1470	1470	
Head (ft.)		100	100	
Paint of Pumping Unit		Fair	Fair	
Number of Valves	Gate Valve	2	2	
	Non-Returning Valve	2	2	
Base Plate		Yes	Yes	

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A1	Intermediate Pumping Station Asset Condition Assessment				Asset Code: _____
					Date: 02-05-2023
Electro-Mechanical Equipment Details					
Transformer Capacity (kVA)	100				
Sanctioned Load (Kwh)	61				
Motor Power (HP)	50	50			
Motor Make	Siemens	Siemens			
MCU	Yes	No			
Earthing of Motor	Yes	No			
Power Wiring	Yes	No			
Service Cable	Yes	No			
Earthing of MCU	Yes	No			
Energy Meter	Yes	No			
Water Meter	Yes	No			
PFI Equipment	Yes	No			
Generator	Yes	No			
Change Over	Yes	No			
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form: IDAMP-A1</b>	<b>Intermediate Pumping Station Asset Condition Assessment</b>	Asset Code: _____ Date: 02-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023



### F. Water Supply Network


Sr #	Dia	Length (meter)	Age (Years)	Condition	Material	Book Value (PKR Million)
1	3"	105406	11	Good	UPVC	3.46
2	4"	12828			UPVC	0.55
3	6"	22154			UPVC	1.50
4	8"	12818			UPVC	1.45
5	10"	9581			UPVC	1.54
6	12"	7487			UPVC	1.53
7	14"	1730			UPVC	0.40
8	16"	6693			UPVC	2.05
9	18"	170			UPVC	0.06



Integrated Development And Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A5	Water Supply Network Asset Condition Assessment			Asset Code: _____ Date: 05-05-2023
Description	Area (Acres)	Percentage		
Served Area	2635	64		
Contaminated Area	-	-		
Water Shortage Area	1603	60		
Unserved Area	1463	36		
Latest water quality analysis carried out for community network?				
	Yes	No		
If yes, which lab and parameters?				
Findings of water quality analysis?				
In case of any parameter above the permissible limit of PEQs, which steps are taken to provide safe drinking water to the consumers?				
Any complaints of water contamination received from the consumers?				
	Yes	No		
If yes, which steps were taken to resolve the complaints?				
Pipe Dia (inches)	Pipe Material	Length (ft)	Year of Laying	Age of Pipe
3"	UPVC	105406	2012	11
4"	UPVC	12828	2012	11
6"	UPVC	22154	2012	11
8"	UPVC	12818	2012	11
10"	UPVC	9581	2012	11
12"	UPVC	7487	2012	11
14"	UPVC	1730	2012	11

<b>16"</b>	UPVC	6693	2012	11
<b>18"</b>	UPVC	170	2012	11
<b>Remarks / Requirements</b>				
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>				
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>	

### F. Vehicles/ Machinery


Sr #	Name	Registration Number	Age (Years)	Condition	Status	Book Value (PKR Million)	Capacity
1	Water Bowser	Tractor Fiat #1	55	Poor	Functional	0.4	55 Hp


Integrated Development and Asset Management Plan (IDAMP)	
Municipal Committee Vehari	
Form: IDAMP-A16	Moveable Asset Asset Condition Assessment
Asset Code: _____ Date: 04-05-2023	
Type of Vehicle / Machinery	Pictures
Water Bowser	
<b>Capacity</b>	500 Gallons
<b>Purpose</b>	Water Supply
<b>Year of Manufacturing</b>	1968
<b>Model</b>	FIAT NH 480
<b>Capital Cost</b>	Not Available
<b>Fuel Consumption (Lt)</b>	330
<b>Condition</b>	Poor

<b>Engine Capacity</b>	55 HP	
<b>Maintenance Cost</b>	Not Available	
<b>Oiling /Fitness</b>	Yes	
<b>Fitness Certificate</b>	No	
<b>Registered</b>	Not Registered	
<b>Overall Rating</b>	Poor	
<b>Remarks / Requirements</b>		
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>		
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>

## 2. Sewerage

### Key Components of a Sewerage System

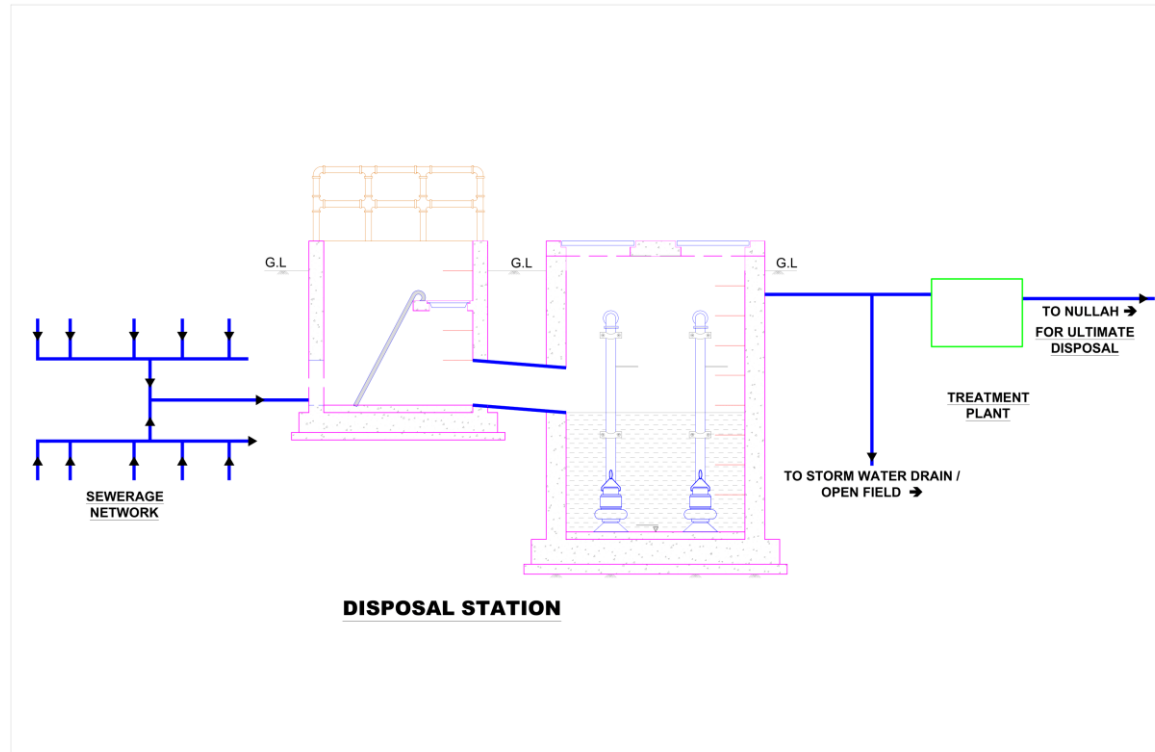

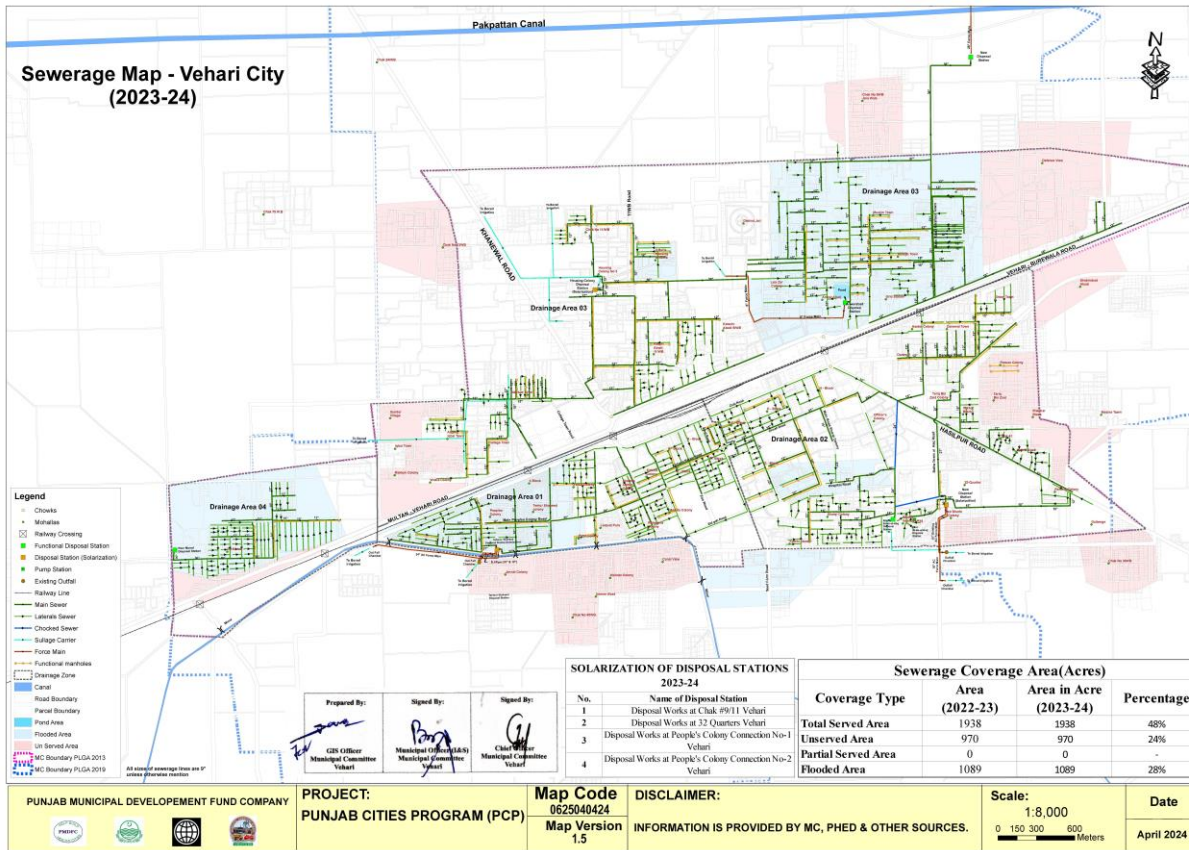


A. Disposal Station

Sr #	Name	Age (Years)	Condition	Status	Motor hp	Pump Make	Motor Make
------	------	-------------	-----------	--------	----------	-----------	------------


		Civil Structure	Pump			Nos. of pump	Discharge Each (Cusec)			
1	Disposal Works 32 Quarter	9	3	Fair	Functional	3	(5,5,4)	(75,75,60)	PECO, PECO, KSB	(PECO, Siemens)
2	Bhatta Ikram ul Haq	47	10	Poor	Functional	1	4	60	KSB	KSB
3	Mini Disposal Bhatta Ikram ul Haq	47	5	Poor	Functional	1	1	20	KSB	KSB
4	Taimoor Shaheed Disposal	47	21	Poor	Functional	3	4	60	KSB	Siemens
5	Mini Disposal Peer Murad	17	17	Poor	Functional	1	1.5	20	KSB	Siemens
6	Chak # 9/11 WB Disposal	39	5	Fair	Functional	4	(5,5,4,4)	(75,75,60,60)	KSB	Siemens
7	Mini Disposal Anwarabad	15	15	Poor	Functional	1	1.5	20	KSB	Siemens
8	Pak Pattan Canal Disposal	7	7	Good	Functional	5	5	75	PECO	PECO



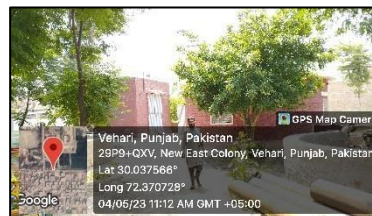

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name	Disposal Works 32 Quarter			
Location	Latitude	30.037566		
	Longitude	72.370728		
Address	32 Quarter, Vehari			
Area (Acres)	1.3			
Installation Year	2014			
Capital Cost of Machinery				
Outfall Drain Sewer	Dia	36"		
	Material	RCC		
Screening Chamber	No. of Screens	2		
	Screen Condition	Good	Fair	Poor
	Chamber Structure	Masonry		
Wet Wells	Number	2		
	Shape	Rectangular	Circular	
	Size			
	Structure	Masonry	RCC	
	Railing	Yes	No	
Force Main	No. of force mains	2		
	Dia	36"	16"	
	Material	AC		
	Starting Point	Pump House	Pump House	
	Ending Point	Ultimate disposal point	Outfall Chamber	
	Length	1.7 km	0.9km	
Sullage Carrier	Size	No Sullage Carrier		
	Shape			
	Length			
	Condition			
Delivery Pipe	Dia	10"		

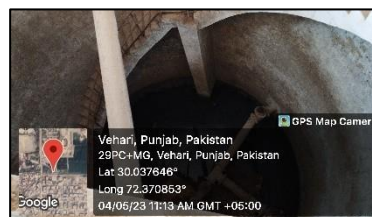

Integrated Development and Asset Management Plan (IDAMP)				
Suction Pipe	Material	C.I		
	Dia	10"		
	Material	C.I		
Number of Valves	Sluice Valves	6		
	Non-Return Valves	3		
	Penstock Valves	2		
Ultimate Disposal	Broad Irrigation, Seed Farm			
Civil Structure Condition	Good	Fair	Poor	
Control Room Structure	Good	Fair	Poor	
Discharge Box Structure	Good	Fair	Poor	
Approach to Pump House	Good	Fair	Poor	
Hoisting Girder	Yes		No	
Boundary Wall & Gate	Yes		No	
Treatment of Sewage	Yes		No	
Wastewater daily discharge in m <sup>3</sup> /day? (based on available information at MC)	8182			
Ultimate disposal of wastewater?				
Electro-Mechanical Equipment Details				
Number of WAPDA Feeders	1			
Transformer Capacity (kVA)	100			
Number of MCU	3			
Sanctioned Load (kWh)	60			
Power Factor Improvement Equipment	Yes	No		
Service Cable	Yes	No		
Power Wiring	Yes	No		
Earthing of Motor	Yes	No		
Earthing of MCU	Yes	No		
Generator Availability	Yes	No		
Light Wiring of Pump House	Yes	No		
Change Over	Yes	No		
Pump Detail				
	Pump A	Pump B	Pump C	
Pump Type	Centrifugal/ Non-Clogging	Centrifugal/ Non-Clogging	Centrifugal/ Non-Clogging	





Integrated Development and Asset Management Plan (IDAMP)							
Pump Brand		PECO		PECO		KSB	
Pump Paint		Fair		Fair		Fair	
Motor Brand		Siemens		Siemens		Siemens	
Installation Year of Pump		2020		2020		2014	
Discharge Capacity (Cusecs)		5		5		4	
Rotational Speed (RPM)		960		960		960	
Head (ft.)		50		50		50	
Motor Power (HP)		75		75		60	
Pump Daily Running Time (Hours)		8		8		Non-Functional	
Base Plate		Yes	No	Yes	No	Yes	No
Number of Valves		Sluice Valve		6			
		Non-Returning Valve		3			
Overall Rating							
Average Score	1	2	3	4	5		
Asset Condition	Excellent	Good	Fair	Poor	Failing		
Category	A	B	C	D	E		
Remarks / Requirements							
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>							
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023			
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023			





Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name	Bhatta Ikram ul Haq			
Location	Latitude	30.036672		
	Longitude	72.366525		
Address	Bhatta Ikram ul Haq, Vehari			
Area (Acres)	3			
Installation Year	1976			
Capital Cost of Machinery				
Outfall Drain Sewer	Dia	24"		
	Material	RCC		
Screening Chamber	No. of Screens	2		
	Screen Condition	Good	Fair	Poor
	Chamber Structure	Masonry		
Wet Wells	Number	2		
	Shape	Rectangular	Circular	
	Size			
	Structure	Masonry	RCC	
	Railing	Yes	No	
Force Main	No. of force mains	No Force Main		
	Dia			
	Material			
	Starting Point			
	Ending Point			
	Length			
Sullage Carrier	Size	3'x4'		
	Shape	Rectangular		
	Length	1000'		
	Condition	Poor		
Delivery Pipe	Dia	10"		
	Material	C.I		



Integrated Development and Asset Management Plan (IDAMP)				
Suction Pipe	Dia	10"		
	Material	C.I		
Number of Valves	Sluice Valves	4		
	Non-Return Valves	2		
	Penstock Valves	2 (NF)		
Ultimate Disposal	Seed Farm Land			
Civil Structure Condition	Good	Fair	Poor	
Control Room Structure	Good	Fair	Poor	
Discharge Box Structure	Good	Fair	Poor	
Approach to Pump House	Good	Fair	Poor	
Hoisting Girder	Yes		No	
Boundary Wall & Gate	Yes		No	
Treatment of Sewage	Yes		No	
Wastewater daily discharge in m <sup>3</sup> /day? (based on available information at MC)	9818			
Ultimate disposal of wastewater?				
<b>Electro-Mechanical Equipment Details</b>				
Number of WAPDA Feeders	1			
Transformer Capacity (kVA)	100			
Number of MCU	1			
Sanctioned Load (kWh)	60			
Power Factor Improvement Equipment	Yes		No	
Service Cable	Yes		No	
Power Wiring	Yes		No	
Earthing of Motor	Yes		No	
Earthing of MCU	Yes		No	
Generator Availability	Yes		No	
Light Wiring of Pump House	Yes		No	
Change Over	Yes		No	
<b>Pump Detail</b>				
	<b>Pump A</b>		<b>Pump B</b>	
Pump Type	Centrifugal/ Non-Clogging		Centrifugal/ Non-Clogging	
Pump Brand	KSB		KSB	
Pump Paint	Poor		Poor	



Integrated Development and Asset Management Plan (IDAMP)					
Motor Brand		KSB		PECO	
Installation Year of Pump		2013		2013	
Discharge Capacity (Cusecs)		4		3	
Rotational Speed (RPM)		960		960	
Head (ft.)		40		40	
Motor Power (HP)		60		50	
Pump Daily Running Time (Hours)		24		Non-Functional	
Base Plate		Yes	No	Yes	No
Number of Valves	Sluice Valve	4			
	Non-Returning Valve	2			
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	



Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		Mini Disposal Bhatta Ikram ul Haq		
Location	Latitude	30.036839		
	Longitude	72.367028		
Address		Bhatta Ikram ul Haq, Vehari		
Area (Acres)		0.1		
Installation Year		1976		
Capital Cost of Machinery				
Outfall Drain Sewer	Dia	12"		
	Material	RCC		
Screening Chamber	No. of Screens	0		
	Screen Condition	Good	Fair	
	Chamber Structure			
Wet Wells	Number	2		
	Shape	Rectangular	Circular	
	Size	10'		
	Structure	Masonry	RCC	
	Railing	Yes	No	
Force Main	No. of force mains	1		
	Dia	6"		
	Material	C.I		
	Starting Point	Pump house		
	Ending Point	Sullage carrier of main Disposal, Bhatta Ikram ul Haq		
Length	0.18 km			
Sullage Carrier	Size	No Sullage Carrier		
	Shape			
	Length			
	Condition			




Integrated Development and Asset Management Plan (IDAMP)			
Delivery Pipe	Dia	6"	
	Material	C.I	
Suction Pipe	Dia	6"	
	Material	C.I	
Number of Valves	Sluice Valves	2	
	Non-Return Valves	1	
	Penstock Valves	0	
Ultimate Disposal	Sullage carrier of main Disposal, Bhatta Ikram ul Haq		
Civil Structure Condition	Good	Fair	Poor
Control Room Structure	Good	Fair	Poor
Discharge Box Structure	Good	Fair	Poor
Approach to Pump House	Good	Fair	Poor
Hoisting Girder	Yes	No	
Boundary Wall & Gate	Yes	No	
Treatment of Sewage	Yes	No	
Wastewater daily discharge in m <sup>3</sup> /day? (based on available information at MC)	818		
Ultimate disposal of wastewater?			
<b>Electro-Mechanical Equipment Details</b>			
Number of WAPDA Feeders	1 (Shared with main disposal)		
Transformer Capacity (kVA)	100		
Number of MCU	1		
Sanctioned Load (kWh)	60 (Shared connection with main disposal)		
Power Factor Improvement Equipment	Yes	No	
Service Cable	Yes	No	
Power Wiring	Yes	No	
Earthing of Motor	Yes	No	
Earthing of MCU	Yes	No	
Generator Availability	Yes	No	
Light Wiring of Pump House	Yes	No	
Change Over	Yes	No	
<b>Pump Detail</b>			








Vehari, Punjab, Pakistan  
 29Q9+R3R, near education university of, Vehari, Punjab, Pakistan  
 Lat 30.036983°  
 Long 72.367063°  
 04/06/23 11:54 AM GMT +05:00




Integrated Development and Asset Management Plan (IDAMP)					
		<b>Pump A</b>			
<b>Pump Type</b>		Centrifugal/ Non-Clogging			
<b>Pump Brand</b>		KSB			
<b>Pump Paint</b>		Fair			
<b>Motor Brand</b>		KSB			
<b>Installation Year of Pump</b>		2018			
<b>Discharge Capacity (Cusecs)</b>		1			
<b>Rotational Speed (RPM)</b>		1460			
<b>Head (ft.)</b>		40			
<b>Motor Power (HP)</b>		20			
<b>Pump Daily Running Time (Hours)</b>		8			
<b>Base Plate</b>		Yes		No	
<b>Number of Valves</b>	<b>Sluice Valve</b>	2			
	<b>Non-Returning Valve</b>	1			
<b>Overall Rating</b>					
<b>Average Score</b>	1	2	3	4	5
<b>Asset Condition</b>	Excellent	Good	Fair	Poor	Failing
<b>Category</b>	A	B	C	D	E
<b>Remarks / Requirements</b>					
No Remarks					
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>	

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Asset Detail			Pictures		
<b>Name</b>		Taimoor Shaheed Disposal			
<b>Location</b>	<b>Latitude</b>	30.034745			
	<b>Longitude</b>	72.334190			
<b>Address</b>		Taimoor Shaheed Colony, Vehari			
<b>Area (Acres)</b>		1			
<b>Installation Year</b>		1976			
<b>Capital Cost of Machinery</b>					
<b>Outfall Drain Sewer</b>	<b>Dia</b>	27"			
	<b>Material</b>	RCC			
<b>Screening Chamber</b>	<b>No. of Screens</b>	2			
	<b>Screen Condition</b>	Good	Fair	Poor	
	<b>Chamber Structure</b>	Masonry			
<b>Wet Wells</b>	<b>Number</b>	3			
	<b>Shape</b>	Rectangular	Circular		
	<b>Size</b>	25'			
	<b>Structure</b>	Masonry	RCC		
	<b>Railing</b>	Yes	No		
<b>Force Main</b>	<b>No. of force mains</b>	3			
	<b>Dia</b>	24"	12"	10"	
	<b>Material</b>	AC	D.I	D.I	
	<b>Starting Point</b>	Pump House	Pump House	Pump House	
	<b>Ending Point</b>	Ultimate Disposal Point	Outfall Chamber	Outfall Chamber	
	<b>Length</b>	2 km	500'	500'	
<b>Sullage Carrier</b>	<b>Size</b>	No Sullage Carrier			
	<b>Shape</b>				
					
					

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
	Length			
	Condition			
Delivery Pipe	Dia	10"	12"	
	Material	C.I	C.I	
Suction Pipe	Dia	10"	12"	
	Material	C.I	C.I	
Number of Valves	Sluice Valves	6		
	Non-Return Valves	3		
	Penstock Valves	2		
Ultimate Disposal	Broad Irrigation			
Civil Structure Condition	Good	Fair	Poor	
Control Room Structure	Good	Fair	Poor	
Discharge Box Structure	Good	Fair	Poor	
Approach to Pump House	Good	Fair	Poor	
Hoisting Girder	Yes		No	
Boundary Wall & Gate	Yes		No	
Treatment of Sewage	Yes		No	
Wastewater daily discharge in m <sup>3</sup> /day? (based on available information at MC)	7364			
Ultimate disposal of wastewater?				
Electro-Mechanical Equipment Details				
Number of WAPDA Feeders	2			
Transformer Capacity (kVA)	100			
Number of MCU	2			
Sanctioned Load (kWh)	60			
Power Factor Improvement Equipment	Yes		No	
Service Cable	Yes		No	
Power Wiring	Yes		No	
Earthing of Motor	Yes		No	
Earthing of MCU	Yes		No	

Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment				Asset Code: _____ Date: 04-05-2023	
Generator Availability	Yes	No				
Light Wiring of Pump House	Yes	No				
Change Over	Yes	No				
Pump Detail						
	Pump A		Pump B		Pump C	
Pump Type	Centrifugal/ Non-Clogging		Centrifugal/ Non-Clogging		Centrifugal/ Non-Clogging	
Pump Brand	KSB		KSB		KSB	
Pump Paint	Fair		Fair		Poor	
Motor Brand	Siemens		Siemens		Siemens	
Installation Year of Pump	2002		2002		2002	
Discharge Capacity (Cusecs)	4		4		3	
Rotational Speed (RPM)	960		960		960	
Head (ft.)	70		70		70	
Motor Power (HP)	50		60		50	
Pump Daily Running Time (Hours)	9		9		Non-Functional	
Base Plate	Yes	No	Yes	No	Yes	No
Number of Valves	Sluice Valve		6			
	Non-Returning Valve		3			
Overall Rating						
Average Score	1	2	3	4	5	
Asset Condition	Excellent	Good	Fair	Poor	Failing	
Category	A	B	C	D	E	
Remarks / Requirements						
No Remarks						
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023		



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form:</b> IDAMP-A7	<b>Sewerage Disposal Station</b> <b>Asset Condition Assessment</b>	<b>Asset Code:</b> _____ <b>Date:</b> 04-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form:</b> IDAMP-A7	<b>Sewerage Disposal Station</b> <b>Asset Condition Assessment</b>	<b>Asset Code:</b> _____ <b>Date:</b> 04-05-2023
Asset Detail		Pictures
<b>Name</b>	Mini Disposal Peer Murad	
<b>Location</b>	<b>Latitude</b>	30.037558
	<b>Longitude</b>	72.307918
<b>Address</b>	Peer Murad Colony, Vehari	
<b>Area (Acres)</b>	0.2	
<b>Installation Year</b>	2006	
<b>Capital Cost of Machinery</b>		
<b>Outfall Drain Sewer</b>	<b>Dia</b>	36"
	<b>Material</b>	RCC
<b>Screening Chamber</b>	<b>No. of Screens</b>	1 (NF)
	<b>Screen Condition</b>	Good   Fair   <b>Poor</b>
	<b>Chamber Structure</b>	Masonry
<b>Wet Wells</b>	<b>Number</b>	1
	<b>Shape</b>	Rectangular   <b>Circular</b>
	<b>Size</b>	15'
	<b>Structure</b>	<b>Masonry</b>   RCC
	<b>Railing</b>	Yes   <b>No</b>
<b>Force Main</b>	<b>No. of force mains</b>	No Force Main

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
	Dia			
	Material			
	Starting Point			
	Ending Point			
	Length			
Sullage Carrier	Size	1.5'x4'		
	Shape	Rectangular		
	Length	100'		
	Condition	Good		
Delivery Pipe	Dia	6"		
	Material	C.I		
Suction Pipe	Dia	6"		
	Material	C.I		
Number of Valves	Sluice Valves	2		
	Non-Return Valves	1		
	Penstock Valves	0		
Ultimate Disposal		Broad Irrigation		
Civil Structure Condition	Good	Fair	Poor	
Control Room Structure	Good	Fair	Poor	
Discharge Box Structure	Good	Fair	Poor	
Approach to Pump House	Good	Fair	Poor	
Hoisting Girder	Yes		No	
Boundary Wall & Gate	Yes		No	
Treatment of Sewage	Yes		No	
Wastewater daily discharge in m <sup>3</sup> /day? (based on available information at MC)	1227			
Ultimate disposal of wastewater?				
Electro-Mechanical Equipment Details				
Number of WAPDA Feeders	1			
Transformer Capacity (kVA)	25			



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Number of MCU	1				
Sanctioned Load (kWh)	23				
Power Factor Improvement Equipment	Yes	No			
Service Cable	Yes	No			
Power Wiring	Yes	No			
Earthing of Motor	Yes	No			
Earthing of MCU	Yes	No			
Generator Availability	Yes	No			
Light Wiring of Pump House	Yes	No			
Change Over	Yes	No			
Pump Detail					
			Pump A		
Pump Type	Centrifugal/ Non-Clogging				
Pump Brand	KSB				
Pump Paint	Fair				
Motor Brand	Siemens				
Installation Year of Pump	2006				
Discharge Capacity (Cusecs)	1.5				
Rotational Speed (RPM)	1460				
Head (ft.)	40				
Motor Power (HP)	20				
Pump Daily Running Time (Hours)	8				
Base Plate	Yes	No			
Number of Valves	Sluice Valve	2			
	Non-Returning Valve	1			
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					


Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form: IDAMP-A7</b>	<b>Sewerage Disposal Station Asset Condition Assessment</b>	<b>Asset Code: _____ Date: 04-05-2023</b>
<ul style="list-style-type: none"> <li>• No Remarks</li> </ul>		
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>





Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name	Chak # 9-11 WB Disposal			
Location	Latitude	30.053006		
	Longitude	72.342963		
Address	Chak # 9/11, Vehari			
Area (Acres)	0.8			
Installation Year	1984			
Capital Cost of Machinery				
Outfall Drain Sewer	Dia	36"		
	Material	RCC		
Screening Chamber	No. of Screens	2		
	Screen Condition	Good	Fair	Poor
	Chamber Structure	Masonry		
Wet Wells	Number	1		
	Shape	Rectangular	Circular	
	Size	25'		
	Structure	Masonry	RCC	
	Railing	Yes	No	
Force Main	No. of force mains	No Force Main		
	Dia			
	Material			
	Starting Point			
	Ending Point			
	Length			
Sullage Carrier	Size	3'x5'		
	Shape	Rectangular		
	Length	2.62 km		
	Condition	Fair		
Delivery Pipe	Dia	10"		
	Material	C.I		

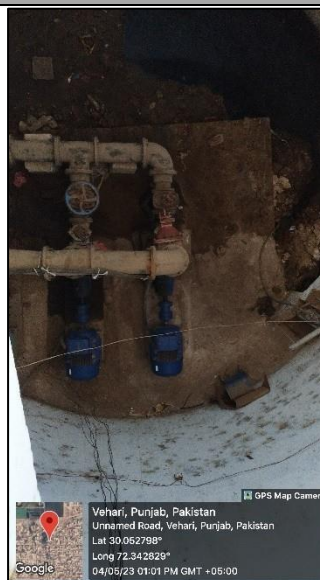



Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____
				Date: 04-05-2023
Suction Pipe	Dia	10"		
	Material	C.I		
Number of Valves	Sluice Valves	8		
	Non-Return Valves	4		
	Penstock Valves	4		
Ultimate Disposal	Broad Irrigation			
Civil Structure Condition	Good	Fair	Poor	
Control Room Structure	Good	Fair	Poor	
Discharge Box Structure	Good	Fair	Poor	
Approach to Pump House	Good	Fair	Poor	
Hoisting Girder	Yes	No		
Boundary Wall & Gate	Yes	No		
Treatment of Sewage	Yes	No		
Wastewater daily discharge in m <sup>3</sup> /day? (based on available information at MC)	6545			
Ultimate disposal of wastewater?				
Electro-Mechanical Equipment Details				
Number of WAPDA Feeders	1			
Transformer Capacity (kVA)	100			
Number of MCU	4			
Sanctioned Load (kWh)	60			
Power Factor Improvement Equipment	Yes	No		
Service Cable	Yes	No		
Power Wiring	Yes	No		
Earthing of Motor	Yes	No		
Earthing of MCU	Yes	No		
Generator Availability	Yes	No		
Light Wiring of Pump House	Yes	No		
Change Over	Yes	No		
Pump Detail				




Integrated Development and Asset Management Plan (IDAMP)									
Municipal Committee Vehari									
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment					Asset Code: _____ Date: 04-05-2023			
	Pump A		Pump B		Pump C		Pump D		
<b>Pump Type</b>	Centrifugal/ Non-Clogging		Centrifugal/ Non-Clogging		Centrifugal/ Non-Clogging		Centrifugal/ Non-Clogging		
<b>Pump Brand</b>	KSB		KSB		KSB		KSB		
<b>Pump Paint</b>	Good		Good		Fair		Fair		
<b>Motor Brand</b>	KSB		KSB		Siemens		Siemens		
<b>Installation Year of Pump</b>	2018		2018		2014		2014		
<b>Discharge Capacity (Cusecs)</b>	4		4		4		4		
<b>Rotational Speed (RPM)</b>	960		960		960		960		
<b>Head (ft.)</b>	50		50		40		40		
<b>Motor Power (HP)</b>	75		75		60		60		
<b>Pump Daily Running Time (Hours)</b>	8		8		Non- Functional		Non- Functional		
<b>Base Plate</b>	Yes	No	Yes	No	Yes	No	Yes	No	
<b>Number of Valves</b>	<b>Sluice Valve</b>		8						
	<b>Non-Returning Valve</b>		4						
Overall Rating									
<b>Average Score</b>	1	2	3		4	5			
<b>Asset Condition</b>	Excellent	Good	Fair		Poor	Failing			
<b>Category</b>	A	B	C		D	E			
Remarks / Requirements									
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>									
<i>Data Collected By: Mr. Abdullah</i>			<i>Designation: Team Member</i>			 <i>Sign &amp; Date: 30 May 2023</i>			


Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Asset Detail			Pictures	
Name		Mini Disposal Anwarabad		
Location	Latitude	30.051696		
	Longitude	72.362719		
Address		Anwarabad, Vehari		
Area (Acres)		0.1		
Installation Year		2008		
Capital Cost of Machinery				
Outfall Drain Sewer	Dia	12"		
	Material	RCC		
Screening Chamber	No. of Screens	1		
	Screen Condition	Good	Fair	Poor
	Chamber Structure	Masonry		
Wet Wells	Number	1		
	Shape	Rectangular	Circular	
	Size	20'		
	Structure	Masonry	RCC	
	Railing	Yes	No	
Force Main	No. of force mains	1		
	Dia	6"		
	Material	MS		
	Starting Point	Pump House		
	Ending Point	Ultimate disposal point		
	Length	1.345 km		
Sullage Carrier	Size	No Sullage Carrier		
	Shape			
	Length			
	Condition			
Delivery Pipe	Dia	6"		
	Material	C.I		

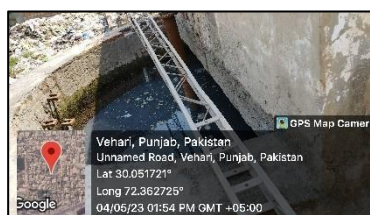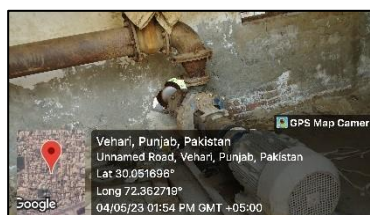








Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
Suction Pipe	Dia	6"		
	Material	C.I		
Number of Valves	Sluice Valves	2		
	Non-Return Valves	1		
	Penstock Valves	0		
Ultimate Disposal	Broad Irrigation			
Civil Structure Condition	Good	Fair	Poor	
Control Room Structure	Good	Fair	Poor	
Discharge Box Structure	Good	Fair	Poor	
Approach to Pump House	Good	Fair	Poor	
Hoisting Girder	Yes		No	
Boundary Wall & Gate	Yes		No	
Treatment of Sewage	Yes		No	
Wastewater daily discharge in m <sup>3</sup> /day? (based on available information at MC)	920			
Ultimate disposal of wastewater?				
Electro-Mechanical Equipment Details				
Number of WAPDA Feeders	1			
Transformer Capacity (kVA)	100 (Shared with Water Works)			
Number of MCU	1			
Sanctioned Load (kWh)	23			
Power Factor Improvement Equipment	Yes	No		
Service Cable	Yes	No		
Power Wiring	Yes	No		
Earthing of Motor	Yes	No		
Earthing of MCU	Yes	No		
Generator Availability	Yes	No		
Light Wiring of Pump House	Yes	No		
Change Over	Yes	No		

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
<b>Form:</b> IDAMP-A7	<b>Sewerage Disposal Station Asset Condition Assessment</b>			<b>Asset Code: _____</b> <b>Date: 04-05-2023</b>	
Pump Detail					
			<b>Pump A</b>		
<b>Pump Type</b>	Centrifugal/ Non-Clogging				
<b>Pump Brand</b>	KSB				
<b>Pump Paint</b>	Fair				
<b>Motor Brand</b>	Siemens				
<b>Installation Year of Pump</b>	2008				
<b>Discharge Capacity (Cusecs)</b>	1.5				
<b>Rotational Speed (RPM)</b>	1460				
<b>Head (ft.)</b>	30'				
<b>Motor Power (HP)</b>	20				
<b>Pump Daily Running Time (Hours)</b>	6				
<b>Base Plate</b>	Yes		No		
<b>Number of Valves</b>	<b>Sluice Valve</b>	2			
	<b>Non-Returning Valve</b>	1			
Overall Rating					
<b>Average Score</b>	1	2	3	4	5
<b>Asset Condition</b>	Excellent	Good	Fair	Poor	Failing
<b>Category</b>	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	



Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A7	Sewerage Disposal Station Asset Condition Assessment			Asset Code: _____	
				Date: 04-05-2023	
Asset Detail			Pictures		
<b>Name</b>		Pak Pattan Canal Disposal Station			
<b>Location</b>	<b>Latitude</b>	30.075052			
	<b>Longitude</b>	72.373216			
<b>Address</b>		Pak Pattan Canal, Vehari			
<b>Area (Acres)</b>		0.3			
<b>Installation Year</b>		2016			
<b>Capital Cost of Machinery</b>					
<b>Outfall Drain Sewer</b>	<b>Dia</b>	36"			
	<b>Material</b>	RCC			
<b>Screening Chamber</b>	<b>No. of Screens</b>	2			
	<b>Screen Condition</b>	Good	Fair		Poor
	<b>Chamber Structure</b>	Masonry			
<b>Wet Wells</b>	<b>Number</b>	2			
	<b>Shape</b>	Rectangular	Circular		
	<b>Size</b>	20'			
	<b>Structure</b>	Masonry	RCC		
	<b>Railing</b>	Yes	No		
<b>Force Main</b>	<b>No. of force mains</b>	1			
	<b>Dia</b>	28"			
	<b>Material</b>	Ductile Iron			
	<b>Starting Point</b>	Pump House			
	<b>Ending Point</b>	Ultimate disposal point			
	<b>Length</b>	500'			
<b>Sullage Carrier</b>	<b>Size</b>	No Sullage Carrier			
	<b>Shape</b>				
	<b>Length</b>				
	<b>Condition</b>				
<b>Delivery Pipe</b>	<b>Dia</b>	24"			

Integrated Development and Asset Management Plan (IDAMP)					
	Material	C.I			
Suction Pipe	Dia	24"			
	Material	C.I			
Number of Valves	Sluice Valves	8			
	Non-Return Valves	4			
	Penstock Valves	2			
Ultimate Disposal	Broad Irrigation				
Civil Structure Condition	Good	Fair	Poor		
Control Room Structure	Good	Fair	Poor		
Discharge Box Structure	Good	Fair	Poor		
Approach to Pump House	Good	Fair	Poor		
Hoisting Girder	Yes		No		
Boundary Wall & Gate	Yes		No		
Treatment of Sewage	Yes		No		
Wastewater daily discharge in m <sup>3</sup> /day? (based on available information at MC)	24545				
Ultimate disposal of wastewater?					
Electro-Mechanical Equipment Details					
Number of WAPDA Feeders	1				
Transformer Capacity (kVA)	200				
Number of MCU	3				
Sanctioned Load (kWh)	190				
Power Factor Improvement Equipment	Yes	No			
Service Cable	Yes	No			
Power Wiring	Yes	No			
Earthing of Motor	Yes	No			
Earthing of MCU	Yes	No			
Generator Availability	Yes	No			
Light Wiring of Pump House	Yes	No			
Change Over	Yes	No			
Pump Detail					
	Pump A	Pump B	Pump C	Pump D	Pump E



Integrated Development and Asset Management Plan (IDAMP)										
<b>Pump Type</b>	Centrifugal / Non-Clogging		Centrifugal / Non-Clogging		Centrifugal / Non-Clogging		Centrifugal / Non-Clogging		Centrifugal / Non-Clogging	
<b>Pump Brand</b>	PECO		PECO		PECO		PECO		PECO	
<b>Pump Paint</b>	Fair		Fair		Fair		Fair		Fair	
<b>Motor Brand</b>	PECO		PECO		PECO		PECO		PECO	
<b>Installation Year of Pump</b>	2016		2016		2016		2016		2016	
<b>Discharge Capacity (Cusecs)</b>	5		5		5		5		5	
<b>Rotational Speed (RPM)</b>	960		960		960		960		960	
<b>Head (ft.)</b>	50		50		50		50		50	
<b>Motor Power (HP)</b>	75		75		75		75		75	
<b>Pump Daily Running Time (Hours)</b>	12		12		12		12		4	
<b>Base Plate</b>	Yes	No	Yes	No	Yes	No	Yes	No	Yes	No
<b>Number of Valves</b>	<b>Sluice Valve</b>				8					
	<b>Non-Returning Valve</b>				4					
<b>Overall Rating</b>										
<b>Average Score</b>	1	2	3	4	5					
<b>Asset Condition</b>	Excellent	Good	Fair	Poor	Failing					
<b>Category</b>	A	B	C	D	E					
<b>Remarks / Requirements</b>										
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>										
<i>Data Collected By: Mr. Abdullah</i>			<i>Designation: Team Member</i>			 <i>Sign &amp; Date: 30 May 2023</i>				
<i>Data Checked By: Mr. M. Fiaz</i>			<i>Designation: Team Lead</i>			 <i>Sign &amp; Date: 30 May 2023</i>				

### B. Sewerage Network

Sr #	Dia	Length (meter)	Age (Years)	Condition	Book Value (PKR Million)	Material
1	9"	10143	17	Fair	0.36	RCC
2	12"	1396			0.06	RCC
3	15"	533			0.03	RCC
4	18"	293			0.02	RCC
5	24"	301			0.02	RCC
6	36"	866			0.16	RCC
7	9"	15158	39	Failing	0.05	RCC
8	12"	5982			0.02	RCC
9	15"	2169			0.01	RCC
10	18"	386			0.00	RCC
11	21"	1609			0.01	RCC
12	24"	954			0.01	RCC
13	27"	188			0.00	RCC
14	30"	1210			0.02	RCC
15	33"	305			0.01	RCC
16	36"	52			0.00	RCC
17	9"	8953	15	Good	0.392	RCC
18	12"	7231			0.360	RCC
19	15"	562			0.034	RCC
20	21"	300			0.026	RCC
21	24"	716			0.073	RCC
22	27"	1628			0.229	RCC
23	30"	1222			0.223	RCC
24	9"	2389	7	Excellent	0.157	RCC

Sr #	Dia	Length (meter)	Age (Years)	Condition	Book Value (PKR Million)	Material
25	12"	4851			0.362	RCC
26	15"	470			0.043	RCC
27	18"	1056			0.1055	RCC
28	21"	443			0.0566	RCC
29	24"	99			0.015	RCC
30	27"	1533			0.3235	RCC
31	30"	528			0.1448	RCC
32	9"	32980	47	Failing	0	RCC
33	12"	3208			0	RCC
34	15"	4194			0	RCC
35	18"	1226			0	RCC
36	21"	947			0	RCC
37	24"	1505			0	RCC
38	27"	600			0	RCC
39	9"	8639			0	RCC
40	12"	1114			0	RCC
41	15"	204			0	RCC
42	18"	410			0	RCC
43	24"	539			0	RCC
44	9"	10533			0	RCC
45	12"	3981			0	RCC
46	15"	2296			0	RCC
47	18"	1348			0	RCC
48	21"	444			0	RCC
49	24"	989			0	RCC
50	27"	572			0	RCC
51	33"	195			0	RCC



---

Sr #	Dia	Length (meter)	Age (Years)	Condition	Book Value (PKR Million)	Material
52	36"	47			0	RCC

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A6	Sewerage Network Asset Condition Assessment			Asset Code: _____ Date: 05-05-2023	
Description	Area (Acres)		Percentage		
Served Area	1938		45		
Flooded Area	1089		56		
Unserved Area	2405		55		
Type and number of complaints received to MC regarding sewerage system?	55 (Blockage)				
Steps considered by MC to resolve the complaints					
Pipe Dia (inches)	Pipe Material	Length (ft)	No. of Manholes	Year of Laying	Age of Pipe
9	RCC	10143	666	2006	17
12	RCC	1396	46	2006	17
15	RCC	533	12	2006	17
18	RCC	293	5	2006	17
24	RCC	301	4	2006	17
36	RCC	866	9	2006	17
9	RCC	15158	995	1984	39
12	RCC	5982	196	1984	39
15	RCC	2169	47	1984	39
18	RCC	386	6	1984	39
21	RCC	1609	21	1984	39
24	RCC	954	13	1984	39
27	RCC	188	2	1984	39
30	RCC	1210	13	1984	39
33	RCC	305	3	1984	39
36	RCC	52	1	1984	39
9	RCC	8953	587	2008	15


Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A6	Sewerage Network Asset Condition Assessment			Asset Code: _____ Date: 05-05-2023	
12	RCC	7231	237	2008	15
15	RCC	562	12	2008	15
21	RCC	300	4	2008	15
24	RCC	716	9	2008	15
27	RCC	1628	18	2008	15
30	RCC	1222	13	2008	15
9	RCC	2389	157	2016	7
12	RCC	4851	159	2016	7
15	RCC	470	10	2016	7
18	RCC	1056	17	2016	7
21	RCC	443	6	2016	7
24	RCC	99	1	2016	7
27	RCC	1533	17	2016	7
30	RCC	528	6	2016	7
9	RCC	32980	2164	1976	47
12	RCC	3208	105	1976	47
15	RCC	4194	92	1976	47
18	RCC	1226	20	1976	47
21	RCC	947	12	1976	47
24	RCC	1505	20	1976	47
27	RCC	600	7	1976	47
9	RCC	8639	567	1976	47
12	RCC	1114	37	1976	47
15	RCC	204	4	1976	47
18	RCC	410	7	1976	47
24	RCC	539	7	1976	47
9	RCC	10533	691	1976	47
12	RCC	3981	131	1976	47
15	RCC	2296	50	1976	47





Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A6	Sewerage Network Asset Condition Assessment			Asset Code: _____ Date: 05-05-2023	
<b>18</b>	RCC	1348	22	1976	47
<b>21</b>	RCC	444	6	1976	47
<b>24</b>	RCC	989	13	1976	47
<b>27</b>	RCC	572	6	1976	47
<b>33</b>	RCC	195	2	1976	47
<b>36</b>	RCC	47	1	1976	47
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>	

### C. Vehicles/ Machinery


Sr #	Name	Registration Number	Age (Years)	Condition	Status	Book Value (PKR Million)	Capacity
1	Suction Machine-Nissan	VRG-10-1021	16	Fair	Functional	3.5	6000 cc
2	Jetting Machine-Nissan	VRG-10-1022	15	Fair	Functional	3.9	6000 cc
3	De Watering Sets (6 Nos)	-	-	Good	Functional		
4	Shoulder Foggers (12 Nos)	Not Applicable	10	Fair	Functional	Not Available	Not Available
5	Spray Pumps (25 Nos)	Not Applicable	10	Fair	Functional	Not Available	Not Available
6	Safety Gear (37 Nos)	Not Applicable	10	Fair	Functional	Not Available	Not Available

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A16	Moveable Asset Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
Type of Vehicle / Machinery	Pictures	
Sucker & Jetting Machine		
	Suction Machine	Jetting Machine
<b>Capacity</b>	4500 liters	4500 liters
<b>Purpose</b>	Suction	Jetting
<b>Year of Manufacturing</b>	2007	2008
<b>Model</b>	Nissan-PKB 211	Nissan-PKB 211
<b>Capital Cost</b>		
<b>Fuel Consumption (Lt)</b>	514	341
<b>Condition</b>	Fair	Fair
<b>Engine Capacity</b>	4500 CC	4500 CC
<b>Maintenance Cost</b>	Not Available	Not Available
<b>Oiling /Fitness</b>	Yes	Yes
<b>Fitness Certificate</b>	No	No
<b>Registered</b>	VRG 10-1021	VRG 10-1022
<b>Overall Rating</b>	Fair	Fair
<b>Remarks / Requirements</b>		

<ul style="list-style-type: none"><li>No Remarks</li></ul>		
Data Collected By: Mr. Abdullah	Designation: Team Member	 Sign & Date: 30 May 2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

### 3. Solid Waste Management


#### Key Components of Solid Waste Management System

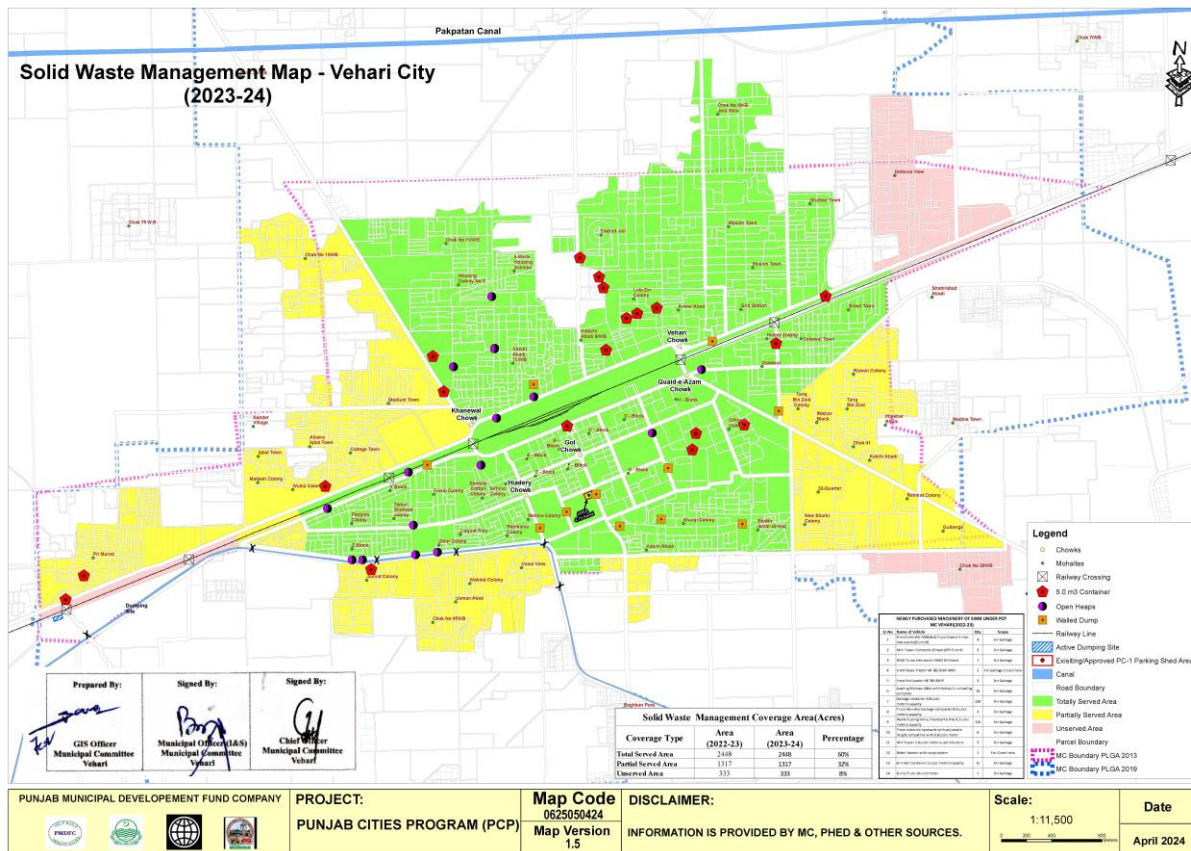






## A. Dumping Site

Sr #	Name	Age (Years)	Condition	Status	Book Value (PKR Million)	Area (Acres)	Ownership
1	Peer Murad, Multan Road	3	Poor	Functional	19.5	6.5	Revenue Department

Integrated Development And Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A11	Solid Waste Dumping Site Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023		
Name		Multan Road Dumping Site	<div style="text-align: center;"><b>Pictures</b></div> 		
Location	Latitude	30.029890			
	Longitude	72.309460			
Address		Peer Murad Multan Road			
Area (Acres)		6.5			
Distance from urban area		6 km			
Year the site started for dumping service		2020			
Average waste dumped daily (based on information provided by MC)		54 Ton			
EHS SOPs for waste handlers		No			
Availability of PPEs for waste collectors/handlers		Yes		No	
Expected Life (Years)		3			
Land Ownership		Revenue Department			
Site Accessibility		Good		Fair	Poor
Surface Type		Flat		Depressed	
Approach Road Condition		Good		Fair	Poor
Parking Shed		Yes		No	
Boundary Wall		Yes		No	
Gate		Yes	No		
Ramps		Yes	No		
Any Building at Site		Yes	No		
Weigh Bridge		Yes	No		
Earth Cover Arrangements		Yes	No		



Integrated Development And Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A11	Solid Waste Dumping Site Asset Condition Assessment			Asset Code: _____	Date: 04-05-2023
Compaction Equipment	Yes	No			
Plantation Around Site	Yes	No			
Any illegal occupants or encroachments observed- if yes, type	No				
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>Presently MC collects solid wastes and dispose off at plain area dumping site i.e. 6.5 acres. This is not a proper disposal of solid wastes in respect of environment and utilization of land. MC should be given a landfill site project for the better utilization of available land.</li> </ul>					
Data Collected By: Mr. Abdullah	Designation: Team Member		 Sign & Date: 30 May 2023		



Integrated Development And Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A11	Solid Waste Dumping Site Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023


**B. Vehicles/ Machinery**



Sr #	Name	Registration Number	Quantity	Age (Years)	Condition	Status	Book Value (PKR Million)	Capacity
1	New Holland	VR 1612	1	11	Fair	Functional	0.55	55 Hp
2	Millat	VRG-10-1003	1	14	Fair	Functional	0.4	50 Hp
3	Millat	VRB 1510	1	38	Poor	Functional	0.08	51 Hp
4	Mazda	VRE 1912	1	28	Poor	Functional	0.15	3500 cc
5	Mazda	VRB 750	1	16	Fair	Functional	0.38	3000 cc
6	Hino-300	VRJ-12-16	1	11	Fair	Functional	0.54	4000 cc
7	ISUZU	VRK 7577	1	16	Fair	Functional	0.39	4300 cc
8	Millat	Tractor MF375	1	33	Poor	Functional	0.1	75 Hp
9	Mazda	VRA 2457	1	38	Poor	Non-Functional	0.078	3000 cc
10	BMC Lorry	MNA 3648	1	51	Poor	Non-Functional	0	190 Hp
11	Millat-Front Loader	VRJ-16-13	1	7	Good	Functional	0.7	85 Hp
12	Containers 5 m3 (Total No.7)	Not Available	7	-	Good	All Functional	Not Available	5 Cubic Meter
13	Truck Mounted Garbage Compactor 8.0 M <sup>3</sup>	Not Available	3	1	Excellent	Functional	4.0	8.0 M <sup>3</sup>
14	Water Bowser With Spray System	Not Available	1	1	Excellent	Functional	1.3	12000 gallon
15	Mini Tipper Complete.(Chassis)efi Euro III.	Not Available	3	1	Excellent	Functional	6.5	Not Available

Sr #	Name	Registration Number	Quantity	Age (Years)	Condition	Status	Book Value (PKR Million)	Capacity
16	Front Blade Tractor MF 385 85HP 4WD	Not Available	2	1	Excellent	Functional	1.9	385 85HP 4WD
17	Front End Loader MF 385 85HP	Not Available	3	1	Excellent	Functional	2.4	385 85HP
18	Loading Rikshaw 200cc With Hydraulic Unloading Complete	Not Available	10	1	Excellent	Functional	0.4	200cc
19	Dump Truck 10 Cubic Meter	Not Available	1	1	Excellent	Functional	3.1	Not Available
20	Waste Tipping Trolley / Hand Cart 0.4 ~ 0.5 M3 Capacity	Not Available	150	1	Excellent	Functional	0.1	0.4 ~ 0.5 M3 Capacity
21	Three Wheeled Handcarts With Adjustable Height Compatible With 0.8 Cubic Meter Containers	Not Available	8	1	Excellent	Functional	0.1	0.8 Cubic Meter Containers
22	Arm Roll Container 5 Cubic Meter	Not Available	15	1	Excellent	Functional	0.4	5 Cubic Meter
23	Garbage Container 0.8 Cubic Meter Capacity	Not Available	228	1	Excellent	Functional	0.1	0.8 Cubic Meter

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A16	Moveable Asset Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Type of Vehicle / Machinery	Pictures				
Tractor					
	Tractor- 1	Tractor- 2	Tractor- 3	Tractor- 4	Tractor-5
<b>Capacity</b>	75 HP	50 HP	85 HP	50 HP	55 HP
<b>Purpose</b>	SWM	SWM	SWM	SWM	SWM
<b>Year of Manufacturing</b>	1990	1986	2016	2009	2012
<b>Model</b>	MF375	MF240	MF385	MF240	New Holland 480 Special
<b>Capital Cost</b>					
<b>Fuel Consumption (Lt)</b>	485	98	648	338	396
<b>Condition</b>	Poor	Poor	Good	Fair	Fair
<b>Engine Capacity</b>	75 HP	50 HP	85 HP	50 HP	55 HP
<b>Maintenance Cost</b>	Not Available	Not Available	Not Available	Not Available	Not Available
<b>Oiling /Fitness</b>	Yes	Yes	Yes	Yes	Yes
<b>Fitness Certificate</b>	No	No	No	No	No
<b>Registered</b>	Not Registered	VRB 1510	VRJ-16-13	VRG-10-1003	VR 1612
<b>Overall Rating</b>	Poor	Poor	Good	Fair	Fair

Remarks / Requirements		
• No Remarks		
Data Collected By: Mr. Abdullah	Designation: Team Member	 Sign & Date: 30 May 2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A16	Moveable Asset Asset Condition Assessment				Asset Code: _____ Date: 04-05-2023	
Type of Vehicle / Machinery	Pictures					
Truck						
	Truck- 1	Truck- 2	Truck- 3	Truck- 4	Truck- 5	Truck- 6
<b>Capacity</b>	5 m <sup>3</sup>	5 m <sup>3</sup>	5 m <sup>3</sup>	5 m <sup>3</sup>	5 m <sup>3</sup>	5 m <sup>3</sup>
<b>Purpose</b>	SWM	SWM	SWM	SWM	SWM	SWM
<b>Year of Manufacturing</b>	2012	2007	1995	1985	1985	1972
<b>Model</b>	Hino-Dutro WU720R	ISUZU-NPR 66	Mazda	Mazda	Mazda	BMC Lorry
<b>Capital Cost</b>						
<b>Fuel Consumption (Lt) (Lt)</b>	504	388	403	294	Non- Functional	Non- Functional
<b>Condition</b>	Fair	Fair	Fair	Poor	Poor	Poor
<b>Engine Capacity</b>	4009 CC	4300 CC0	3500 CC	3000 CC	3000 CC	190 HP
<b>Maintenance Cost</b>	Not Available	Not Available	Not Available	Not Available	Not Available	Not Available
<b>Oiling /Fitness</b>	Yes	Yes	Yes	Yes	No	No
<b>Fitness Certificate</b>	No	No	No	No	No	No
<b>Registered</b>	VRJ-12-16	VRK 7577	VRE 1912	VRB 750	VRA 2457	MNA 3648
<b>Overall Rating</b>	Fair	Fair	Fair	Poor	Poor	Poor
<b>Remarks / Requirements</b>						

<ul style="list-style-type: none"><li>No Remarks</li></ul>		
<i>Data Collected By: Mr. Abdullah</i>	<i>Designation: Team Member</i>	 <i>Sign &amp; Date: 30 May 2023</i>
<i>Data Checked By: Mr. M. Fiaz</i>	<i>Designation: Team Lead</i>	 <i>Sign &amp; Date: 30 May 2023</i>






#### 4. Building

##### A. Offices

Sr #	Name	Age (Year)	Condition	Total	Area
1	MC Office	1929	Good	1	1.6

Integrated Development and Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A14	Building Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023
Name	MC Office		<div style="text-align: center;"><b>Pictures</b></div>
Location	Latitude	30.041842	
	Longitude	72.353098	
Address	MC Office, Vehari		
Year of Construction	1929		
Land Area (Acres)	1.5		
No. of Stories	1		
Condition	Fair		
Purpose	Municipal Affairs		
No. of Staff	200		
No. of Rooms	24		
Conference/Meeting Room	Yes	No	
Store Room	Yes	No	
Study Room/Book Shelf	Yes	No	
Boundary Wall	Yes	No	
Heating & Cooling Arrangement	Yes	No	
Parking Lots	Yes	No	
Drinking Water Facilities	Yes	No	
Availability and quality of water (based on available water quality test reports)	Yes	No	
Washrooms / Sewerage System	Yes	No	

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A14	Building Asset Condition Assessment			Asset Code: _____	Date: 04-05-2023
Separate Washroom for Ladies	Yes	No			
Prayers Area/room	Yes	No			
Furniture	Yes	No			
Electric Appliances (Fans Etc.)	Yes	No			
Machinery & Equipment	Yes	No			
Sports Club	Yes	No			
Staff Attendance System	Yes	No			
Emergency Alarm System	Yes	No			
Fire Fighting System / Equipment	Yes	No			
Ramps for wheel chairs at entry gate	Yes	No			
Security Guard	Yes	No			
Park/lawn outdoor/indoor plantation	Yes	No			
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead			

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
Form: IDAMP-A14	Building Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023
		<i>Sign &amp; Date: 30 May 2023</i>

### B. Residential Buildings

Sr #	Location	Condition	Total
1	Near Patwar Khana C Block	Fair	1
2	H Block Near Fire Brigade Vehari	Fair	10
3	Chak No.11 WB Vehari	Fair	2
4	Tamoor Shahed Colony Vehari	Fair	1
5	Sharqi Colony Vehari	Fair	1
6	157. G Block Vehari	Fair	18
7	B Block Near Baag wali Masjid Vehari	Fair	3
8	DPS School Vehari	Fair	6
9	148 G block Vehari	Fair	1
10	149 G block Vehari	Fair	1
11	150 G block Vehari	Fair	1
12	Khanewal Road	Fair	1

### C. Other Buildings

Sr #	Name	Condition	Total
1	Club Road Vehari	Fair	2
2	Octroi Post Eid Gah Road Vehari	Fair	1
3	Octroi Post Near Liaqat Pura Katchi Mandi	Fair	1
4	Octroi Post Adda Pir Murad Vehari	Fair	1
5	Octroi Post Near Railway Station	Fair	2
6	Octroi Post Danewal	Fair	1
7	Octroi Post Multan Road Near Bani Shell	Fair	1
8	Octroi Post Khanewal Chowk	Fair	1
9	Octroi Post Karam Pur Road	Fair	1
10	Octroi Post Old General Bus Stand	Fair	1
11	Octroi Post Near 13/WB Khanewal Road	Fair	1
12	157. G Block Vehari	Fair	1
13	Octroi Post Burewala Road	Fair	2
14	Near Patwar Khana C Block	Fair	1



### D. Shops

Sr #	Location	Age (Years)	Condition	Total	Area sq_ft	Book Value
1	Mini Market	1971	Good	61	48	3.5
2	PSO Depot Shops	1971	Good	6	80	0.5
3	Taimoor Shaheed Colony Shops	1971	Good	12	80	0.75
4	Inner Grain Market	1971	Good	8	80	4.5
5	Zoo Shops	1971	Good	2	80	0.6
6	Lorry Adda-Built Plots	1971	Good	6	80	4.5
7	Lorry Adda- Empty plots	1971	Good	49	80	4.5
8	Lorry Adda-Cabins	1971	Good	3	80	0.75
9	Municipal Market	1971	Good	32	96	5
10	Gol Chowk	1971	Good	75	96	3
11	Shaheen Market	1971	Good	179	96	2.5
12	Jinnah Plaza	1971	Good	13	120	3
13	Club Road	1971	Good	165	120	5.5
14	Shopping Center Block C	1971	Good	47	170	4.5
15	Club Road Gabri	1971	Good	128	200	5.5
16	Stadium Road	1971	Good	119	200	5.5
17	Shopping Center Block C	1971	Good	51	240	2
18	Lorry Adda-Workshop	1971	Good	21	80	5.5

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
1	23087075	Stadium Road Vehari	30.04213333	72.34439	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Salman	Ali ahmad Chulha center
2	5087036	Club Road Sharqi Vehari	30.044195	72.351835	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ibraheem	Aslah Dealer
3	16087036	Block C, Vehari	30.04229167	72.35286333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Atiq Ur Rehman	Atar Shop
4	22087001	Block C, Vehari	30.04483	72.35410333	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem Akhtar s.20	Auto
5	26087005	Auction Empty Plot (Lorry Adda)	30.04789167	72.35984	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Auto Shop
6	26087001	Auction Empty Plot (Lorry Adda)	30.04796167	72.35984	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Riaz Hussain	Auto Shop
7	23087081	Stadium Road Vehari	30.042035	72.34452333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sadique Khan	Auto Shop
8	23087095	Stadium Road Vehari	30.041995	72.34470333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ahmad Sohail	Auto Shop
9	23087094	Stadium Road Vehari	30.04190667	72.34480833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abbas	Auto Shop



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
10	23087101	Stadium Road Vehari	30.04186667	72.34496333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shahid Mehmood	Auto Shop
11	23087104	Stadium Road Vehari	30.04185833	72.34507167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Altaf Hussain	Auto Shop
12	23087108	Stadium Road Vehari	30.04187	72.34515167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Liaqat Ali	Auto Shop
13	24087011	Taimoor Shaheed Colony	30.03678333	72.33374167	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Auto Shop
14	7087005	Block C, Vehari	30.04223167	72.352775	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khurram Sajjad	Cloth Shop
15	9087002	Godown Old Meat Market	30.04140833	72.35298167	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Furniture Shop
16	9087001	Godown Old Meat Market	30.04134667	72.35309333	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zulfiqar Ali	Gas Agency
17	5087096	Club Road Sharqi Market	30.044855	72.35381	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Arshad Ali	Auto Shop
18	5087095	Club Road Sharqi Market	30.044815	72.35378333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shareef ,	Auto Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
													Muhammad Sarwar	
19	5087091	Club Road Sharqi Market	30.04476167	72.35360167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram	Auto Shop
20	21087026	Shaheen Market	30.04626167	72.35743167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Munir Ahmad Sabri	Auto Shop
21	21087027	Shaheen Market	30.04631833	72.35742	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Munir Ahmad Sabri	Auto Shop
22	21087028	Shaheen Market	30.04640667	72.357485	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam 28	Auto Shop
23	21087029	Shaheen Market	30.04633167	72.35753833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam 29	Auto Shop
24	21087030	Shaheen Market	30.04629167	72.35755167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam 30	Auto Shop
25	21087046	Shaheen Market	30.04668833	72.357265	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam 45	Auto Shop
26	21087060	Shaheen Market	30.046125	72.35744333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ikhtlaq Hussain	Auto Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
27	21087024	Shaheen Market	30.04613833	72.35741833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rasheed	Auto Shop
28	21087106	Shaheen Market	30.04668667	72.35716667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zulfiqar Ali, Abdul Qadir	Auto Shop
29	21087110	Shaheen Market	30.04673	72.357205	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saeed , Abdul Qayyum	Auto Shop
30	21087113	Shaheen Market	30.04673667	72.35716833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghani	Auto Shop
31	21087149	Shaheen Market	30.04634833	72.35696167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif 159	Auto Shop
32	23087016	Stadium Road	30.04197333	72.34492667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tasveer UI Haq	Auto Shop
33	23087017	Stadium Road	30.04199167	72.34493667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Boota	Auto Shop
34	23087020	Stadium Road	30.04206833	72.34480833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amir Mehmood-24	Auto Shop
35	23087021	Stadium Road	30.04205167	72.34478	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shah Rasool	Auto Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
36	23087022	Stadium Road	30.04206833	72.34480167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal	Auto Shop
37	23087063	Stadium Road Vehari	30.04239333	72.34410667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rafique	Auto Shop
38	23087025	Stadium Road Vehari	30.042085	72.34467833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Quratulain	Auto Shop
39	23087028	Stadium Road Vehari	30.04211833	72.34460667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Khalid	Auto Shop
40	23087007	Stadium Road	30.042105	72.34556333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Nabi	Auto Shop
41	23087116	Club Road Vehari	30.04206333	72.34563333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nazir Ahmad	auto shop
42	23087001	Stadium Road	30.04205667	72.34552833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saeeda Begum	Auto Shop
43	23087117	Stadium Road	30.04208833	72.34552	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal	Auto Shop
44	23087003	Stadium Road Vehari	30.04192667	72.34568833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Suleman, Nawab Ali	Auto Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
45	23087002	Stadium Road	30.04205333	72.34548667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amjad Hameed	Auto Shop
46	23087005	Stadium Road	30.04204167	72.34552833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Hameed-8	Auto Shop
47	23087049	Stadium Road Vehari	30.04238333	72.344235	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rasheed	Auto Shop
48	23087051	Stadium Road Vehari	30.04247	72.34423167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ibrahim	Auto Shop
49	23087054	Stadium Road Vehari	30.04257	72.34420833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shaikh Ameer Hussain	Auto Shop
50	23087008	Stadium Road	30.04206333	72.34536333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khizar Hayat	Auto Shop
51	23087009	Stadium Road	30.04202	72.34536	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Munawar Hussain, Shazia Yousaf	Auto Shop
52	23087066	Stadium Road Vehari	30.042355	72.34411833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Auto Shop
53	23087067	Stadium Road Vehari	30.04235667	72.34413167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Basheer Ahmad	Auto Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
54	23087070	Stadium Road Vehari	30.04228667	72.34419333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yaqoob	Auto Shop
55	4087097	Club Road Garbi	30.04239833	72.34684667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bashir Ahmad	Auto Shop
56	23087092	Stadium Road Vehari	30.04257333	72.34714333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Auto Shop
57	4087118	Club Road Garbi	30.04231167	72.346495	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar 117	Auto Shop
58	4087114	Club Road Garbi	30.04237833	72.34649333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Imran	Auto Shop
59	4087091	Club Road Garbi	30.04265667	72.34729	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rasheed	Auto Shop
60	4087099	Club Road Garbi	30.04257333	72.34704167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Latif	Auto Shop
61	4087094	Club Road Garbi	30.04264333	72.34715167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Shakoor	Auto Shop
62	4087119	Club Road Garbi	30.04232167	72.34651333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Javed Iqbal, Abdul Majeed,	Auto Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
63	23087091	Stadium Road Vehari	30.04188833	72.34471667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad	Auto Shop
64	26087028	Auctioned Empty Plot (Lorry Adda)	30.04730167	72.36068667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal, Muhammad Siddique	Auto Shop
65	26087037	Auctioned Empty Plot (Lorry Adda)	30.04719167	72.36032	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif	Auto Shop
66	26087041	Auctioned Empty Plot (Lorry Adda)	30.04730333	72.36073667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Qayyum Khan	Auto Shop
67	4087096	Club Road Garbi	30.04262333	72.34722	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faryad Ali	Auto Shop
68	4087095	Club Road Garbi	30.04256333	72.34703167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rafique	Auto Shop
69	23087111	Stadium Road Vehari	30.04155333	72.35318833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Auto Shop
70	26087042	Auctioned Empty Plot (Lorry Adda)	30.04729667	72.36070167	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saleem, Tariq Hameed	Auto Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
71	15087052	Mini Market Block C, Vehari	30.04404167	72.35325167	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Sattar	Bag
72	15087041	Mini Market Block C, Vehari	30.04423	72.35317167	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Jameel Hussain Shah	Bag Shop
73	15087042	Mini Market Block C, Vehari	30.044295	72.35316667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Sarfraz Ahmad	Bag Shop
74	22087004	Block C, Vehari	30.04432645	72.35312404	170	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Hamid (SCC)	bag shop
75	22087060	Block C, Vehari	30.04439806	72.35311977	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Rasool	bags shop
76	7087047	Block C, Vehari	30.04221833	72.35262667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashraf	Bakers Shop
77	5087159	Club Road Sharqi Market	30.045495	72.35579	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rauf	Bakers Shop
78	5087158	Club Road Sharqi Market	30.04548	72.35569333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ayoub	Bakers Shop
79	5087103	Club Road Sharqi Market	30.04493333	72.35413667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafiq, Faqeer	Bakers Shop



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
													Muhammad, M.Ramzan	
80	5087104	Club Road Sharqi Market	30.04488	72.35410167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafi, Muhammad Faqir, M.Ramzan 98	Bakers Shop
81	21087011	Shaheen Market	30.045995	72.35662333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mst. Shafqat Riaz	Bakers Shop
82	4087081	Club Road Garbi	30.04278333	72.34762833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zulfiqar Ali 80	Bakers Shop
83	5087124	Club Road Sharqi Market	30.04514667	72.35465667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Amin	Bance Shop
84	5087114	Club Road Sharqi Market	30.04496333	72.35417333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	M Ashraf	Bao pan shop
85	26087006	Auction empty Plot (Lorry Adda)	30.04793	72.36001	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Pervaz Hameed	Barbar Shop
86	2087004	Built Plot (Lorry Adda)	30.048275	72.36093667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ashfaq Ahmad Rafique	Barbar Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
87	26087015	Auctioned Empty Plot (Lorry Adda)	30.04796667	72.36048667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Syed Najmal Ul Hassan Shah	Barbar Shop
88	26087018	Auctioned Empty Plot (Lorry Adda)	30.04809167	72.36062167	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Javed Hassan	Barbar Shop
89	7087034	Block C, Vehari	30.04167333	72.35265333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Subhan Mehmood	Barbar Shop
90	5087022	Club Road Sharqi Market	30.04397333	72.35134667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Fiaz	Barbar Shop
91	24087008	Taimoor Shaheed Colony	30.03673833	72.33354333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashraf	Barbar Shop
92	22087005	Block C, Vehari	30.04447333	72.35354167	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tahir Saleem	Barbar Shop
93	26087020	Auctioned Empty Plot (Lorry Adda)	30.04723	72.360385	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ch.Zahoor Akbar, Manzooran	Barbar Shop
94	7087068	Block C, Vehari	30.04195167	72.35274333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Subhan Mehmood	Barbar Shop
95	5087055	Club Road Sharqi Market	30.04436667	72.35252333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashraf	Barten Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
96	26087036	Auctioned Empty Plot (Lorry Adda)	30.04719667	72.36035167	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad	Battery Shop
97	16087028	Block C, Vehari	30.04223	72.35323333	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Manzoor Ahmad	Bed Sheet Shop
98	16087034	Block C, Vehari	30.042135	72.35306833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam s.30	Bed Sheet Shop
99	16087016	Block C, Vehari	30.04225833	72.352945	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Bashir Ahmad	Bed Sheet Shop
100	16087015	Block C, Vehari	30.04227167	72.35292667	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Saeed Ahmad	Bed Sheet Shop
101	16087009	Block C, Vehari	30.042355	72.35288	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Saeed Akhtar	Bed Sheet Shop
102	16087030	Block C, Vehari	30.04224	72.35292	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Bed Sheet Shop
103	4087105	Club Road Garbi	30.042535	72.34687	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saeeda Begum	Bike Design shop
104	4087112	Club Road Garbi	30.04249167	72.346595	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Arif Hussain	Bike Design Shop &

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
														Number Plate
105	21087108	Shaheen Market	30.04585167	72.35725667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Zahid	bike ship
106	4087111	Club Road Garbi	30.04244667	72.34676167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hameed Ali 110	Bike Spare Patrs
107	5087140	Club Road Sharqi Market	30.04533	72.35530333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Bilal Saeed	Biryani Shop
108	19087014	Plot Workshop (Lorry Adda)	30.04771	72.359305	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Irshad,Tahir,Rafique,Rashed,Shafique,SharifKhalid	Body Maker
109	14087003	Jinnah Plaza	30.04140167	72.35306333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shaikh Abdul Malik	Book Depot
110	14087004	Jinnah Plaza	30.04139667	72.35306167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Adnan Shahzad	Book Depot
111	14087001	Jinnah Plaza	30.04138333	72.35303333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Murtaza	Book Depot
112	21087162	Shaheen Market	30.046605	72.35692667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Lal Deen	Book Depot

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
113	22087003	Block C, Vehari	30.04446833	72.353255	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Malik Sardool	Book Depot
114	23087039	Stadium Road Vehari	30.04225167	72.34437167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nadeem Akhtar	Book Depot
115	23087040	Stadium Road Vehari	30.04226	72.34433667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Riasat Ali	Book Depot
116	23087118	Stadium Road	30.04202667	72.34552167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Hameed	Book Depot
117	23087004	Stadium Road	30.042125	72.345445	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Arshad	Book Depot
118	23087006	Stadium Road	30.04200833	72.34534167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Rasool	Book Depot
119	23087038	Stadium Road Vehari	30.042235	72.34437667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saeed Akhtar	book shop
120	3087001	Canteen & Wooden Cabin (Lorry Adda)	30.04774833	72.36100667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nadeem Aslam Sethi	buss ticket

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
121	22087045	Block C, Vehari	30.04442333	72.353135	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Rasool	Carpet Shop
122	5087090	Club Road Sharqi Market	30.04479333	72.35360667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mst. Naveed Begum	CD Shop
123	5087120	Club Road Sharqi Market	30.04517833	72.35453667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Qasim, Muhammad Jawad	Chaar Pai Shop
124	5087089	Club Road Sharqi Market	30.04481333	72.35362167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Aas Muhammad	Chaar Pai Shop
125	5087066	Club Road Sharqi Market	30.04456667	72.35276667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ramzan	Char pai Shop
126	7087029	Block C, Vehari	30.041755	72.35275667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amjad Ali	Chicken Shop
127	7087035	Goal Chowk Vehari	30.04176667	72.352645	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tariq Hanif	Chicken Shop
128	7087036	Block C, Vehari	30.041795	72.35261167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khursheed bibi	Chicken Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
129	21087001	Shaheen Market	30.04584667	72.35627667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Altaf Hussain	Chicken Shop
130	21087075	Shaheen Market	30.04672333	72.35679333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Jamshaid Khan	Chicken Shop
131	21087018	Shaheen Market	30.046205	72.35743	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ali Muhammad	Chicken Shop
132	19087003	Plot Workshop (Lorry Adda)	30.04749	72.36051667	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nokar Abbas Alamdar	Chicken Shop
133	7087037	Mini Market Block C, Vehari	30.041845	72.35258333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem	Chicken Shop
134	22087034	Block C, Vehari	30.04487892	72.35437784	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Arshad	cical Shop
135	16087011	Block C, Vehari	30.04243833	72.35298333	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Saleem	Clean
136	4087122	Club Road Garbi	30.04232167	72.34647833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Dost Muhammad, Muhammad Shafi	Clean Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
137	5087106	Club Road Sharqi Market	30.044925	72.35408667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nazar Hussain, Azhar Mujeeb Asimm	Clinic
138	15087039	Mini Market Block C, Vehari	30.04392667	72.35327333	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Sajid Azeem	Cloth
139	26087011	Auctioned Empty Plot (Lorry Adda)	30.04798167	72.36031	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Asif Javed	Close
140	5087130	Club Road Sharqi Market	30.04514167	72.35484167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Qamar Din	close
141	21087157	Shaheen Market	30.04547667	72.35571667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Latif 173	Close
142	21087160	Shaheen Market	30.04663167	72.35712667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hamad Ali	close
143	21087057	Shaheen Market	30.04687167	72.35719167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ali Akbar 57	Close
144	21087069	Shaheen Market	30.04653	72.35731333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Latif	Close



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
145	21087053	Shaheen Market	30.04625167	72.35745	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram	Close
146	21087144	Shaheen Market	30.04645833	72.35698667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yaseen 154	Close
147	21087163	Shaheen Market	30.04665167	72.35690833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Latif 173	Close
148	21087159	Shaheen Market	30.04670667	72.35712667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Atta Muhammad	Close
149	21087145	Shaheen Market	30.04646	72.35726333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shareefan Bibi	Close
150	21087143	Shaheen Market	30.04649167	72.356885	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad yaseen 153	Close
151	21087155	Shaheen Market	30.046265	72.35709833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashraf 165	Close
152	4087030	Club Road Garbi	30.04333667	72.34938333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ilyas Khan	close
153	23087093	Stadium Road Vehari	30.04191333	72.34477	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hussain	close

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
154	15087001	Mini Market Block C, Vehari	30.0438	72.35296333	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Hussain	Cloth Shop
155	6087003	Corner Goal Chock	30.04226833	72.35277833	20	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Muhammad	Cloth Shop
156	7087007	Block C, Vehari	30.04216	72.35284167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Diwan Khan	Cloth Shop
157	7087008	Block C, Vehari	30.04220333	72.35294167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Bilal	Cloth Shop
158	7087006	Block C, Vehari	30.04219	72.35283833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhamamd Din	Cloth Shop
159	7087009	Block C, Vehari	30.04227667	72.35291333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tariq Sohail, Imran Ali, Numan Ali	Cloth Shop
160	7087010	Block C, Vehari	30.04220667	72.353005	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sultan	Cloth Shop
161	7087011	Block C, Vehari	30.04215833	72.35295833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif	Cloth Shop
162	7087012	Block C, Vehari	30.04213667	72.35300667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saeed	Cloth Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
163	7087013	Block C, Vehari	30.042165	72.35315167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Latif	Cloth Shop
164	7087014	Block C, Vehari	30.04215167	72.35302	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Latif	Cloth Shop
165	15087040	Mini Market Block C, Vehari	30.04398667	72.35339	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Riaz Ahmad	Cloth Shop
166	15087045	Mini Market Block C, Vehari	30.04426833	72.35332	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Liaqat Ali Shah	Cloth Shop
167	15087006	Mini Market Block C, Vehari	30.04384	72.35313667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Sattar	Cloth Shop
168	15087054	Mini Market Block C, Vehari	30.04397167	72.35329	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Ashraf	Cloth Shop
169	15087055	Mini Market Block C, Vehari	30.04401	72.35336333	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Anwar UI Haq	Cloth Shop
170	15087051	Mini Market Block C, Vehari	30.04404667	72.35325333	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Mushtaq Ahmad	Cloth Shop
171	15087049	Mini Market Block C, Vehari	30.04416	72.35324667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Munir Ahmad	Cloth Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
172	15087050	Mini Market Block C, Vehari	30.04414167	72.353205	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Wlayt Ali	Cloth Shop
173	15087047	Mini Market Block C, Vehari	30.04411667	72.35312833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Jabbar	Cloth Shop
174	15087048	Mini Market Block C, Vehari	30.04418	72.35320833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Fazal Muhammad	Cloth Shop
175	15087046	Mini Market Block C, Vehari	30.04424167	72.35315	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Amjad Farooq	Cloth Shop
176	15087025	Mini Market Block C, Vehari	30.04408667	72.35305167	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Sadique	cloth shop
177	15087026	Mini Market Block C, Vehari	30.04410667	72.35315	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Ata Muhammad	cloth shop
178	15087044	Mini Market Block C, Vehari	30.04427	72.353145	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Shafi	Cloth Shop
179	15087043	Mini Market Block C, Vehari	30.04428333	72.35326667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Hafiz Ghulam Muhammad	Cloth Shop
180	15087056	Mini Market Block C, Vehari	30.04403333	72.35332167	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Qayyum	Cloth Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
181	15087057	Mini Market Block C, Vehari	30.04403	72.35337	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Haji Muhammad Yaqoob	Cloth Shop
182	15087004	Mini Market Block C, Vehari	30.04405667	72.35334667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Yaseen	Cloth Shop
183	22087007	Block C, Vehari	30.04449833	72.35355667	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rizwan	Cloth Shop
184	22087059	Block C, Vehari	30.04441147	72.35314982	170	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Satar	cloth shop
185	16087020	Block C, Vehari	30.04238	72.35313833	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Satar	Cloth Shop
186	16087027	Block C, Vehari	30.04230667	72.35318333	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Aslam	Cloth Shop
187	16087022	Block C, Vehari	30.042325	72.35310667	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Majeed (MCM)	Cloth Shop
188	16087021	Block C, Vehari	30.0424	72.35299667	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Hameed	Cloth Shop
189	16087023	Block C, Vehari	30.04234667	72.35319667	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Anyat Ullah	Cloth Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
190	16087035	Block C, Vehari	30.042165	72.35298167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shaikh Abdul Jabbar	Cloth Shop
191	16087024	Block C, Vehari	30.04239	72.35294	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Hameed	Cloth Shop
192	15087005	Mini Market Block C, Vehari	30.0443	72.35305	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Bashir Ahmad	Cloth Shop
193	9087003	Godown Old Meat Market	30.04159667	72.353075	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zikar Javed Gulraiz	juice shop
194	7087048	Block C, Vehari	30.04228167	72.35284167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Gulzar	cloth shop
195	22087041	Block C, Vehari	30.04447667	72.35357	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ayoob	cloth shop
196	5087131	Club Road Sharqi Market	30.04523333	72.35489	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yaqoob, Mahmood Ali Yousaf Ali	Cold Drink Shop
197	7087067	Block C, Vehari	30.041955	72.35281167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amin Anwar	Color shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
198	10087002	Near PSO Depot Multan Road Vehari	30.04191833	72.34532167	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ishfaq	Auto Shop
199	13087004	Inner Grain Market Shops	30.04293333	72.349905	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafi	Commission Shop
200	5087165	Club Road Sharqi Market	30.04582333	72.35599667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nadeem Arif	Commission Shop
201	22087055	Block C, Vehari	30.04452978	72.35353187	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashiq	cool line service senter
202	5087127	Club Road Sharqi Market	30.04519	72.35479333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ibrahim 116	Cotton Shop
203	5087051	Club Road Sharqi Market	30.04439667	72.35231833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Dilbar Hussain	Crockery Shop
204	5087050	Club Road Sharqi Market	30.04443333	72.352265	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rafique Ahmad, Muhammad Atique	Crockery Shop
205	5087049	Club Road Sharqi Market	30.04441167	72.35229	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ijaz Ahmad, Bashir Ahmad	Crockery Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
206	22087021	Block C, Vehari	30.04468	72.35337833	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Syed Riaz Ali Shah	Crockery Shop
207	25087001	Near Zoor Vehari	30.03648	72.35210833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ijaz Hussain	Cycle Works
208	21087022	Shaheen Market	30.04621833	72.35728833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Imran	Cycle Works
209	22087035	Block C, Vehari	30.04486833	72.354355	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Tariq	Cycle Works
210	23087024	Stadium Road Vehari	30.04205833	72.34469	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Talib Hussain	Cycle Works
211	23087109	Stadium Road Vehari	30.04178833	72.34520167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rustam Ali	Cycle Works
212	22087043	Block C, Vehari	30.044455	72.35327	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mushtaq Ahmad	Dairy Shop
213	23087096	Stadium Road Vehari	30.041905	72.34486	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ishaq	decoration
214	5087152	Club Road Sharqi Market	30.04544167	72.3555	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ijaz Ahmad Shah	Decoration Shop



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
215	5087132	Club Road Sharqi Market	30.04521167	72.35497667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal	Decoration Shop
216	16087006	Block C, Vehari	30.04224833	72.35299667	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Zia Khalid Khan	Decoration Shop
217	21087074	Shaheen Market	30.04203667	72.35263167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Imran Sarwar	Denting Painting
218	21087072	Shaheen Market	30.04675667	72.35689167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Imran Sarwar	Denting Painting
218	21087088	Shaheen Market	30.046585	72.35652	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Subhani	Denting Painting
219	26087002	Auction Empty Plot (Lorry Adda)	30.04743	72.360375	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafique	Diesel Laboratory
220	23087112	Stadium Road Vehari	30.04197833	72.34518667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	saleem sarwar dogar	dogar motors
221	26087049	Auctioned Empty Plot (Lorry Adda)	30.04814333	72.360865	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nadeem Akbar	Drink Corner
222	6087001	Corner Goal Chowk	30.04205	72.35312667	20	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faiz Muhammad	Drink Corner

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
223	25087002	Near Zoo Vehari	30.03647167	72.35208667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Drink Corner
224	26087013	Auctioned Empty Plot (Lorry Adda)	30.048025	72.36036	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yaqub	Dry Cleaner
225	7087031	Block C, Vehari	30.04182	72.35279333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rehmat Ullah	Dry Cleaner
226	7087030	Block C, Vehari	30.04170167	72.35267833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rehmat Ullah	Dry Cleaner
227	24087012	Taimoor Shaheed Colony	30.03677833	72.33337333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yaseen	Dry Cleaner
228	5087160	Club Road Sharqi Market	30.045515	72.35577667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Allah Ditta	Dry Fruit
229	5087128	Club Road Sharqi Market	30.04534	72.35473667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sarwar urf Kala	Dry Fruit
230	5087133	Club Road Sharqi Market	30.04516833	72.35504	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sadiq, Sohail Arshad	dry fruit Shop
231	5087143	Club Road Sharqi Market	30.04529	72.35529667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Akbar Ali	Egg Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
232	5087137	Club Road Sharqi Market	30.04524667	72.35512333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mehmooda Begum, M. Imran, Zubair Suleman & 6 others	egg shop
233	5087112	Club Road Sharqi Market	30.04497167	72.35434667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Latif 103/C	Egg Shop
234	22087033	Block C, Vehari	30.04507845	72.35423952	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shahid Mehmood	Electric Shop
235	22087002	Block C, Vehari	30.04488315	72.35412384	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem Akhtar s.21	Electric shop
236	22087058	Block C, Vehari	30.04437038	72.35318607	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Munir Ahmad	Electric Shop
237	22087029	Block C, Vehari	30.04495373	72.35409801	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sajjad	Electric shop
238	22087062	Mini Market Block C, Vehari	30.04424511	72.35313366	170	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Ishtaq Rauf	Electric Shop
239	22087027	Block C, Vehari	30.04488167	72.35403333	240	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Yaseen	Electric Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
240	22087032	Block C, Vehari	30.04622833	72.35731167	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ameen	electric store
241	5087162	Club Road Sharqi Market	30.04557667	72.35582	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhamamd Nawaz	Electric Store
242	5087118	Club Road Sharqi Market	30.04502333	72.35445833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Naeem Shehzad, Amir Farooq	Electric Store
243	21087116	Shaheen Market	30.04618667	72.35700333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Naeem 126	Electric Store
244	21087120	Shaheen Market	30.04612833	72.35705167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Aman Ullah	Electric Store
245	15087020	Mini Market Block C, Vehari	30.04422	72.35313833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Rafique	Electric Store
246	21087021	Shaheen Market	30.04614833	72.35704	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nimat Ali	Electric Store
247	21087023	Shaheen Market	30.04631	72.35720833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sardar Muhammad	Electric Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
248	21087032	Shaheen Market	30.046175	72.35739333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Imran	Electric Store
249	21087033	Shaheen Market	30.04618	72.35734667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shah Muhammad	Electric Store
250	21087034	Shaheen Market	30.04648	72.357445	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hamida Bibi	Electric Store
251	21087038	Shaheen Market	30.04649667	72.35734167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tanveer Qaiser. 38	Electric Store
252	21087041	Shaheen Market	30.04633167	72.357355	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Razia Rehana 40	Electric Store
253	22087009	Block C, Vehari	30.044425	72.35351167	170	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Khalid Mehmood	Electric Store
254	22087044	Block C, Vehari	30.04439333	72.35318	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashfaq	Electric Store
255	22087052	Block C, Vehari	30.044215	72.35312333	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shuja Din Bhatti	Electric Store
256	5087107	Club Road Sharqi Market	30.04498833	72.35414167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mubarik Ali	electric store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
257	21087115	Shaheen Market	30.04625833	72.35704833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashfaq 125	Electric Store
258	21087117	Shaheen Market	30.046285	72.35701167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sakeena Bibi 127	Electric Store
259	21087112	Shaheen Market	30.04620667	72.35671167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Naem	Electric Store
260	21087123	Shaheen Market	30.04618167	72.35668333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif	Electric Store
261	21087124	Shaheen Market	30.04605667	72.35663	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif s.134	Electric Store
262	21087118	Shaheen Market	30.04613333	72.35700167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Alam	Electric Store
263	21087099	Shaheen Market	30.04667167	72.35727167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sarwar 99	Electric Store
264	21087095	Shaheen Market	30.04664833	72.357285	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amir Shahzad	Electric Store
265	21087065	Shaheen Market	30.04641833	72.35737833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Munir Ahmad	Electric Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
266	21087100	Shaheen Market	30.04603167	72.35693167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Electric Store
267	21087164	Shaheen Market	30.04569333	72.356365	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nazir Ahmad	Electric Store
268	21087133	Shaheen Market	30.04627333	72.35698833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif	Electric Store
269	21087125	Shaheen Market	30.04632	72.35744	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nadeem	Electric Store
270	21087131	Shaheen Market	30.04634167	72.35732167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem Akhtar	Electric Store
271	21087139	Shaheen Market	30.04645667	72.35728667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashfaq	Electric Store
272	21087109	Shaheen Market	30.04672833	72.35719833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Barkat Ali	Electric Store
273	21087121	Shaheen Market	30.04682167	72.35701667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Bashir, Jalal Din	Electric Store
274	21087122	Shaheen Market	30.04672333	72.35678667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nasim	Electric Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
275	21087138	Shaheen Market	30.04658667	72.35682167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Naseem 148	Electric Store
276	21087152	Shaheen Market	30.04632	72.357045	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tariq Hussain 162	Electric Store
277	4087070	Club Road Garbi	30.042805	72.348	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Liaqat Ali, Hakim Ali, Muhammad Hanif	Electric Store
278	4087100	Club Road Garbi	30.04267167	72.34728	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal	electric store
279	5087161	Club Road Sharqi Market	30.045545	72.35579167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Abdul Ghaffar	Electricity
280	4087090	Club Road Garbi	30.04267667	72.34745333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ayoub 89	Electricity Shop
281	4087104	Club Road Garbi	30.04244333	72.34697	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad 103	Electricity Shop
282	4087015	Club Road Garbi	30.04348833	72.34994833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Azam Hussain	Electricity Shop



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
283	5087017	Club Road Sharqi Market	30.04426667	72.35134333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Majeed	Electronics
284	5087092	Club Road Sharqi Market	30.04483	72.35367167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Muhammad	Electronic
285	5087042	Club Road Sharqi Vehari	30.04429333	72.351965	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram	Electronic
286	5087070	Club Road Sharqi Market	30.04464	72.35284333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Hussain	Electronic Shop
287	5087139	Club Road Sharqi Market	30.04521833	72.355205	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ishfaq 128	Electronic Shop
288	5087125	Club Road Sharqi Market	30.04515167	72.35479833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hashim Khan	Electronic Shop
289	5087117	Club Road Sharqi Market	30.04502333	72.35451667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ali	Electronic Shop
290	5087031	Club Road Vehari	30.044225	72.35175333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mst. Khursheed Begum	Electronic Shop
291	5087060	Club Road Sharqi Market	30.04450833	72.35261167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Azra Ahmad	electronic Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
292	5087122	Club Road Sharqi Market	30.04501833	72.35463667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ali Shair	Electronic Store
293	5087016	Club Road Sharqi Market	30.04422333	72.35127167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tabassum Naseem	Electronics Shop
294	21087045	Shaheen Market	30.04671167	72.35735167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	waheed	Electronics Shop
295	5087156	Club Road Sharqi Market	30.04548333	72.355625	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar, Abdul Razzaq	Electronics Shop
296	5087145	Club Road Sharqi Market	30.0454	72.35533833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Jamal Din	Electronics Shop
297	5087135	Club Road Sharqi Market	30.04525667	72.355255	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ahsaan UI Haq	Electronics Shop
298	5087134	Club Road Sharqi Market	30.045345	72.355315	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Bakhsh	Electronics Shop
299	5087121	Club Road Sharqi Market	30.04507667	72.35453667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Naeem Shehzad, Amir Farooq 110	Electronics Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
300	5087119	Club Road Sharqi Market	30.04498167	72.35445667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zulfiqar Ali, Nasir, Abdul Jabbar	Electronics Shop
301	5087116	Club Road Sharqi Market	30.04510667	72.35434167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faqeer Muhammad 105	Electronics Shop
302	5087087	Club Road Sharqi Market	30.04477667	72.35349833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Maqsood	Electronics Shop
303	5087086	Club Road Sharqi Market	30.04485	72.35332833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hussain	Electronics Shop
304	5087084	Club Road Sharqi Market	30.04474167	72.35337667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sadique, Muhammad Iqbal	Electronics Shop
305	5087083	Club Road Sharqi Market	30.04466333	72.35336667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khursheed Ahmad	Electronics Shop
306	5087079	Club Road Sharqi Market	30.04467833	72.35315833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sohaib Ahmad, Inaam Ul Haq	Electronics Shop
307	5087078	Club Road Sharqi Market	30.04475167	72.35317833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram, Muhammad Afzal	Electronics Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
308	5087075	Club Road Sharqi Market	30.04473667	72.35296833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ch. Muhammad Sadique	Electronics Shop
309	5087076	Club Road Sharqi Market	30.04478333	72.35309	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sadique	Electronics Shop
310	5087077	Club Road Sharqi Market	30.04485	72.35288833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ch. Muhammad Sadique 70	Electronics Shop
311	5087069	Club Road Sharqi Market	30.04463	72.352755	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Abid Sadiq	Electronics Shop
312	5087065	Club Road Sharqi Market	30.04453833	72.35266333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bashir Ahmad	Electronics Shop
313	5087064	Club Road Sharqi Market	30.04462667	72.352655	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ramzan	Electronics Shop
314	5087063	Club Road Sharqi Market	30.04446	72.35274167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Electronics Shop
315	5087068	Club Road Sharqi Market	30.04442167	72.35273833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Niamat Ali	Electronics Shop
316	5087052	Club Road Sharqi Market	30.04447	72.35237333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mushtaq Ahmad	Electronics Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
317	5087046	Club Road Sharqi Vehari	30.04435	72.35216833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Imdad Hussain	Electronics Shop
318	5087038	Club Road Sharqi Vehari	30.04429667	72.351875	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Maqsood Ahmad	Electronics Shop
319	5087037	Club Road Sharqi Vehari	30.044185	72.35186333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Noor Muhammad	Electronics Shop
320	5087035	Club Road Sharqi Market	30.04423	72.35185167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muneer Ahmad	Electronics Shop
321	5087030	Club Road Sharqi Market	30.0442	72.35171167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iftikhar	Electronics Shop
322	5087032	Club Road Sharqi Market	30.04419667	72.35191833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shoaib	Electronics Shop
323	5087029	Club Road Sharqi Market	30.04425333	72.35175	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Chirag, Umer Deen	Electronics Shop
324	21087042	Shaheen Market	30.04665	72.357325	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Amir	Electronics Shop
325	21087043	Shaheen Market	30.04636667	72.35736833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Amir 42	Electronics Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
326	21087044	Shaheen Market	30.046365	72.35730333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	inam up haq	Electronics Shop
327	22087012	Block C, Vehari	30.044625	72.353025	240	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Shafiq	Electronics Shop
328	22087013	Block C, Vehari	30.0446	72.35309	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nawaz	Electronics Shop
329	22087014	Block C, Vehari	30.04461667	72.35312833	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Islam	Electronics Shop
330	22087015	Block C, Vehari	30.04456167	72.35318333	240	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Khalik	Electronics Shop
331	22087017	Block C, Vehari	30.04463	72.35325	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad	Electronics Shop
332	22087016	Block C, Vehari	30.044555	72.353205	240	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Ghulam Rasool	Electronics Shop
333	22087019	Block C, Vehari	30.04464833	72.35334833	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem Akhtar s.9	Electronics Shop
334	22087020	Block C, Vehari	30.04467167	72.353345	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem Akhtar s.10	Electronics Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
335	22087042	Block C, Vehari	30.04447833	72.35333667	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akhtar	Electronics Shop
336	22087057	Block C, Vehari	30.04444346	72.353330069	170	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Qasir Raza	Electronics Shop
337	5087099	Club Road Sharqi Market	30.044785	72.35364833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sidique	Electronics Shop
338	21087146	Shaheen Market	30.04651833	72.35728667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Amir 156	Electronics Shop
339	21087147	Shaheen Market	30.04658667	72.35697667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shazia Amber Sadique	Electronics Shop
340	4087107	Club Road Garbi	30.04247667	72.34675833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif	Electronics Shop
341	5087012	Club Road Sharqi Market	30.04395	72.35104833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Aziz Ur Rahman	Electronics Shop
342	5087033	Club Road Sharqi Market	30.044145	72.35159333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sarfraz	Electronics Shop
343	5087074	Club Road Sharqi Market	30.04468667	72.35302333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Lateef	Electronics Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
344	5087081	Club Road Sharqi Market	30.04469833	72.35323833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saleem 74	Electronics Shop
345	7087022	Mini Market Block C, Vehari	30.04184167	72.353045	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Asghar	empty
346	21087080	Shaheen Market	30.046715	72.35669333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Barkat Ali	empty
347	4087049	Club Road Garbi	30.04312667	72.34863667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Taj	Fast Food
348	4087047	Club Road Garbi	30.04313833	72.34868833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nisar Ahmad s.45	Fast Food
349	4087048	Club Road Garbi	30.04312833	72.34868667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nisar Ahmad s.46	Fast Food
350	19087001	Plot workshop (Lorry Adda)	30.04688167	72.359245	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rana Muhammad Younis	fastfoos shop
351	21087126	Shaheen Market	30.04619167	72.35708167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sarwar, Almas	Filter Shop
352	4087102	Club Road Garbi	30.042515	72.34694	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Sattar 101	Foam Shop



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
353	4087027	Club Road Garbi	30.04343333	72.34948833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Foam Shop
354	4087098	Club Road Garbi	30.04257167	72.34707333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bashir Ahmad	foam shop
355	4087028	Club Road Garbi	30.04336	72.34942667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rahman	Foam Shop
356	5087061	Club Road Sharqi Market	30.044525	72.35263667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mehboob Ahmad	Fodder Shop
357	4087017	Club Road Garbi	30.04353	72.34987833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sardar Muhammad	Fodder Shop
358	22087040	Block C, Vehari	30.04451333	72.35353	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sabar Hussain	food
359	4087019	Club Road Garbi	30.04346333	72.34981	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif Asad	Food point
360	16087033	Block C, Vehari	30.04216333	72.35319167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yaqoob	Fruit Shop
361	23087074	Stadium Road Vehari	30.04224667	72.344205	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mahar Ghulam Sarwar	fuel agency

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
362	4087046	Club Road Garbi	30.0431	72.34884	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nisar Ahmad	Furniture Shop
363	5087146	Club Road Sharqi Market	30.04538	72.35543167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhamamd Ramzan	Furniture Shop
364	21087096	Shaheen Market	30.04662833	72.35726667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mumtaz Hussain , Muhammad Yar	Furniture Shop
365	4087055	Club Road Garbi	30.04306667	72.34846	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nawaz	Furniture Shop
366	4087054	Club Road Garbi	30.043055	72.34846	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad	Furniture Shop
367	4087076	Club Road Garbi	30.04285167	72.34777167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal	Furniture Shop
368	6087004	Corner Goal Chowk	30.04231833	72.35269667	20	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sarfraz Ali	Garments Shop
369	14087002	Jinnah Plaza	30.041335	72.35313833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Umer Niaz	Garments Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
370	5087153	Club Road Sharqi Market	30.04548333	72.35558167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faqeer Hussain	Garments Shop
371	5087142	Club Road Sharqi Market	30.04534	72.355225	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Asghar Ali	Garments Shop
372	24087009	Taimoor Shaheed Colony	30.03665667	72.33355833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Mushtaq	Gas Agency
373	8087002	Godown Diesel Oil	30.046145	72.35663833	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tanveer Alam, Khursheed Alam, M.Zahid, Zaheer Alam	Gas Agency
374	5087093	Club Road Sharqi Market	30.04478333	72.35363333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad 87	gas shop
375	21087061	Shaheen Market	30.046845	72.35714	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hussain	gas welding
376	19087007	Plot Workshop (Lorry Adda)	30.04679667	72.35890333	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Siddique	general store
377	16087002	Block C, Vehari	30.04246833	72.353105	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Shafi (MCM)	General Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
378	5087157	Club Road Sharqi Market	30.045475	72.35569667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Farooq	General Store
379	5087094	Club Road Sharqi Market	30.044885	72.35366833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hafiz Naeem Akhtar	General Store
380	16087004	Block C, Vehari	30.042295	72.35270667	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Shareef	General Store
381	16087001	Block C, Vehari	30.04243	72.35306167	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Arshad (MCM)	General Store
382	16087007	Block C, Vehari	30.04229667	72.35299167	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Zia Khalid Khan s.5	General Store
383	4087113	Club Road Garbi	30.04236667	72.34666167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khadim Hussain	Glass Shop
384	21087059	Shaheen Market	30.04701667	72.35717833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tanveer Ahmad	Glass Shop
385	21087058	Shaheen Market	30.04701333	72.35718333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sarfraz Hussain	Glass Shop
386	8087008	Near Shaheen Market	30.04675167	72.35633667	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sibt Hussain Shah	Glass Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
387	21087049	Shaheen Market	30.04673833	72.357275	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ahmad Din	Glass Shop
388	21087102	Shaheen Market	30.04644	72.35694667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafi 112	Glass Shop
389	7087041	Block C, Vehari	30.04207	72.35254167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdullah	Glasses shop
390	4087013	Club Road Garbi	30.04349833	72.35000333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Jamshaid Ali	Godaam
391	23087042	Stadium Road Vehari	30.04235833	72.344285	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	sarfaraz ahmad	golden autos
392	4087103	Club Road Garbi	30.04249	72.34698333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam, Muhammad Asghar	Hair Cut Shop
393	23087034	Stadium Road Vehari	30.04220833	72.34446167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mukhtar Ahmad	hair dresser
394	26087023	Auctioned Empty Plot (Lorry Adda)	30.04816333	72.360805	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saeed	Hakeem Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
395	21087111	Shaheen Market	30.046375	72.356895	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sheikh Zahoor Ilahi	Hakeem Shop
396	23087027	Stadium Road Vehari	30.04208333	72.34461333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zulfiqar Ali	Hakeem Shop
397	4087051	Club Road Garbi	30.043115	72.34857833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Munir	Hakeem Shop
398	23087026	Stadium Road Vehari	30.04210333	72.34462333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafi	hakeem shop
399	5087014	Club Road Sharqi Market	30.043945	72.35111333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rafiq	Hakeem Shop
400	7087069	Block C, Vehari	30.04205833	72.35285833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hakeem nazir ahmad	Hakeem Shop
401	5087108	Club Road Sharqi Market	30.04501167	72.354245	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Kubra Urf Natho	Hardware
402	5087151	Club Road Sharqi Market	30.04542833	72.35549667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nawab Din	Hardware Shop
403	5087123	Club Road Sharqi Market	30.04511167	72.354715	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam 112	Hardware Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
404	5087059	Club Road Sharqi Market	30.04449833	72.35261	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Razaq, Muhammad Ishaq	Hardware Shop
405	4087036	Club Road Garbi	30.04320333	72.34910667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Munir	Hardware Shop
406	4087050	Club Road Garbi	30.04314	72.34863333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faqeer Muhammad	Hardware Shop
407	4087041	Club Road Garbi	30.04322833	72.34890833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Chishti, Muhammad Hamid Khan	Hardware Shop
408	5087013	Club Road Sharqi Market	30.04395667	72.35102333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Latif	Hardware Shop
409	22087024	Block C, Vehari	30.04483667	72.35399	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammd Raza	Hardware Shop Shop
410	4087078	Club Road Garbi	30.04285667	72.34777	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shoukat Ali, Abdul Rasheed	Home
411	14087006	Jinnah Plaza	30.04145333	72.35313667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Imtiaz Hashmat	Homeopat hic Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
412	19087004	Plot Workshop (Lorry Adda)	30.0469	72.35905333	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Syed Jamil Hussain Shah	hotel
413	19087020	Plot Workshop (Lorry Adda)	30.04685333	72.359325	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faqeer, Muhammad Khalid	hotel
414	26087008	Auctioned Empty Plot (Lorry Adda)	30.04791167	72.359865	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafi	Hotel
415	26087007	Auctioned Empty Plot (Lorry Adda)	30.04797167	72.3601	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Aziz	Hotel
416	26087014	Auctioned Empty Plot (Lorry Adda)	30.04809167	72.36035833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Siddique	Hotel
417	26087016	Auctioned Empty Plot (Lorry Adda)	30.04807833	72.36046667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Muhammad Sarwar	Hotel
418	2087005	Built Plot (Lorry Adda)	30.04814833	72.36078667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Hotel
419	26087017	Auctioned Empty Plot (Lorry Adda)	30.04806667	72.360565	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Imdad, Gulzar & Faryad	Hotel
420	26087019	Auctioned Empty Plot (Lorry Adda)	30.04814833	72.36080167	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hakeem Muhammad Saeed	Hotel



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
421	2087006	Built Plot (Lorry Adda)	30.04816833	72.36083667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tahir Bashir	Hotel
422	2087001	Built Plot (Lorry Adda)	30.04819833	72.36108167	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zahid Ramzan	Hotel
423	4087060	Club Road Garbi	30.04279667	72.34818	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Dilbar Hussain 58	Hotel
424	20087001	PSO Depot Shops	30.04493667	72.346425	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Riaz Ahmad	Hotel
425	20087002	PSO Depot Shops	30.04493	72.346445	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Imran Riaz	Hotel
426	21087016	Shaheen Market	30.04607333	72.356935	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nafees Ahmad	Hotel
427	15087007	Mini Market Block C, Vehari	30.04446333	72.353305	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Ghafar	Hotel
428	15087008	Mini Market Block C, Vehari	30.044485	72.35332	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Ghafar 8	Hotel
429	22087049	Block C, Vehari	30.04421667	72.35299	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Murtaza	Hotel

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
430	16087025	Block C, Vehari	30.042245	72.352775	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Aslam	Hotel
431	4087062	Club Road Vehari	30.0429983	72.34821833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Boota	Hotel
432	4087061	Club Road Garbi	30.0429983	72.348255	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bashir Ahmad, Jan Muhammad	Hotel
433	26087045	Auctioned Empty Plot (Lorry Adda)	30.0472866	72.36064	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif	Hotel
434	26087026	Auctioned Empty Plot (Lorry Adda)	30.0473183	72.36071	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rao Muhammad Jamil	Hotel
435	26087029	Auctioned Empty Plot (Lorry Adda)	30.047345	72.36065333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Altaf Ahmad	Hotel
436	7087042	Block C, Vehari	30.0421266	72.35260167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	imran aslam	imran aslam plastic shop
437	4087069	Club Road Garbi	30.04293	72.34812167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yousif 67	Iron Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
438	4087005	Club Road Garbi	30.04365	72.35026833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Javed iqbal, Muhammad Khalid s.4	jewellery shop
439	4087127	Club Road Garbi	30.04364	72.350225	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Latif	jewellery shop
440	5087072	Club Road Sharqi Market	30.04459167	72.352925	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Majeed	jewelry Shop
441	22087063	Block C, Vehari	30.04426438	72.35310743	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Bota	jewelry Shop
442	22087064	Block C, Vehari	30.04428999	72.35309734	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amjad Javed	jewelry Shop
443	15087017	Mini Market Block C, Vehari	30.04418667	72.35319833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Sharif	Jewellers Shop
444	7087032	Block C, Vehari	30.04172833	72.35267333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Jewellers Shop
445	5087071	Club Road Sharqi Market	30.04452	72.352885	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Zafar Iqbal	Jewellers Shop
446	5087044	Club Road Sharqi Vehari	30.04432833	72.35209667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Javed Iqbal, Muhammad Khalid,	Jewellers Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
													Muhammad Abid	
447	15087012	Mini Market Block C, Vehari	30.044065	72.35315833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Ibraheem	Jewllers Shop
448	15087014	Mini Market Block C, Vehari	30.04411833	72.35316333	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Hussain	Jewllers Shop
449	15087013	Mini Market Block C, Vehari	30.04412167	72.35319333	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Ali Jan	Jewllers Shop
450	15087016	Mini Market Block C, Vehari	30.04411833	72.35312833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Siraj Deen	Jewllers Shop
451	15087018	Mini Market Block C, Vehari	30.04416	72.35312833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Fazal Muhammad	Jewllers Shop
452	15087021	Mini Market Block C, Vehari	30.04423667	72.35310667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Shafi	Jewllers Shop
453	15087033	Mini Market Block C, Vehari	30.04418333	72.353105	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Javed Iqbal	Jewllers Shop
454	15087032	Mini Market Block C, Vehari	30.044185	72.352925	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Saeed Ahmad	Jewllers Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
455	15087034	Mini Market Block C, Vehari	30.04419667	72.35283667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Arshad	Jewllers Shop
456	15087035	Mini Market Block C, Vehari	30.04417	72.35302667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Rasheed Ahmad	Jewllers Shop
457	16087019	Block C, Vehari	30.04238667	72.35289167	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Shafi	Jewllers Shop
458	4087002	Club Road Garbi	30.04371667	72.35035333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Habib Ahmad	Jewllers Shop
459	4087003	Club Road Garbi	30.04370833	72.35035333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nadeem Aslam	Jewllers Shop
460	4087006	Club Road Garbi	30.04367333	72.35024833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Javed iqbal, Muhammad Khalid s.4A	Jewllers Shop
461	4087007	Club Road Garbi	30.04366333	72.350395	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zulfiqar Ali, Mumtaz Ali	Jewllers Shop
462	4087012	Club Road Garbi	30.04358333	72.35004333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Rasool	Jewllers Shop
463	15087019	Mini Market Block C, Vehari	30.0442	72.35316167	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Dur Muhammad	Jewllers Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
464	5087011	Club Road Sharqi Market	30.04432833	72.35224833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Fehmida Begum, Abid javed, Wajid Ali, Rashid, Sajida	Jewllers Shop
465	5087019	Club Road Sharqi Market	30.04402167	72.35129167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Imtiaz Ali	Jewllers Shop
466	4087004	Club Road Garbi	30.04368	72.35041667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Jewllers Shop
467	5087105	Club Road Sharqi Market	30.044955	72.35404833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ishfaq	Juice Corner
468	23087012	Stadium Road	30.04202	72.34508333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Akram Ul Haq	Juice Corner
469	6087008	Corner Goal Chock	30.04155333	72.35311	20	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Umer Din	Juice Corner
470	26087003	Auction Empty Plot (Lorry Adda)	30.04746667	72.36036667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Asghar Ali	Kahrad
471	26087010	Auctioned Empty Plot (Lorry Adda)	30.04798833	72.36041	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mukhtar Ahmad, Zulfiqar Ali, M. Aslam, S	kamani shop buss

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
													amina & 2other	
472	21087105	Shaheen Market	30.04100667	72.35005833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Jabbar 115	karyana
473	16087026	Block C, Vehari	30.042315	72.352895	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Satar	karyana
474	5087129	Club Road Sharqi Market	30.04528833	72.35485	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ismail	karyana Shop
475	15087002	Mini Market Block C, Vehari	30.04379667	72.35299833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Aslam	Karyana Shop
476	5087085	Club Road Sharqi Market	30.04279167	72.34755833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ishtiaq Ahmad	karyana Shop
477	19087006	Plot Workshop (Lorry Adda)	30.04684667	72.35897333	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal	karyana store
478	7087039	Block C, Vehari	30.041915	72.35246667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Waseem Anjum	Karyana Store
479	7087040	Block C, Vehari	30.04192833	72.35245667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nasir Ali & Qasir Ali	Karyana Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
480	7087044	Block C, Vehari	30.04210333	72.35254167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rasheed	Karyana Store
481	24087001	Taimoor Shaheed Colony	30.0368	72.33335	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khalid Mehmood	Karyana Store
482	15087003	Mini Market Block C, Vehari	30.0439	72.35305667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Ibrahim	Karyana Store
483	5087147	Club Road Sharqi Market	30.04535167	72.35540833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Waheed khan	Karyana Store
484	5087136	Club Road Sharqi Market	30.04532333	72.35513333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sardar Muhammad	Karyana Store
485	5087054	Club Road Sharqi Market	30.04422833	72.352325	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rehmat Ali	Karyana Store
486	21087004	Shaheen Market	30.04584167	72.35629833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	majeed	Karyana Store
487	21087006	Shaheen Market	30.04598667	72.35646	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Liaqat Ali Zaidi	Karyana Store
488	21087007	Shaheen market	30.04580333	72.356575	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Farzand Ali, M. Shari	Karyana Store



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
489	21087010	Shaheen Market	30.04597	72.35657667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sarwar	Karyana Store
490	21087012	Shaheen Market	30.04581833	72.35664	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Umer Farooq Najam	Karyana Store
491	21087013	Shaheen Market	30.04594833	72.35677	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashraf 13	Karyana Store
492	21087014	Shaheen Market	30.04601167	72.35672833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sadaq	Karyana Store
493	21087161	Shaheen Market	30.04601667	72.35665	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amir Shahzad 177	Karyana Store
494	22087031	Block C, Vehari	30.04498309	72.35420882	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Faheem	Karyana Store
495	21087168	Shaheen Market	30.04604667	72.356705	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Aftab Ahmad	Karyana Store
496	4087018	Club Road Garbi	30.04356833	72.34983667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Taswar Ali	Karyana Store
497	4087021	Club Road Garbi	30.04348333	72.34984333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Fateh Muhammad	Karyana Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
498	19087005	Plot Workshop (Lorry Adda)	30.04747167	72.36051	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad khursheed	Karyana Store
499	5087057	Club Road Sharqi Market	30.04445667	72.35257667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ilyas	Karyana Store
500	7087071	Block C, Vehari	30.04195833	72.35276	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Hameed, M.S harif	Karyana Store
501	7087072	Block C, Vehari	30.04195333	72.35276	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghafoor	Karyana Store
502	5087155	Club Road Sharqi Market	30.045485	72.355595	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Naseem Kausar	Khaad Shop
503	5087138	Club Road Sharqi Market	30.04538	72.35510833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mehmoda Begum, M. Imran, Zubair Suleman&6ot her127	Khaad Shop
504	5087005	Club Road Sharqi Market	30.04387167	72.350765	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdus Salam	Kharadia
505	5087006	Club Road Sharqi Market	30.04356167	72.35008167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shoukat Ali	Kharadia

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
506	24087006	Taimoor Shaheed Colony	30.03679167	72.33347	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yonas Shakir	Kharadia
507	5087164	Club Road Sharqi Market	30.045605	72.35589667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bashir Ahmad, Javid Akbar Bashir,	Kharadia
508	21087020	Shaheen Market	30.045965	72.35704833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Arshad Ahmad	Kharadia
509	21087070	Shaheen Market	30.04676667	72.35693333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sarver	Kharadia
510	21087127	Shaheen Market	30.04610667	72.35704333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Hameed	Kharadia
511	21087142	Shaheen Market	30.04636833	72.35694167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Taseen	Kharadia
512	21087153	Shaheen Market	30.04662333	72.35689833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif 163	Kharadia
513	21087135	Shaheen Market	30.046385	72.35736	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Imran	kharadia
514	21087054	Shaheen Market	30.04669333	72.35729667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ikram ul Haq	Kharadia

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
515	21087151	Shaheen Market	30.04652833	72.35699	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tariq Hussain 161	Kharadia
516	23087061	Stadium Road Vehari	30.04244167	72.344045	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Almas	Kharadia
517	23087023	Stadium Road Vehari	30.042055	72.34467833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Lal Deen	Kharadia
518	4087071	Club Road Garbi	30.04288333	72.347945	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ramzan	Kharadia
519	21087050	Shaheen Market	30.04685167	72.35721	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Arshad	kharadiaa
520	21087051	Shaheen Market	30.04677	72.35728333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Arshad 51	khradia
521	21087136	Shaheen Market	30.046285	72.35748	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Suliman	khradia
522	23087077	Stadium Road Vehari	30.042095	72.34445833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ch khursheed	khursheed motors
523	22087006	Block C, Vehari	30.04432667	72.35425	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Kashif	landa shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
524	4087093	Club Road Garbi	30.042595	72.3472	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rasheed	Leather Shop
525	4087067	Club Road Garbi	30.04292667	72.34812667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sadique 65	Leather Shop
526	24087003	Taimoor Shaheed Colony	30.03678167	72.333445	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saif-ur-Rehman, Muhammad Ismail	lpg gass
527	23087076	Stadium Road Vehari	30.04208833	72.34444	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Babar hussain	M Amir autos
528	5087058	Club Road Sharqi Market	30.04440833	72.352475	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Dilawar Hussain Shah	Machine cloth
529	21087119	Shaheen Market	30.046155	72.35673333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saddiq	mati oil shop
530	14087012	Jinnah Plaza	30.041615	72.352935	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Kashif Munawwar	Meat Shop
531	14087011	Jinnah Plaza	30.04168833	72.35296333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shabbir Ahmad	Meat Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
532	14087013	Jinnah Plaza	30.04162167	72.35303	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Naeem Khalid	Meat Shop
533	4087066	Club Road Garbi	30.042815	72.34813	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Kareem	Meat Shop
534	6087006	Corner Goal Chock	30.04177	72.35318833	20	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sardar Ali	Meat Shop
535	23087041	Stadium Road Vehari	30.042295	72.34433	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Zahid	mechanic
536	24087004	Taimoor Shaheed Colony	30.036825	72.333375	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saleem	medical store
537	4087052	Club Road Garbi	30.043105	72.34855333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Â Shoukat,Ra sheed Ahmad, Muhammad Hanif, Liaqat Ali	medical store
538	5087027	Club Road Sharqi Market	30.044105	72.35148333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal	Milk Shop
539	4087075	Club Road Garbi	30.04284167	72.34780833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Munawar Hussain	Mirror Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
540	4087092	Club Road Garbi	30.04260833	72.34724167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Maqbool	mobiel shop
541	26087009	Auctioned Empty Plot (Lorry Adda)	30.04801833	72.36015	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram Plot N8 .	Mobile Shop
542	7087019	Block C, Vehari	30.04192167	72.35303	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Jameel Ahmad	Mobile Shop
543	7087045	Block C, Vehari	30.04207167	72.35250167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rehan Kaleem	Mobile Shop
544	7087046	Block C, Vehari	30.042155	72.35259667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Satar	Mobile Shop
545	14087010	Jinnah Plaza	30.04149	72.35289833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khalid Sultan	Mobile Shop
546	5087021	Club Road Sharqi Market	30.04399333	72.35130167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal	Mobile Shop
547	24087010	Taimoor Shaheed Colony	30.03677167	72.33365	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Javed Iqbal	Mobile Shop
548	24087002	Taimoor Shaheed Colony	30.03681	72.33333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tanveer Ahmad	Mobile Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
549	5087067	Club Road Sharqi Market	30.044585	72.35277333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Raoof	Mobile Shop
550	5087043	Club Road Sharqi Vehari	30.04425667	72.35212167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal	Mobile Shop
551	22087022	Block C, Vehari	30.04471667	72.35344	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shahid Ahmad	Mobile Shop
552	22087025	Block C, Vehari	30.04490167	72.35395667	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Jamshad Hussain	Mobile Shop
553	4087110	Club Road Garbi	30.042485	72.34668833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hameed Ali 109	Motor Bike Spare Parts
554	19087021	Plot Workshop (Lorry Adda)	30.047455	72.359115	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal s.13	Motor Cycle Showroom
555	23087080	Stadium Road Vehari	30.04197833	72.344505	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem Arshad	Motor Cycle Showroom
556	23087082	Stadium Road Vehari	30.04198167	72.34464167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Azam Khan	Motor Cycle Showroom
557	23087086	Stadium Road Vehari	30.04191833	72.34465667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Abdul Sattar-90	Motor Cycle Showroom



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
558	23087087	Stadium Road Vehari	30.04189833	72.344655	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Basheer Ahmad	Motor Cycle Showroom
559	23087090	Stadium Road Vehari	30.04200333	72.34471667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad	Motor Cycle Showroom
560	23087103	Stadium Road Vehari	30.041845	72.34501833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghafoor	Motor Cycle Showroom
561	23087107	Stadium Road Vehari	30.04189667	72.34513333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Khalid	Motor Cycle Showroom
562	23087013	Stadium Road	30.042015	72.34504833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Younis, Muhammad Yousaf	Motor Cycle Showroom
563	23087018	Stadium Road	30.04201333	72.34485833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Latif	Motor Cycle Showroom
564	23087068	Stadium Road Vehari	30.04230167	72.34415833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Hameed,Ghulam Rasool	Motor Cycle Showroom
565	23087029	Stadium Road Vehari	30.04209	72.34459167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Khalid -33	Motor Cycle Showroom

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
566	23087030	Stadium Road Vehari	30.04216	72.344515	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Khalid-34	Motor Cycle Showroom
567	23087031	Stadium Road Vehari	30.042185	72.344535	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Wali Muhammad	Motor Cycle Showroom
568	23087037	Stadium Road Vehari	30.04225833	72.34443333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram	Motor Cycle Showroom
569	23087043	Stadium Road	30.04233333	72.34431833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Rasool	Motor Cycle Showroom
570	23087044	Stadium Road Vehari	30.04236	72.34439	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Rasool-48	Motor Cycle Showroom
571	23087045	Stadium Road Vehari	30.04234333	72.34426333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Farooq, Muhammad Asif	Motor Cycle Showroom
572	23087046	Stadium Road Vehari	30.04238833	72.34424833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amjad Ali	Motor Cycle Showroom
573	23087069	Stadium Road Vehari	30.04233333	72.34416167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Munawar, Tasawar, Anwar	Motor Cycle Showroom

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
574	23087010	Stadium Road	30.042025	72.34532167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Motor Cycle Showroom
575	23087011	Stadium Road	30.04201833	72.34524333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sadiq	Motor Cycle Showroom
576	23087089	Stadium Road Vehari	30.04260333	72.347205	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem Anjum-93	Motor Cycle Showroom
577	4087115	Club Road Garbi	30.04243833	72.34655167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Abbas	Motor Cycle Showroom
578	4087109	Club Road Garbi	30.042415	72.34674667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Amin, Muhammad Jameel	Motor Cycle Showroom
579	23087099	Stadium Road Vehari	30.04191667	72.34498333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hashmat Ali	Motor Cycle Showroom
580	23087100	Stadium Road Vehari	30.04195667	72.34500667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Arshad	Motor Cycle Showroom
581	23087105	Stadium Road Vehari	30.04188	72.345095	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mst. Nadra Begum	Motor Cycle Showroom

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
582	23087106	Stadium Road Vehari	30.04191833	72.345115	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sajid Rafique	Motor Cycle Showroom
583	23087047	Stadium Road Vehari	30.04196667	72.34461833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amjad Ali -51	Motor Cycle Showroom
584	23087048	Stadium Road Vehari	30.04197333	72.34461833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rasheed	Motor Cycle Showroom
585	23087097	Stadium Road Vehari	30.041905	72.34493	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ahmad Shakeel	Motor Cycle Showroom
586	23087115	Stadium Road Vehari	30.04161167	72.353115	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal	Motor Cycle Showroom
587	23087114	Stadium Road Vehari	30.04157167	72.35326667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Imran Khan	Motor Cycle Showroom
588	23087113	Stadium Road Vehari	30.041655	72.35317333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Abdullah, Esmatullah, Asadullah	Motor Cycle Showroom
589	23087110	Stadium Road Vehari	30.041605	72.35307833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanfi	Motor Cycle Showroom

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
590	23087062	Stadium Road Vehari	30.04244333	72.34407167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Sattar	motor shop
591	23087036	Stadium Road Vehari	30.04222	72.3444	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Hussain	motorcycle
592	21087019	Shaheen Market	30.045925	72.35704	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saeed Ahmad, Abdul Hameed, Abdul Hafiz	motorcycle shop
593	23087073	Stadium Road Vehari	30.042245	72.34418833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Motorcycle shop
594	22087008	Block C, Vehari	30.044455	72.353485	170	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Ali	Movie Maker
595	19087002	Plot Workshop (Lorry Adda)	30.04677667	72.35915	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nazar Hussain, Asif Mujtaba, Muhammad Arslan	Nazar Clinic
596	24087007	Taimoor Shaheed Colony	30.03675	72.33353833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mukhtar Ahmad	non shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
597	20087004	PSO Depot Shops	30.044685	72.34643333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Kashif Qayum	Office
598	20087006	PSO Depot Shops	30.04465833	72.346475	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal	Office
599	21087098	Shaheen Market	30.04648333	72.35654	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Munir	Office
600	21087101	Shaheen Market	30.04652667	72.35656333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	munir carige	office
601	21087097	Shaheen Market	30.04653833	72.35657167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yousaf 97	Office
602	21087114	Shaheen Market	30.046695	72.35718167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghani 124	Office
603	26087025	Auctioned Empty Plot (Lorry Adda)	30.04741833	72.36096833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zafar Alam	Office
604	26087048	Auctioned Empty Plot (Lorry Adda)	30.047305	72.36063333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Waheed Ahmad	Office
605	21087090	Shaheen Market	30.04655	72.35653833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Tahir Mehmood	Oil Agency

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
606	8087004	Godown Diesel Oil	30.04640333	72.35648	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sattar, Iftikhar, Iqbal, Zubair,Umar	Oil Agency
607	8087005	Godown Diesel Oil	30.04646167	72.3565	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Munir	Oil Agency
608	8087006	Godown Diesel Oil	30.04662	72.356455	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Abdul Majeed	Oil Agency
609	5087041	Club Road Sharqi Vehari	30.044265	72.35204667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Dilawar Hussain Shah	Optic Shop
610	16087014	Block C, Vehari	30.042445	72.35296	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Ilyas	Over Lock
611	16087017	Block C, Vehari	30.04244167	72.35307167	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Yaqoob	Over Lock
612	16087018	Block C, Vehari	30.04238	72.35315167	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Zafar Alam Hiyat	Over Lock
613	16087013	Block C, Vehari	30.042395	72.35296	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Saif Ullah	Over Lock
614	6087002	Corner Goal Chowk	30.04227667	72.35310667	20	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ibraheem	Over Lock Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
615	5087109	Club Road Sharqi Market	30.04501833	72.35424667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Mukhtar Ahmad	paan shop
616	7087077	Block C, Vehari	30.04206833	72.35287333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ameen Anwar, Saleem Anwar	Paint Shop
617	7087050	Block C, Vehari	30.042025	72.35287833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Khalid Athar	Paint Shop
618	7087076	Block C, Vehari	30.04205667	72.353	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem Anwar	Paint Shop
619	5087150	Club Road Sharqi Market	30.045325	72.35555167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nawab Din	Paint Shop
620	4087029	Club Road Garbi	30.04341	72.34936	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Fiaz Khan	Paint Shop
621	4087031	Club Road Garbi	30.04336167	72.34930167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Jabbar	Paint Shop
622	4087058	Club Road Garbi	30.04304833	72.34832667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Qasir Bhatti	Paint Shop
623	4087064	Club Road Garbi	30.04292667	72.34819333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saddique	paint Shop



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
624	4087045	Club Road Garbi	30.04314333	72.34874833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shoukat Ali	Paint Shop
625	7087078	Block C, Vehari	30.04206833	72.35278	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ameen Anwar, Saleem Anwar	Paint Shop
626	7087079	Goal Chowk Vehari	30.04206667	72.35259333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shahid Ahmad, Saghira Ahmad, Muhammad Amir	Pan Shop
627	21087067	Shaheen Market	30.046805	72.35695333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sajid, Abid Hussain,	panafpex printing
628	21087017	Shaheen Market	30.04607833	72.3569	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif	PCO
629	4087074	Club Road Garbi	30.04284833	72.34788667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Fateh Muhammad	pencher shop
630	5087088	Club Road Sharqi Market	30.04472667	72.35354833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad	Perfoum Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
631	22087030	Block C, Vehari	30.04497667	72.35410667	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shaikh Muhammd Tahir	Perfourm Shop
632	13087007	Inner Grain Market Shops	30.04184833	72.35113833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Akbar Ali, Hussain Ahmad	Pesticides Shop
633	13087001	Inner Grain Market Shops	30.04166167	72.35053	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mehmood Ahmad	Pesticides Shop
634	13087006	Inner Grain Market Shops	30.04318	72.35059667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Qadeer Ahmad	Pesticides Shop
635	5087073	Club Road Sharqi Market	30.04472	72.35290167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhamamad Iqbal	Pesticides Shop
636	21087015	Shaheen Market	30.04602833	72.356755	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bashir Ahmad	Pesticides Shop
637	19087008	Plot Workshop (Lorry Adda)	30.046725	72.35891	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Akbar Ali	pestisiod shop
638	7087017	Block C, Vehari	30.04189333	72.35306333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Imran	Pharmacy
639	7087018	Block C, Vehari	30.041935	72.35306667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sardar Muhammad	Pharmacy

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
640	7087023	Block C, Vehari	30.041855	72.35300667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Pharmacy
641	7087024	Block C, Vehari	30.041825	72.35322667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Pharmacy
642	7087033	Block C, Vehari	30.04173833	72.35264167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rana Rashid Ali	Pharmacy
643	14087009	Jinnah Plaza	30.04143	72.35305167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Iftikhar Ahmad	Pharmacy
644	14087008	Jinnah Plaza	30.04156333	72.35297167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rehan Sheikh	Pharmacy
645	5087026	Club Road Sharqi Market	30.04412	72.35150833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdus Satar	Pharmacy
646	5087024	Club Road Sharqi Market	30.04410833	72.351405	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdullah Rashid	Pharmacy
647	5087023	Club Road Sharqi Market	30.04409	72.35137667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Shakoor	Pharmacy
648	5087020	Club Road Sharqi Market	30.04404333	72.35122667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ajmal Tariq	Pharmacy

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
649	5087009	Club Road Sharqi Market	30.04383167	72.35095667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif Asad 09	Pharmacy
650	5087010	Club Road Sharqi Market	30.04391333	72.35089167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Asim Hanif	Pharmacy
651	5087001	Club Road Sharqi Market	30.04387333	72.35068333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif Asad	Pharmacy
652	23087078	Stadium Road Vehari	30.04198833	72.34447167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nadeem Arshad	Pharmacy
653	5087148	Club Road Sharqi Market	30.04533833	72.35542833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Pharmacy
654	5087045	Club Road Sharqi Vehari	30.04422833	72.352185	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sardar Sabir	Pharmacy
655	5087034	Club Road Sharqi Market	30.04427167	72.351755	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amir Sadique	Pharmacy
656	21087025	Shaheen Market	30.04618167	72.35738	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rafique	Pharmacy
657	5087025	Club Road Sharqi Market	30.04399167	72.35136667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Mehboob	Pharmacy

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
658	5087028	Club Road Vehari	30.04403167	72.35156667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khushi Muhammad	Pharmacy
659	23087032	Stadium Road Vehari	30.042145	72.34448667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Fateh Muhammad	pharmacy
660	23087033	Stadium Road Vehari	30.04217333	72.3445	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Fateh Muhammad- 37	pharmacy
661	4087056	Club Road Garbi	30.04303833	72.34843167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Chiragh Din	Pharmacy
662	26087044	Auctioned Empty Plot (Lorry Adda)	30.04716833	72.36013667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bushra Zeenat	Pharmacy
663	26087046	Auctioned Empty Plot (Lorry Adda)	30.04704333	72.360175	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Khaliq	Pharmacy
664	5087018	Club Road Sharqi Market	30.04399833	72.35124167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nawaz	Pharmacy
665	19087010	Plot Workshop (Lorry Adda)	30.04664833	72.35881	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Samiullah	pharmacy
666	5087149	Club Road Sharqi Market	30.045425	72.355395	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ishfaq 138	pharmacy

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
667	26087043	Auctioned Empty Plot (Lorry Adda)	30.047045	72.35997167	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mian Muhammad Jamil	Pharmacy
668	7087025	Block C, Vehari	30.04183167	72.35294833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Pharmacy
669	6087007	Corner Goal Chock	30.04173167	72.35295167	20	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Liaqat Ali	Photo Copy
670	14087005	Jinnah Plaza	30.041515	72.35298	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ahmad Anjum	Photo Copy
671	13087005	Inner Grain Market Shops	30.04164833	72.35053833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hamayat Ali	Photo Copy
672	23087119	Stadium Road Vehari	30.04195167	72.34510333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Aziz	Photo Copy
673	23087035	Stadium Road Vehari	30.04219	72.34441833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghafoor	photocopy
674	19087009	Plot Workshop (Lorry Adda)	30.04677333	72.35869833	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Riaz Ahmad, Saeed Akhtar Malik	pizza shop
675	7087057	Block C, Vehari	30.04187	72.35280167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Munir	Plastic Shoper

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
676	7087043	Block C, Vehari	30.04200667	72.352575	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Kareem	Plastic Store
677	7087055	Block C, Vehari	30.04197333	72.352945	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghani	Plastic Store
678	21087003	Shaheen Market	30.04593	72.356415	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhamamd Ramzan	Plastic Store
679	7087016	Block C, Vehari	30.041995	72.35312667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sajid	Plastic Store
680	4087120	Club Road Garbi	30.04233167	72.3464	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nadir Ali	Poshesh Maker
681	23087098	Stadium Road Vehari	30.04194167	72.344945	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zia Taranum	Poshish Maker
682	4087121	Club Road Garbi	30.04230833	72.34639167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram	Poshish Maker
683	4087106	Club Road Garbi	30.04248833	72.34679167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashiq	Poshish Maker
684	4087101	Club Road Garbi	30.04242	72.34707333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Sattar	Poshish Maker

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
685	21087009	Shaheen Market	30.04592	72.35662333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rasheed Arshad	Printing Press
686	22087036	Block C, Vehari	30.04478456	72.35431532	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Gahfoor	Printing Press
687	22087065	Block C, Vehari	30.04448	72.35348833	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saeed Ahmad	Printing Press
688	21087077	Shaheen Market	30.04664333	72.35674833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Allah Dita	Printing Press
689	21087068	Shaheen Market	30.046505	72.35730167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Dilhahad Ahmad	Printing Press
690	21087047	Shaheen Market	30.046665	72.35728	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yousaf	Printing Press
691	21087048	Shaheen Market	30.04662333	72.357215	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Arif	Printing Press
692	22087067	Block C, Vehari	30.04439167	72.35332	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Jabbar	Refrigrator Repair
693	21087066	Shaheen Market	30.04643333	72.35734833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Jabbar	Refrigrator Repair



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
694	8087007	Near Shaheen Market	30.04654833	72.35641667	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sagheer	Residence
695	12087002	Godam Sabzi Mandi	30.04150333	72.353215	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sabir Hussain	Residence
696	12087003	Godam Sabzi Mandi	30.04163333	72.35314833	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tariq Mehmood	Residence
697	12087004	Godam Sabzi Mandi	30.04165667	72.35303167	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Islam, Muhammad Saleem	Residence
698	12087005	Godown Sabzi Mandi	30.04166	72.35308	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Kamil Iqbal	Residence
699	12087007	Godown Sabzi Mandi	30.041675	72.35309667	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Liaquat Hussain	Residence
700	12087006	Godown Sabzi Mandi	30.04159667	72.35299333	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hameedan Jabeen	Residence
701	12087008	Godown Sabzi Mandi	30.04159667	72.35299333	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Sabir, Muhammad Bashir	Residence

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
702	12087009	Godown Sabzi Mandi	30.04165	72.35307167	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Syed Iqbal, Muhammad Din	Residence
703	12087010	Godown Sabzi Mandi	30.04145667	72.352995	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ibraheem Butt	Residence
704	7087028	Block C, Vehari	30.04175167	72.35281833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Naseeb	Sabzi shop
705	4087053	Club Road Garbi	30.04311167	72.34847	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif Asad 51	Saintary Shop
706	4087123	Club Road Garbi	30.042175	72.34643667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shahid Nadeem	Saintary Shop
707	22087053	Block C, Vehari	30.04451903	72.35358937	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ramzan	Salone
708	7087038	Block C, Vehari	30.04186667	72.35248667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Majeed	Samosa Shop
709	6087005	Corner Goal Chowk	30.041745	72.35316	20	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yasin	Samosa Shop
710	4087011	Club Road Garbi	30.04355	72.35012833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faqir Muhammad s.8	sanitary sho

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
711	5087004	Club Road Sharqi Market	30.04381333	72.35079833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mehmood Ul Hassan, Muhammad Shabir	Sanitary Shop
712	5087002	Club Road Sharqi Market	30.04374833	72.35067833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khalid Mehmood	Sanitary Shop
713	4087083	Club Road Garbi	30.04240333	72.34742167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Fareed	Sanitary Shop
714	22087023	Block C, Vehari	30.04492	72.3539	240	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Hanif	Sanitary Shop
715	22087026	Block C, Vehari	30.04484167	72.35403333	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saleem	Sanitary Shop
716	21087008	Shaheen Market	30.04663167	72.35727	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Maqsood Ahmad	Sanitary Shop
717	4087016	Club Road Garbi	30.04356667	72.34995	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hussain	Sanitary Shop
718	4087025	Club Road Garbi	30.04359667	72.349385	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	M.Khalid,M.Tariq,M.Asif, M.Tahir, M.Zahid	Sanitary Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
719	4087026	Club Road Garbi	30.04341667	72.349515	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	M.Khalid,M.Tariq,M.Asif, M.Tahir, M.Zahid s.23	Sanitary Shop
720	4087080	Club Road Garbi	30.04278	72.34764	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zulfiqar Ali	Sanitary Shop
721	4087086	Club Road Garbi	30.04273833	72.34752	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Hussain	Sanitary Shop
722	4087082	Club Road Garbi	30.04274667	72.34758833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Sanitary Shop
723	4087032	Club Road Garbi	30.04335333	72.34929833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shah Rasool	Sanitary Shop
724	4087125	Club Road Garbi	30.04335333	72.34929667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal 124	Sanitary Shop
725	4087033	Club Road Garbi	30.04335833	72.34929833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Taufail	Sanitary Shop
726	4087034	Club Road Garbi	30.04336333	72.34922833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghafoor	Sanitary Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
727	5087003	Club Road Sharqi Market	30.043855	72.35074	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mehmood Sabir	Sanitary Shop
728	4087044	Club Road Garbi	30.04318667	72.348805	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shahid	Sanitary Shop
729	4087043	Club Road Garbi	30.043185	72.348825	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rafique	Sanitary Shop
730	4087042	Club Road Garbi	30.0432	72.34902833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam, Akram, Arshad s.40	Sanitary Shop
731	4087039	Club Road Garbi	30.04327	72.34897333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khalid Mehmood	Sanitary Shop
732	4087040	Club Road Garbi	30.04325833	72.34896	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Waqas Mehmood	Sanitary Shop
733	4087037	Club Road Garbi	30.04330833	72.349045	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saleem	Sanitary Shop
734	4087038	Club Road Garbi	30.04326833	72.349075	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Idrees	Sanitary Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
735	4087085	Club Road Garbi	30.04265	72.347565	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rasheed	Sanitary Shop
736	4087124	Club Road Garbi	30.04332833	72.34917	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bashir Ahmad 123	Sanitary Shop
737	4087126	Club Road Garbii	30.043325	72.349135	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Jamil	Sanitary Shop
738	5087015	Club Road Sharqi Market	30.04391167	72.35116833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Amjad Ali, Muhammad Irfan	Sanitary Shop
739	21087035	Shaheen Market	30.04649167	72.35739167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Fiaz	Scrap
740	21087036	Shaheen Market	30.04623333	72.35733	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Fiaz	Scrap
741	22087038	Block C, Vehari	30.04479929	72.35423893	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rashid	Scrap
742	22087066	Block C, Vehari	30.04441667	72.35341667	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yaqoob	Scrap

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
743	23087056	Stadium Road Vehari	30.04256333	72.34413167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Basharat, Muhammad Rashid	Scrap
744	4087089	Club Road Garbi	30.04269667	72.34737833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nazeer Ahmad	Scrap
745	4087088	Club Road Garbi	30.04282	72.347675	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khushi Muhammad, Nazeer Ahmad	Scrap
746	4087087	Club Road Garbi	30.04271167	72.34741833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Anwar UI Haq Urf Zulfiqar Ali	Scrap
747	21087062	Shaheen Market	30.04676167	72.35708667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal	scrap shop
748	23087055	Stadium Road Vehari	30.04256833	72.34413333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Basharat	scrap shop
749	20087003	PSO Depot Shops	30.044705	72.346415	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Seal	Seal
750	20087005	PSO Depot Shops	30.044725	72.34648833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Seal	Seal

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
751	7087064	Block C, Vehari	30.042115	72.35306	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Younas	Seeds Shop
752	7087049	Block C, Vehari	30.0420433	72.35265167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saleem	Seeds Shop
753	7087063	Block C, Vehari	30.04195	72.35285167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Naseeb	Seeds Shop
754	7087056	Block C, Vehari	30.041955	72.35286667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saleem	Seeds Shop
755	13087002	Inner Grain Market Shops	30.04317167	72.3506	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Naseer Ahmad Akhtar	Seeds Shop
756	5087082	Club Road Sharqi Market	30.04483667	72.35322	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sohaib Ahmad, Inaam Ul Haq	Seeds Shop
757	5087040	Club Road Sharqi Vehari	30.04429167	72.35190333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Asghar Ali	Seeds Shop
758	19087011	Plot Workshop (Lorry Adda)	30.04750833	72.36049333	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ejaz Mehmood Rasheed	Seeds Shop
759	5087053	Club Road Sharqi Market	30.04443	72.35243833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shareef	Sewing Machine



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
760	5087047	Club Road Sharqi Vehari	30.04433833	72.35222833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nadeem Abbas, Muhammad Qasim, Muhammad Yousaf,	Sewing Machine
761	21087087	Shaheen Market	30.04655333	72.35652833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif 87	Sewing Machine
762	4087014	Club Road Garbi	30.04357833	72.34999667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Akbar Ali	Sewing Machine
763	5087056	Club Road Sharqi Market	30.04446333	72.35253333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rehman	Sewing Machine
764	5087048	Club Road Sharqi Vehari	30.04426	72.352175	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Farooq, Muhammad Naeem	sewing machine
765	5087080	Club Road Sharqi Market	30.04478333	72.35323333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saleem 73	Shalimar electronics
766	14087007	Jinnah Plaza	30.04135	72.35309833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Imtiaz Hashmat	Shoes Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
767	15087023	Mini Market Block C, Vehari	30.043875	72.35312	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Khalid Mehmood	Shoes Shop
768	15087024	Mini Market Block C, Vehari	30.043895	72.353265	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Fiaz Ahmad	Shoes Shop
769	5087141	Club Road Sharqi Market	30.045235	72.35522667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Malang	Shoes Shop
770	5087126	Club Road Sharqi Market	30.04518	72.35475333	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Roshan Din	Shoes Shop
771	5087110	Club Road Sharqi Market	30.044955	72.354375	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Mukhtar Ahmad	shoes shop
772	5087113	Club Road Sharqi Market	30.04505667	72.3543	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faqeer Muhammad	shoes shop
773	5087101	Club Road Sharqi Market	30.04484167	72.35393	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nazeer Ahmad	shoes shop
774	15087011	Mini Market Block C, Vehari	30.04411	72.353195	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Shareef	Shoes Shop
775	15087028	Mini Market Block C, Vehari	30.04411333	72.35309167	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Sarwar	Shoes Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
776	15087029	Mini Market Block C, Vehari	30.04408167	72.35310667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Sarwar	Shoes Shop
777	15087031	Mini Market Block C, Vehari	30.04411333	72.3531	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Ali Jan	Shoes Shop
778	15087030	Mini Market Block C, Vehari	30.04426333	72.35303833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Noor Muhammad	Shoes Shop
779	22087056	Block C, Vehari	30.04442634	72.35329499	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhamamd Raza	shoes shop
780	22087068	Block C, Vehari	30.044415	72.35335167	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Munir	shoes shop
781	22087046	Block C, Vehari	30.04440333	72.353135	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nawaz	Shoes Shop
782	22087047	Block C, Vehari	30.04431833	72.353095	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Jameel	Shoes Shop
783	22087061	Block C, Vehari	30.04430731	72.35303557	170	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Shafqat Mehmood	shoes shop
784	22087050	Block C, Vehari	30.04421833	72.35311167	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashraf	Shoes Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
785	22087051	Block C, Vehari	30.04416167	72.35314833	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Liaquat Ali	Shoes Shop
786	23087057	Stadium Road Vehari	30.04258167	72.34403333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shokat ali	Shokat tyre shop
787	18087001	Old Meat Market Shops	30.04492167	72.34642833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Bakhsh	Auto Shop
788	4087128	Club Road Garbi	30.04318167	72.34901333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam, Akram, Arshad s.39	shop
789	22087011	Shopping Centre, Vehari	30.044495	72.35303667	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amir Raza	Shoper
790	15087022	Mini Market Block C, Vehari	30.043905	72.35316833	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Sardar Muhammad	Shose House
791	15087010	Mini Market Block C, Vehari	30.04391	72.35314333	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Ramzan	Shose Shop
792	15087009	Mini Market Block C, Vehari	30.043915	72.353165	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Nazir Ahmad	Shose Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
793	5087098	Club Road Sharqi Market	30.04484833	72.353845	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad younis	Shose Shop
794	15087027	Mini Market Block C, Vehari	30.04407	72.35306667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Abdul Hafeez	Shose Shop
795	23087102	Stadium Road Vehari	30.04188333	72.34504333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Afzal	show room
796	26087012	Auctioned Empty Plot (Lorry Adda)	30.04806167	72.36031833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Syed Najmal Ul Hassan Shah	Snooker Club
797	26087021	Auctioned Empty Plot (Lorry Adda)	30.048215	72.36066833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Waheed, Muhammad Saeed	Snooker Club
798	21087071	Shaheen Market	30.042195	72.35271667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Irfan Sarwar	Soap Shop
799	5087144	Club Road Sharqi Market	30.045335	72.35532667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Majeed	Sound System
800	23087058	Stadium Road Vehari	30.042515	72.344	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Khalid	Sound System

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
801	2087002	Built Plot (Lorry Adda)	30.04791333	72.35978	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammed shafiq	spare part
802	23087019	Stadium Road	30.04200167	72.344835	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amir Mehmood	spare parts
803	26087039	Auctioned Empty Plot (Lorry Adda)	30.047375	72.36087833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Qayyum	spare parts
804	7087021	Block C, Vehari	30.041895	72.35308	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Asghar Ali	Sports Shop
805	21087031	Shaheen Market	30.04614833	72.35735	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Tofail	Sports Shop
806	19087018	Plot Workshop (Lorry Adda)	30.047305	72.35866	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ilyas, Qaiser Waseem, Umer Waseem	Store
807	19087019	Plot Workshop (Lorry Adda)	30.04731833	72.35864	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafi s.10	Store
808	26087033	Auctioned Empty Plot (Lorry Adda)	30.04792	72.35986667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafi	Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
809	7087020	Block C, Vehari	30.04187	72.35307167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saleem Muhammad Anwar	Store
810	7087051	Block C, Vehari	30.042135	72.35294333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Umeed Ali	Store
811	7087066	Block C, Vehari	30.04183333	72.35283667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	store
812	7087061	Block C, Vehari	30.041895	72.35285	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Store
813	7087062	Block C, Vehari	30.04185667	72.352925	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Liaquat Ali	Store
814	7087080	Goal Chowk Vehari	30.04204167	72.35284833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tariq Sohail, Imran Ali, Numan Ali	Store
815	22087028	Block C, Vehari	30.04610167	72.35693167	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ali Muhammad	store
816	21087103	Shaheen Market	30.04638	72.35688667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram	Store
817	15087053	Mini Market Block C, Vehari	30.04405	72.35321667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Baqar Ali	Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
818	18087002	Old Meat Market Shops	30.04060667	72.35035833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shakeel	Property Dealer
819	21087005	Shaheen Market	30.04591333	72.35648833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bashir Ahmad	Store
820	15087015	Mini Market Block C, Vehari	30.04410167	72.35314	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Anwar Ali	Store
821	15087038	Mini Market Block C, Vehari	30.04429333	72.35294667	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Ali	Store
822	21087040	Shaheen Market	30.04659833	72.35734833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Razia Rehana	Store
823	22087037	Block C, Vehari	30.04477667	72.354275	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rashid	Store
824	22087039	Block C, Vehari	30.0445	72.35355	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Arshad	Store
825	22087069	Block C, Vehari	30.0444	72.35332667	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ramzan	Store
826	22087070	Block C, Vehari	30.04444667	72.35329167	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ramzan s.69	Store



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
827	22087071	Block C, Vehari	30.04435667	72.35323667	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Zulfiqar Ali	Store
828	22087048	Block C, Vehari	30.044325	72.35299667	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Qadir	Store
829	22087072	Block C, Vehari	30.04424833	72.35309	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ishaq Urf Akmal	Store
830	22087073	Block C, Vehari	30.04423333	72.35313833	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal	Store
831	22087074	Block C, Vehari	30.04423	72.35310167	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Mustafa	Store
832	22087075	Block C, Vehari	30.04413333	72.35323	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shahid Yaseen	Store
833	16087005	Block C, Vehari	30.04228333	72.35272333	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Khalid	Store
834	16087010	Block C, Vehari	30.04245833	72.35291667	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Ashraf	Store
835	16087008	Block C, Vehari	30.04234667	72.35300333	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Hassan Ul Hussain Asghar	Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
836	21087055	Shaheen Market	30.046845	72.35722167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rauf	Store
837	21087056	Shaheen Market	30.04688	72.3572	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ali Akbar	Store
838	21087076	Shaheen Market	30.04653167	72.356705	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar Pervaiz	Store
839	21087083	Shaheen Market	30.04673833	72.356715	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Barkat Ali	Store
840	21087078	Shaheen Market	30.04672833	72.35644667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Tariq	Store
841	21087081	Shaheen Market	30.046455	72.35673667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Tahir	Store
842	21087082	Shaheen Market	30.04663167	72.35643333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad	Store
843	21087084	Shaheen Market	30.04664833	72.35646167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Asif	Store
844	21087085	Shaheen Market	30.04669833	72.356465	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Qamar Din	Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
845	21087086	Shaheen Market	30.04658833	72.35656	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Mushtaq	Store
846	21087089	Shaheen Market	30.04659833	72.35646167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nasir U Din	Store
847	21087091	Shaheen Market	30.04654333	72.35656333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mukhtar Ahmad	Store
848	21087094	Shaheen Market	30.04663167	72.35723167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yousaf	Store
849	21087093	Shaheen Market	30.04663333	72.35729333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sabar Zia	Store
850	21087092	Shaheen Market	30.04664833	72.35729333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghafar	Store
851	21087079	Shaheen Market	30.04665833	72.35724667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Taiyab	Store
852	21087141	Shaheen Market	30.04639833	72.356945	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yaseen 150	Store
853	21087154	Shaheen Market	30.04651	72.356875	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Amjad Rafique	Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
854	21087165	Shaheen Market	30.04665667	72.35686833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Boota, Abdul Jabbar	Store
855	21087140	Shaheen Market	30.04645	72.35727167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yaseen 150	Store
856	21087039	Shaheen Market	30.04675333	72.35725667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sajjad Ahmad Shahid	Store
857	21087137	Shaheen Market	30.04667333	72.35679	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghafoor	Store
858	21087148	Shaheen Market	30.04654	72.35697333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram 158	Store
859	21087150	Shaheen Market	30.04636833	72.35700667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif 160	Store
860	21087156	Shaheen Market	30.04635333	72.35698667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Allah Dita, Muhammad Anwar	Store
861	21087158	Shaheen Market	30.046375	72.35698333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Arshad 168	Store
862	21087052	Shaheen Market	30.04679667	72.35717833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghafoor	Store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
863	4087117	Club Road Garbi	30.042345	72.34638667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sadique 116	Store
864	4087108	Club Road Garbi	30.042445	72.34676	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mst. Khalida Nasreen	Store
865	4087023	Club Road Garbi	30.04346333	72.34959667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Irshad	Store
866	26087031	Auctioned Empty Plot (Lorry Adda)	30.04743167	72.360465	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Murtaza	Store
867	26087034	Auctioned Empty Plot (Lorry Adda)	30.04723833	72.36046667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafi	Store
868	19087017	Plot Workshop (Lorry Adda)	30.047535	72.36054	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Shafi s.10	Store
869	4087116	Club Road Garbi	30.042405	72.34651167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Aslam	Store
870	12087001	Godam Sabzi Mandi	30.04177333	72.35319833	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Maqsood Ahmad	Store
871	22087054	Block C, Vehari	30.04454543	72.35363929	170	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Tariq	store

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
872	2087003	Built Plot (Lorry Adda)	30.04817667	72.36097833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal	Sweet Shop
873	23087084	Stadium Road Vehari	30.04199333	72.34460833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Nadeem	Sweet Shop
874	23087085	Stadium Road Vehari	30.04192167	72.344665	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Abdul Sattar	Sweet Shop
875	24087005	Taimoor Shaheed Colony	30.0368	72.33345333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Shoukat Ali	tailor shop
876	7087015	Block C, Vehari	30.04202167	72.35312	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal	Tailors Shop
877	7087075	Block C, Vehari	30.04205833	72.352785	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Tailors Shop
878	5087062	Club Road Sharqi Market	30.04448833	72.35263667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tanveer	Tanveer Electronics
879	23087059	Stadium Road Vehari	30.04252667	72.34407167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tasawar ali	Tasawar motors
880	4087020	Club Road Garbi	30.043405	72.34980667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif	Tea point

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
881	4087059	Club Road Garbi	30.04307	72.34831167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Dilbar Hussain	tea Point
882	18087004	Old Meat Market Shops	30.04072333	72.35017667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdullah	Store
883	3087002	Canteen & Wooden Cabin (Lorry Adda)	30.04786	72.36125333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhamad Afzaal	Tea Shop
884	3087003	Canteen & Wooden Cabin (Lorry Adda)	30.04771333	72.360915	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rafaqat Ali Shah	Tea Stall
885	5087007	Club Road Sharqi Market	30.04381333	72.35081	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khalil Ahmad	Tea Stall
886	23087083	Stadium Road Vehari	30.04195333	72.344615	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Azeem Khan	Tea Stall
887	13087008	Inner Grain Market Shops	30.04185167	72.35108833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Shakoor , Haji Munir	Tea Stall
888	13087003	Inner Grain Market Shops	30.04296667	72.34987833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Saleem	Tea Stall

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
889	23087052	Stadium Road Vehari	30.04249667	72.344175	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ibraheem	Tent Service
890	23087053	Stadium Road Vehari	30.04252167	72.344185	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mst. Bano	Tent Service
891	5087115	Club Road Sharqi Market	30.04498167	72.35442167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Farooq, Muhammad Shareef	Tobacco Shop
892	5087111	Club Road Sharqi Market	30.04496	72.354235	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ayoub Awan	tobacco shop
893	15087036	Mini Market Block C, Vehari	30.04424667	72.35298	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Muhammad Idrees	toy shop
894	15087037	Mini Market Block C, Vehari	30.04425167	72.352975	48	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Mureed Hussain	Toys
895	4087008	Club Road Garbi	30.04363167	72.35024333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rehmat Ali	travel agency
896	22087018	Block C, Vehari	30.04592167	72.35658	240	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sarwar	Trunk Shop



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
897	16087032	Block C, Vehari	30.04223667	72.35296667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Majid	Trunk Shop
898	16087031	Block C, Vehari	30.042225	72.35298167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul majeed	Trunk Shop
899	5087008	Club Road Sharqi Market	30.04386333	72.350855	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rahman	Tube Well Shop
900	5087154	Club Road Sharqi Market	30.04546167	72.35556833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Arshad	Tube Well Shop
901	21087134	Shaheen Market	30.04619333	72.35697	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif 144	Tube Well Shop
902	21087107	Shaheen Market	30.046415	72.35696	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tariq Latif Sheikh	Tube Well Shop
903	21087104	Shaheen Market	30.04631333	72.35649667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tariq Latif Sheikh	Tube Well Shop
904	8087001	Godown Diesel Oil	30.04613667	72.35667667	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tanveer Tufail	Tube Well Shop
905	8087003	Godown Diesel Oil	30.04626333	72.35662167	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nasrullah Khan	Tube Well Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
906	21087130	Shaheen Market	30.04628	72.35705833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sharif	Tube Well Shop
907	21087132	Shaheen Market	30.046385	72.35696333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Pervaiz Akhtar, Shabana Kousar	Tube Well Shop
908	21087167	Shaheen Market	30.04603667	72.35669	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Amir Shahzad 177	tubewill shop
909	10087001	Near PSO Depot Multan Road Vehari	30.04215167	72.34534333	6000	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Qayyom	Tyre Shop
910	23087060	Stadium Road Vehari	30.042485	72.34402833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ashiq Hussain	Tyre Shop
911	23087064	Stadium Road Vehari	30.04237667	72.34406833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abaad Ali	Tyre Shop
912	23087072	Stadium Road Vehari	30.04226667	72.34422	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Ghafoor	Tyre Shop
913	23087050	Stadium Road Vehari	30.04246167	72.34420167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tasawar Hussain, Munawar Hussain	Tyre Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
914	23087065	Stadium Road Vehari	30.04235	72.3441	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar Naqbi	Tyre Shop
915	26087022	Auctioned Empty Plot (Lorry Adda)	30.04738667	72.36101333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal	tyre shop
916	26087024	Auctioned Empty Plot (Lorry Adda)	30.04759667	72.36096	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Akhter Rasool, Sidra Shaheen, Rabia Khalid	Tyre Shop
917	26087030	Auctioned Empty Plot (Lorry Adda)	30.047265	72.36058333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhamad Arshad, Muhammad Alam, Muhammad Riaz	Tyre Shop
918	26087032	Auctioned Empty Plot (Lorry Adda)	30.04728	72.36047833	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Munir Ahmad	Tyre Shop
919	26087035	Auctioned Empty Plot (Lorry Adda)	30.04727167	72.360465	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif	Tyre Shop
920	26087038	Auctioned Empty Plot (Lorry Adda)	30.047335	72.36083667	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Hafsa Naheed & Children, Attiya Saleem & Children	Tyre Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
921	26087040	Auctioned Empty Plot (Lorry Adda)	30.04731333	72.36076	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Khurshed Ahmad, Muhammad Boota	Tyre Shop
922	5087039	Club Road Sharqi Vehari	30.04429333	72.35191667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ghulam Hussain Shah	Ù...Ù^ø''ø§ ø'!Ù,,
923	19087012	Plot Workshop (Lorry Adda)	30.04668833	72.35883	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ejaz Mehmood, Rasheed M	Under Construction
924	23087079	Stadium Road Vehari	30.041975	72.34452333	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Nadeem Arshad-83	Under Construction
925	23087014	Stadium Road	30.04198667	72.34501	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rafique	Under Construction
926	23087015	Stadium Road	30.04201167	72.34492	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Akram Naveed	Under Construction
927	23087088	Stadium Road Vehari	30.0421	72.34468833	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Rana M Usman	Usman motors
928	7087027	Block C, Vehari	30.04169333	72.35281	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Bashir Ahmad	Vegetable Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
929	7087059	Block C, Vehari	30.04192667	72.35278	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Latif	Vegetable Shop
930	7087065	Block C, Vehari	30.04194	72.3529	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Vegetable Shop
931	7087060	Block C, Vehari	30.04193	72.352755	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hanif	Vegetable Shop
932	7087073	Block C, Vehari	30.042	72.35283833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rafiq	Vegetable Shop
933	7087074	Block C, Vehari	30.04202167	72.352795	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Rafiq	Vegetable Shop
934	7087058	Block C, Vehari	30.04179	72.35294833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Anwar	Vegetable Shop
935	7087054	Block C, Vehari	30.04195167	72.35287333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sakander Hayaat	Vegetable Shop
936	5087163	Club Road Sharqi Market	30.04557333	72.35587667	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Asghar	Vegetable Shop
937	21087002	Shaheen Market	30.04592167	72.356345	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faqeer Muhammad	Vegetable Shop

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
938	7087026	Block C, Vehari	30.04174	72.35304	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Faraz Mubarak	Vegetable shop
939	7087052	Block C, Vehari	30.042	72.35285667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul hameed	Vegetable Shop
940	7087053	Block C, Vehari	30.04204333	72.35285	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	shahid aziz	Vegetable Shop
941	7087070	Block C, Vehari	30.041955	72.35272	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Hafeez	Vegetable Shop
942	5087102	Club Road Sharqi Market	30.04488833	72.35389	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhamamd Basheer	Waan Shop
943	5087097	Club Road Sharqi Market	30.04488333	72.35383167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Manzoor Ahmad, Maqsood Ahmad, Noor Ahmad	Waan Shop
944	16087029	Block C, Vehari	30.04223833	72.35318667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Atta Muhammad	Waan Shop
945	16087012	Block C, Vehari	30.04219833	72.35296833	96	1	Commercial	Not Owned/ But Managed	No	Yes	Rented/ Leased	Good	Ali Muhammad	Waan Shop



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
946	5087100	Club Road Sharqi Market	30.04495167	72.35392833	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abbas Ali	Waan Shop
947	4087022	Club Road Garbi	30.04350667	72.34959667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Perveen Akhtar	Wash basin pipe plastic
948	4087024	Club Road Garbi	30.04348833	72.34952167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Riaz	Wash Basin Plastic Pipe
949	4087010	Club Road Garbi	30.04356667	72.35005667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sohail Bhati	Washroom Basin Plastic pipe
950	4087001	Club Road Garbi	30.04368667	72.35043	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad dilshad	Washroom basin shop
951	26087047	Auctioned Empty Plot (Lorry Adda)	30.04711667	72.35977333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Saeed Ahmad	Watch Shop
952	18087003	Old Meat Market Shops	30.04068833	72.35021167	120	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Rasheed	Welding
953	21087037	Shaheen Market	30.04655	72.35734333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Tanveer Qaiser	Welding
954	21087064	Shaheen Market	30.046405	72.35736667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal 64	Welding

Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
955	21087169	Shaheen Market	30.046095	72.35743167	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sufiyan Sarwar	Welding
956	21087166	Shaheen Market	30.046035	72.357005	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Razzaq	Welding
957	21087073	Shaheen Market	30.04657167	72.3573	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Sarwar	Welding
958	4087072	Club Road Garbi	30.04287667	72.34788167	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Jalal Din, Bashir Ahmad	Welding
959	21087063	Mini Market Block C, Vehari	30.046805	72.35708667	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ashraf	welding shop
960	21087128	Shaheen Market	30.04630333	72.35737333	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ramzan	wood work
961	4087068	Club Road Garbi	30.04290667	72.348045	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Yousif	wood work
962	21087129	Shaheen Market	30.04636667	72.35728833	96	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ubaid Ullah	Wood Works
963	4087073	Club Road Garbi	30.042885	72.34791667	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Lehra	Wood Works



Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
964	40870 65	Club Road Garbi	30.0429316 7	72.348095	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Bashir	Wood Works
965	40870 77	Club Road Garbi	30.04282	72.347816 67	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Iqbal 75	Wood Works
966	40870 63	Club Road Garbi	30.04299	72.348203 33	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Fareed Bakhsh, Mehboob Ali	Wood Works
967	40870 57	Club Road Garbi	30.0430233 3	72.3484	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Tahir, Muhammad Younis	wood works
968	40870 35	Club Road Garbi	30.0433366 7	72.349165	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Riasat Ali	Wood Works
969	40870 79	Club Road Garbi	30.0427583 3	72.347583 33	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Muhammad Ali 78	Wood Works
970	40870 84	Club Road Garbi	30.04272	72.347506 67	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Jamal Din	Wooden Shop
971	19087 013	Plot Workshop (Lorry Adda)	30.04733	72.359066 67	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Sardar Muhammad	work shop


Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
972	19087015	Plot Workshop (Lorry Adda)	30.04742667	72.358925	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Mian Muhammad Jamil	Workshop
973	19087016	Plot Workshop (Lorry Adda)	30.047365	72.35873333	2720	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Ch. Muhammad Sarwar	workshop
974	26087004	Auction Empty Plot (Lorry Adda)	30.04792167	72.359875	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Haji Muhammad Shafi	Workshop
975	26087027	Auctioned Empty Plot (Lorry Adda)	30.04732333	72.36084333	80	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Abdul Razzaq	Workshop
976	23087071	Stadium Road Vehari	30.04233667	72.34429	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	M Yaqoob	yaqoob tyre works
977	23087075	Stadium Road Vehari	30.04213333	72.34439	200	1	Commercial	Not Owned/ But Managed	No	No	Rented/ Leased	Good	Salman	Ali ahmad Chulha center
<b>Average Score</b>		<b>1</b>			<b>2</b>			<b>3</b>			<b>4</b>		<b>5</b>	
<b>Asset Condition</b>		<b>Excellent</b>			<b>Good</b>			<b>Fair</b>			<b>Poor</b>		<b>Failing</b>	
<b>Category</b>		<b>A</b>			<b>B</b>			<b>C</b>			<b>D</b>		<b>E</b>	




Integrated Development and Asset Management Plan (IDAMP)														
Municipal Committee Vehari														
Form: IDAMP-A17					Shop Asset Condition Assessment							Asset Code: _____ Date: 04-05-2023		
SR.	Shop Code	Property Address	Latitude	Longitude	Area (Sqft)	No of Stories	Property Location Status	Ownership Status	Encroachment Status	Litigation Exist	Current Status	Condition	Tenant Name	Business
Data Collected By: Mr. Abdullah					Designation: Team Member					 Sign & Date: 30 May 2023				
Data Checked By: Mr. M. Fiaz					Designation: Team Lead					 Sign & Date: 30 May 2023				

## 5. Public Places


### A. Slaughterhouse

Sr #	Name	Age (Years)	Condition	Area (Acres)	Book Value (PKR Million)
1	Slaughterhouse (Khanewal Road)	53	Fair	1	3

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A15		Slaughterhouse Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
Name			Slaughter House MC Vehari		<p style="text-align: center;"><b>Pictures</b></p> 
Location	Latitude	30.048656			
	Longitude	72.340373			
Address			Khanewal Road		
Year of Construction			1970		
Total Area (Acres)			1		
Ownership			MC		
Slaughter Capacity (Per Day)	Larger Animals	27			
	Smaller Animals	20			
Supervisor			Yes	No	
Doctor's Room			Yes	No	
Inhabitation Facility			Yes	No	
Slaughtering Hall			Yes	No	
Evisceration Hall			Yes	No	
Meat Cutting Room			Yes	No	
Blood Collection Arrangements			Yes	No	
Skin Storage Room			Yes	No	
Tools Disinfectant System			Yes	No	
Health and Hygiene SOPs			Yes	No	
Refrigeration / Storage System			Yes	No	
Separate Facility for Sick Animals			Yes	No	
Water Supply System			Yes	No	
Drainage & Disposal Facility			Yes	No	
Solid Waste Collection Facility			Yes	No	
Boundary Wall & Gate			Yes	No	
Approach Road Condition			Good	Fair	Poor
Civil Structure Condition			Good	Fair	Poor

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A15	Slaughterhouse Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
					
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>		 <i>Sign &amp; Date: 30 May 2023</i>	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>		 <i>Sign &amp; Date: 30 May 2023</i>	



**B. Parks**

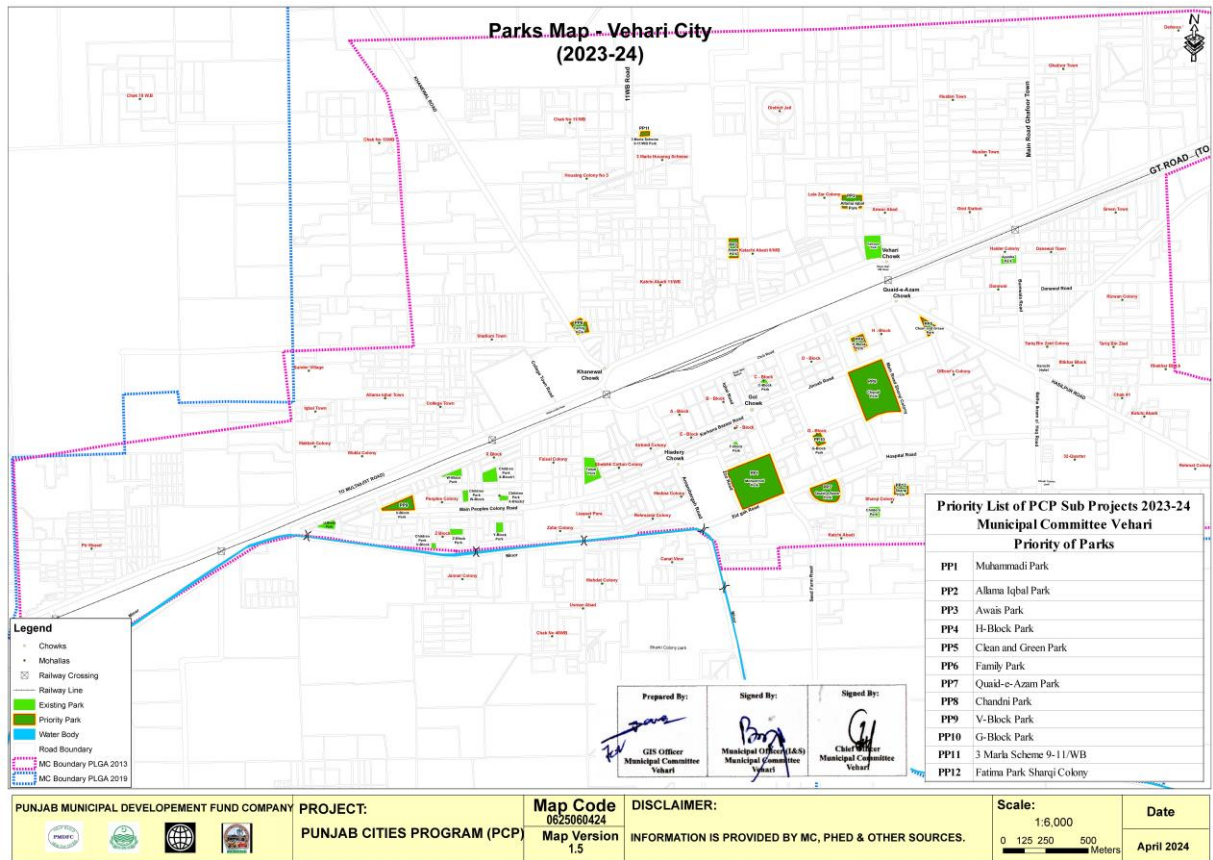


Sr #	Name	Condition	Area (Acres)	Book Value (PKR Million)
1	Muhammadi/Library Park	Fair	14.6	46.72
2	Chandni Park/Ladies Park	Good	12.6	40.32
3	Quaid e Azam Park Sharqi Colony	Good	5.5	17.6
4	Ayesha Park Danewal	Failing	5	16
5	Faisal Park	Fair	4.2	13.44
6	Kalsoom Park	Fair	3.8	12.16
7	Allama Iqbal Park	Poor	3	9.6
8	Sharqi Colony, Southern Block	Failing	2.1	6.72
9	Family Park, X-Block People's Colony	Fair	1.9	6.08
10	Zafar Colony Park	Poor	1.8	5.76


Sr #	Name	Condition	Area (Acres)	Book Value (PKR Million)
11	G-Block Park	Good	1.7	5.44
12	Awais Park 9/11 WB	Failing	1.6	5.12
13	H-Block Park	Poor	1.4	4.48
14	People's Colony Park, V-Block	Poor	1.1	3.52
15	Clean & Green Park	Poor	1.1	3.52
16	Children Park Sharqi Colony	Poor	0.9	2.88
17	Sharqi Colony, Northern Block	Poor	0.9	2.88
18	AC Colony Park	Failing	0.7	2.24
19	People's Colony Park W-Block (Females)	Fair	0.6	1.92
20	People's Colony Park U-Block	Poor	0.6	1.92
21	People's Colony Park Y-Block	Poor	0.5	1.6
22	People's Colony Park Z-Block	Fair	0.5	1.6
23	Family Park, Khanewal Chowk	Failing	0.4	1.28
24	C-Block Park	Fair	0.3	0.96
25	People's Colony Park W-Block (Males)	Poor	0.3	0.96
26	People's Colony Park X-Block	Fair	0.3	0.96
27	F-Block Park	Fair	0.2	0.64

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		Muhammadi/Library Park		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.038628		
	<b>Longitude</b>	72.353423		
<b>Area In Acres</b>		14.6		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>	Good	Fair	Poor	
<b>Approach Road</b>	Good	Fair	Poor	
<b>Parking Lots</b>	Yes	No		
<b>Canteen Availability</b>	Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		70-80		
<b>Any illegal occupants or encroachments observed-if yes, type</b>		No		
<b>Security system</b>	Yes	No		
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>	Yes	No		
<b>Water Supply from Municipal System</b>	Yes	No		
<b>Water Tank</b>	Yes	No		
<b>Pumping Unit</b>	Yes	No		
<b>Distribution Pipe Lines</b>	Yes	No		
<b>Valves</b>	Yes	No		
<b>Sprinkler System</b>	Yes	No		
<b>Ground water storage reservoirs/ponds</b>				
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>	Yes	No		
<b>Flower Beds</b>	Yes	No		
<b>Hedges</b>	Yes	No		
<b>Plants</b>	Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		10-15		
<b>Lights</b>				
<b>Total Number</b>	12			
<b>Poles</b>	Yes	No		
<b>Cables</b>	Yes	No		
<b>Brackets And Lights</b>	Yes	No		
<b>Bulbs And Tubes</b>	Yes	No		
<b>Control Units</b>	Yes	No		
<b>Structures</b>				
<b>No. of Toilets</b>	Gents	04		



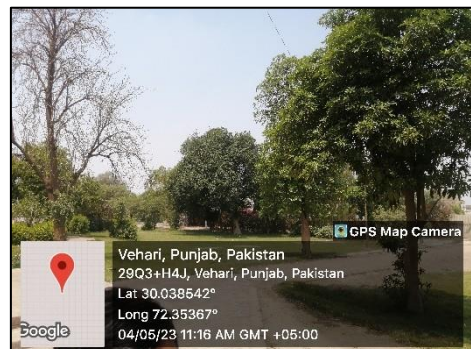
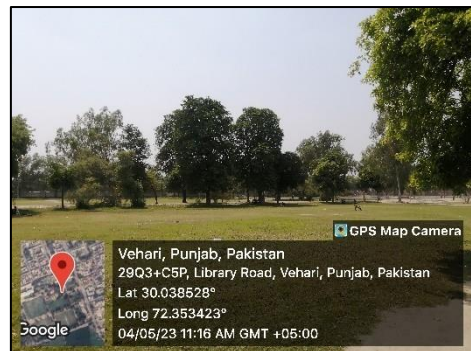





Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
	Ladies	01			
Condition of Toilets	Gents	Fair			
	Ladies	Fair			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)					
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	




Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form:</b> IDAMP-A10	<b>Park</b> Asset Condition Assessment	<b>Asset Code:</b> _____ <b>Date:</b> 04-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023

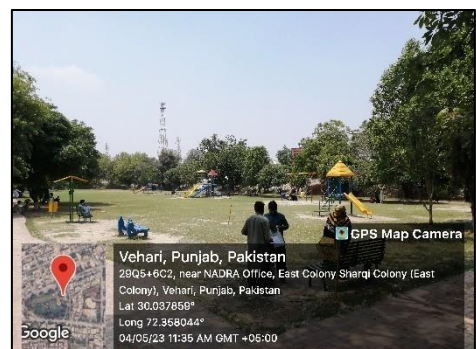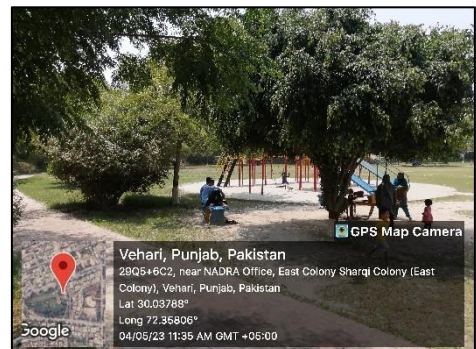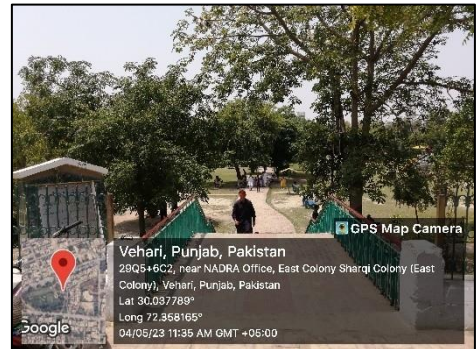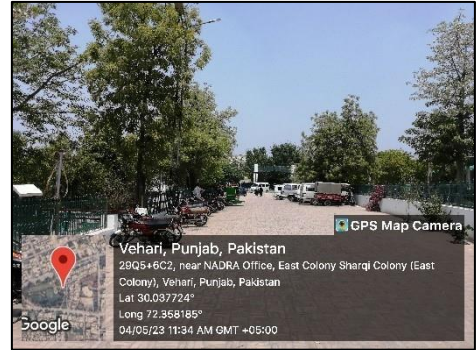

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Quaid e Azam Park Sharqi Colony		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.037788			
	<b>Longitude</b>	72.358165			
<b>Area In Acres</b>		5.5			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>	Good	Fair	Poor		
<b>Approach Road</b>	Good	Fair	Poor		
<b>Parking Lots</b>	Yes		No		
<b>Canteen Availability</b>	Yes	No			
<b>Average number of daily visitors (based on the assessment of MC staff)</b>	300-400				
<b>Any illegal occupants or encroachments observed-if yes, type</b>	Yes	No			
<b>Security system</b>	Yes		No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>	Yes	No			
<b>Water Supply from Municipal System</b>	Yes	No			
<b>Water Tank</b>	Yes		No		
<b>Pumping Unit</b>	Yes		No		
<b>Distribution Pipe Lines</b>	Yes		No		
<b>Valves</b>	Yes	No			
<b>Sprinkler System</b>	Yes	No			
<b>Ground water storage reservoirs/ponds</b>	Yes	No			
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>	Yes	No			
<b>Flower Beds</b>	Yes	No			
<b>Hedges</b>	Yes		No		
<b>Plants</b>	Yes		No		
<b>Number of trees and species (based on readily available information at MC)</b>	13-14				
<b>Lights</b>					
<b>Total Number</b>	18				
<b>Poles</b>	Yes	No			
<b>Cables</b>	Yes		No		
<b>Brackets And Lights</b>	Yes		No		
<b>Bulbs And Tubes</b>	Yes		No		
<b>Control Units</b>	Yes		No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	01			




Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
	Ladies	01			
Condition of Toilets	Gents	Poor			
	Ladies	Poor			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	

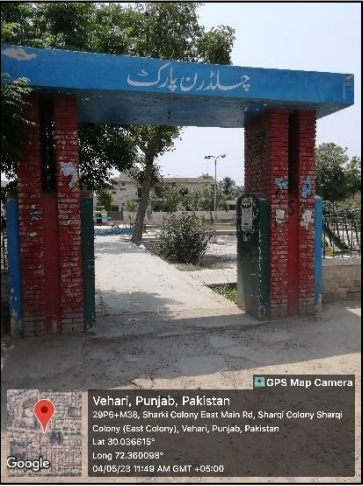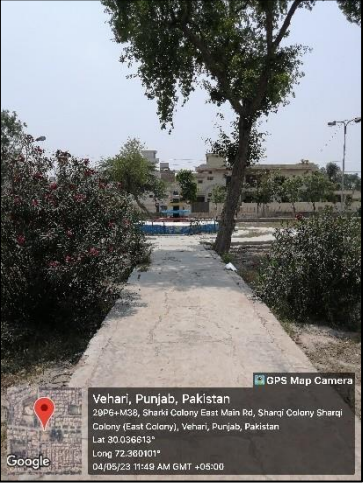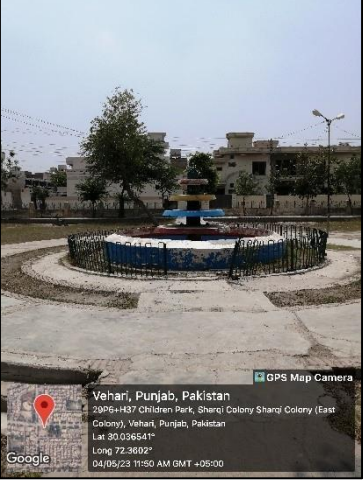Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form:</b> IDAMP-A10	<b>Park</b> <b>Asset Condition Assessment</b>	<b>Asset Code:</b> _____ <b>Date:</b> 04-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10		Park Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Children Park Sharqi Colony		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.036613			
	<b>Longitude</b>	72.360101			
<b>Area In Acres</b>		0.9			
<b>Ownership-Owned by MC or possession allocated to MC by any other department</b>		MC			
<b>Turfing Condition</b>		Good	Fair		
<b>Approach Road</b>		Good	Fair		
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		70-100			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		5-10			
<b>Lights</b>					
<b>Total Number</b>		4			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0			
					
					


	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)					
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li>No Remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

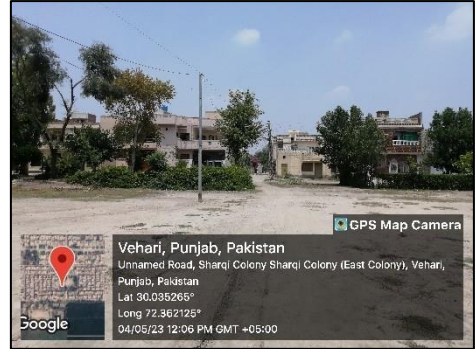

Municipal Committee Vehari					
Form: IDAMP-A10		Park Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Sharqi Colony, Southern Block		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.035265			
	<b>Longitude</b>	72.362125			
<b>Area In Acres</b>		2.1			
<b>Ownership- Owned by MC or possession allocated to MC by any other department</b>		MC			
<b>Turfing Condition</b>		Good	Fair		Poor
<b>Approach Road</b>		Good	Fair		Poor
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		0			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>					
<b>Lights</b>					
<b>Total Number</b>		0			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0			
	<b>Ladies</b>	0			
<b>Condition of Toilets</b>	<b>Gents</b>	-			







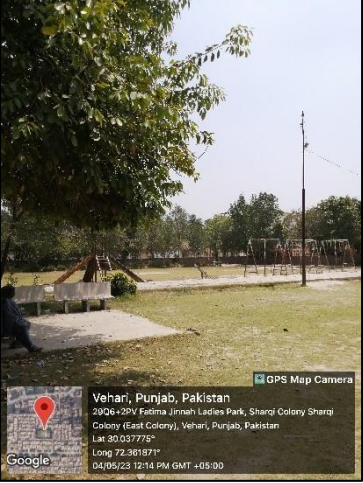

	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)					
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	


Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Sharqi Colony, Northern Block		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.037775			
	<b>Longitude</b>	72.361871			
<b>Area In Acres</b>		0.9			
<b>Ownership-Owned by MC or possession allocated to MC by any other department</b>		MC			
<b>Turfing Condition</b>		Good	Fair		
<b>Approach Road</b>		Good	Fair		
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		100-120			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		15-20			
<b>Lights</b>					
<b>Total Number</b>		1			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0			



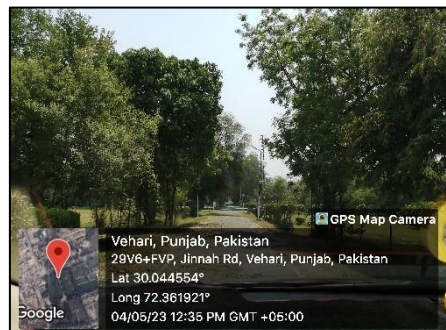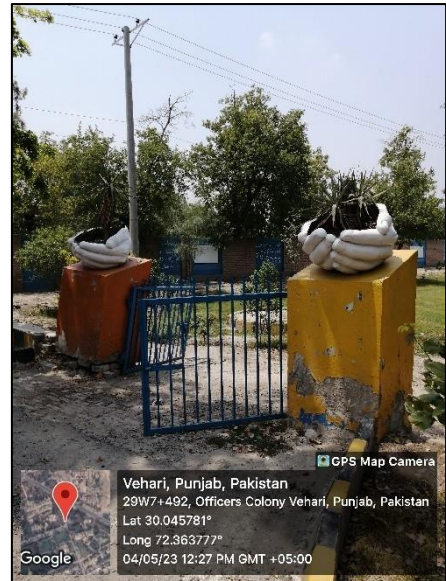

	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

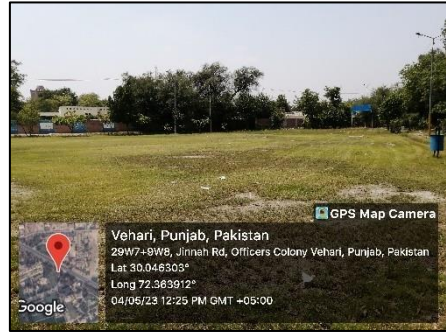

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		Chandni Park/Ladies Park		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.045781		
	<b>Longitude</b>	72.363777		
<b>Area In Acres</b>		12.6		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>	Good	Fair	Poor	
<b>Approach Road</b>	Good	Fair	Poor	
<b>Parking Lots</b>	Yes	No		
<b>Canteen Availability</b>	Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		60-70		
<b>Any illegal occupants or encroachments observed-if yes, type</b>	Yes	No		
<b>Security system</b>	Yes	No		
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>	Yes	No		
<b>Water Supply from Municipal System</b>	Yes	No		
<b>Water Tank</b>	Yes	No		
<b>Pumping Unit</b>	Yes	No		
<b>Distribution Pipe Lines</b>	Yes	No		
<b>Valves</b>	Yes	No		
<b>Sprinkler System</b>	Yes	No		
<b>Ground water storage reservoirs/ponds</b>	Yes	No		
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>	Yes	No		
<b>Flower Beds</b>	Yes	No		
<b>Hedges</b>	Yes	No		
<b>Plants</b>	Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		60-70		
<b>Lights</b>				
<b>Total Number</b>	06			
<b>Poles</b>	Yes	No		
<b>Cables</b>	Yes	No		
<b>Brackets And Lights</b>	Yes	No		
<b>Bulbs And Tubes</b>	Yes	No		
<b>Control Units</b>	Yes	No		
<b>Structures</b>				
<b>No. of Toilets</b>	<b>Gents</b>	2		






	Ladies	2			
Condition of Toilets	Gents	Fair			
	Ladies	Fair			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	





Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Clean & Green Park		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>				
	<b>Longitude</b>				
<b>Area In Acres</b>		1.1			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>		Good	Fair		
<b>Approach Road</b>		Good	Fair		
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		50			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		8			
<b>Lights</b>					
<b>Total Number</b>		07			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0			

	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

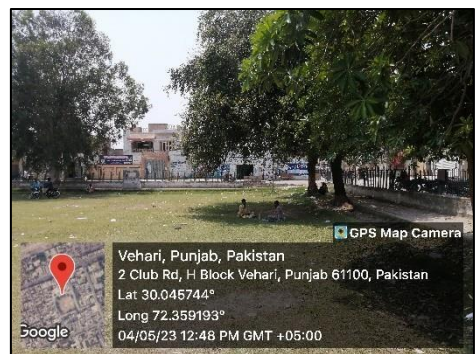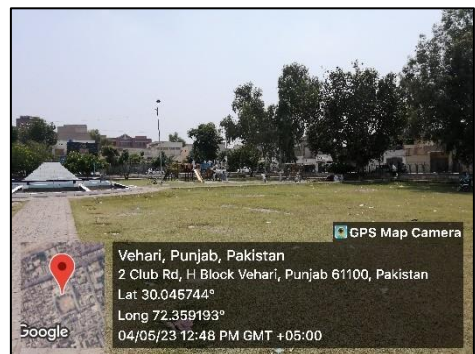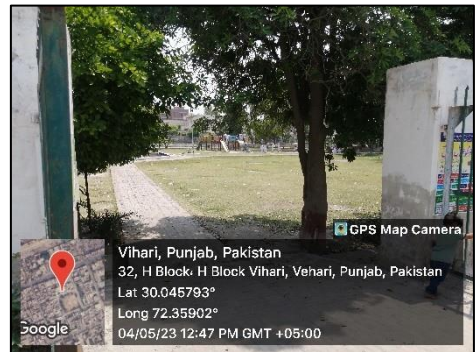
Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		H-Block Park		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.045744		
	<b>Longitude</b>	72.359193		
<b>Area In Acres</b>		1.4		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>	Good	Fair	Poor	
<b>Approach Road</b>	Good	Fair	Poor	
<b>Parking Lots</b>	Yes	No		
<b>Canteen Availability</b>	Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		80-120		
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No	
<b>Security system</b>		Yes	No	
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>		Yes	No	
<b>Water Supply from Municipal System</b>		Yes	No	
<b>Water Tank</b>		Yes	No	
<b>Pumping Unit</b>		Yes	No	
<b>Distribution Pipe Lines</b>		Yes	No	
<b>Valves</b>		Yes	No	
<b>Sprinkler System</b>		Yes	No	
<b>Ground water storage reservoirs/ponds</b>		Yes	No	
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>		Yes	No	
<b>Flower Beds</b>		Yes	No	
<b>Hedges</b>		Yes	No	
<b>Plants</b>		Yes	No	
<b>Number of trees and species (based on readily available information at MC)</b>		10-12		
<b>Lights</b>				
<b>Total Number</b>		07		
<b>Poles</b>		Yes	No	
<b>Cables</b>		Yes	No	
<b>Brackets And Lights</b>		Yes	No	
<b>Bulbs And Tubes</b>		Yes	No	
<b>Control Units</b>		Yes	No	
<b>Structures</b>				
<b>No. of Toilets</b>	Gents	0		










	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
•					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

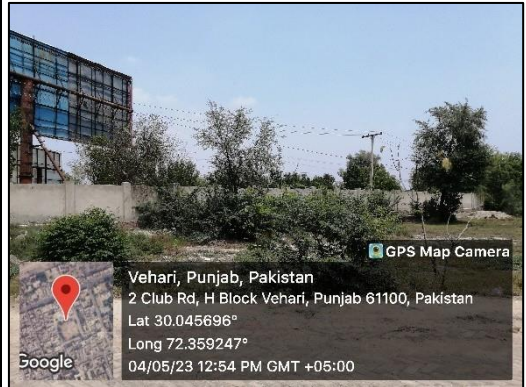

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		AC Colony Park		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.045696			
	<b>Longitude</b>	72.359247			
<b>Area In Acres</b>		0.7			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>	Good	Fair	Poor		
<b>Approach Road</b>	Good	Fair	Poor		
<b>Parking Lots</b>	Yes	No			
<b>Canteen Availability</b>	Yes	No			
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		0			
<b>Any illegal occupants or encroachments observed-if yes, type</b>	Yes	No			
<b>Security system</b>	Yes	No			
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>	Yes	No			
<b>Water Supply from Municipal System</b>	Yes	No			
<b>Water Tank</b>	Yes	No			
<b>Pumping Unit</b>	Yes	No			
<b>Distribution Pipe Lines</b>	Yes	No			
<b>Valves</b>	Yes	No			
<b>Sprinkler System</b>	Yes	No			
<b>Ground water storage reservoirs/ponds</b>	Yes	No			
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>	Yes	No			
<b>Flower Beds</b>	Yes	No			
<b>Hedges</b>	Yes	No			
<b>Plants</b>	Yes	No			
<b>Number of trees and species (based on readily available information at MC)</b>		0			
<b>Lights</b>					
<b>Total Number</b>		0			
<b>Poles</b>	Yes	No			
<b>Cables</b>	Yes	No			
<b>Brackets And Lights</b>	Yes	No			
<b>Bulbs And Tubes</b>	Yes	No			
<b>Control Units</b>	Yes	No			
<b>Structures</b>					
<b>No. of Toilets</b>	Gents	0			




	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	-				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

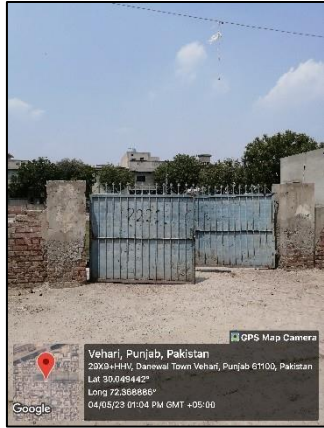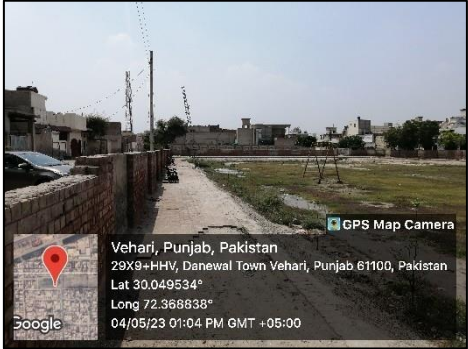
Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		Ayesha Park Danewal		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.049534		
	<b>Longitude</b>	72.368838		
<b>Area In Acres</b>		5		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>	Good	Fair	Poor	
<b>Approach Road</b>	Good	Fair	Poor	
<b>Parking Lots</b>	Yes	No		
<b>Canteen Availability</b>	Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		25-30		
<b>Any illegal occupants or encroachments observed-if yes, type</b>	Yes	No		
<b>Security system</b>	Yes	No		
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>	Yes	No		
<b>Water Supply from Municipal System</b>	Yes	No		
<b>Water Tank</b>	Yes	No		
<b>Pumping Unit</b>	Yes	No		
<b>Distribution Pipe Lines</b>	Yes	No		
<b>Valves</b>	Yes	No		
<b>Sprinkler System</b>	Yes	No		
<b>Ground water storage reservoirs/ponds</b>	Yes	No		
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>	Yes	No		
<b>Flower Beds</b>	Yes	No		
<b>Hedges</b>	Yes	No		
<b>Plants</b>	Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		6-8		
<b>Lights</b>				
<b>Total Number</b>		4 Functional, 4 Non-Functional		
<b>Poles</b>	Yes	No		
<b>Cables</b>	Yes	No		
<b>Brackets And Lights</b>	Yes	No		
<b>Bulbs And Tubes</b>	Yes	No		
<b>Control Units</b>	Yes	No		
<b>Structures</b>				





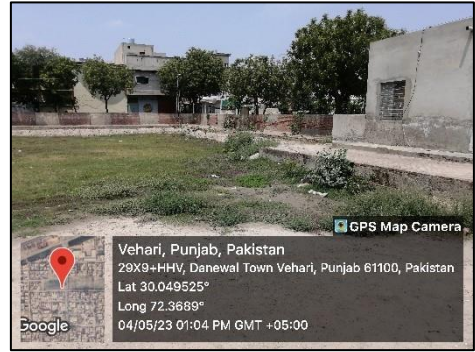

No. of Toilets	Gents	0			
	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	


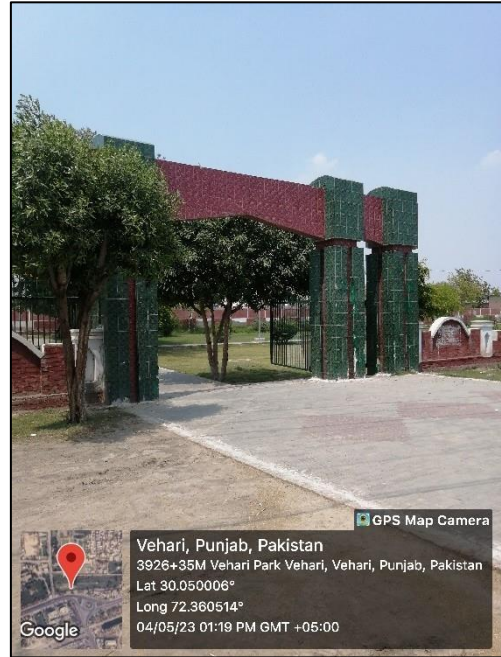


Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Kalsoom Park		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.050028			
	<b>Longitude</b>	72.360477			
<b>Area In Acres</b>		3.8			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>	Good	Fair	Poor		
<b>Approach Road</b>	Good	Fair	Poor		
<b>Parking Lots</b>	Yes	No			
<b>Canteen Availability</b>	Yes	No			
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		40-50			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		15-20			
<b>Lights</b>					
<b>Total Number</b>		9			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0			




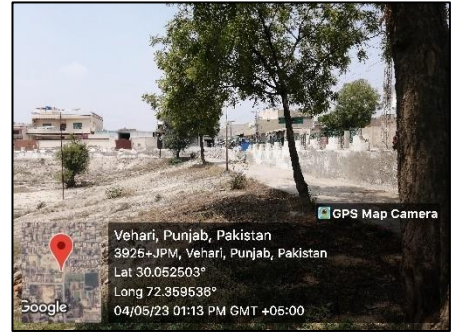
	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		Allama Iqbal Park		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.035568		
	<b>Longitude</b>	72.363407		
<b>Area In Acres</b>		3		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>	Good	Fair	Poor	
<b>Approach Road</b>	Good	Fair	Poor	
<b>Parking Lots</b>	Yes		No	
<b>Canteen Availability</b>	Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		30-50		
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No	
<b>Security system</b>		Yes	No	
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>		Yes	No	
<b>Water Supply from Municipal System</b>		Yes	No	
<b>Water Tank</b>		Yes	No	
<b>Pumping Unit</b>		Yes	No	
<b>Distribution Pipe Lines</b>		Yes	No	
<b>Valves</b>		Yes	No	
<b>Sprinkler System</b>		Yes	No	
<b>Ground water storage reservoirs/ponds</b>		Yes	No	
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>		Yes	No	
<b>Flower Beds</b>		Yes	No	
<b>Hedges</b>		Yes	No	
<b>Plants</b>		Yes	No	
<b>Number of trees and species (based on readily available information at MC)</b>		5-6		
<b>Lights</b>				
<b>Total Number</b>		19 (Non-Functional)		
<b>Poles</b>		Yes	No	
<b>Cables</b>		Yes	No	
<b>Brackets And Lights</b>		Yes	No	
<b>Bulbs And Tubes</b>		Yes	No	
<b>Control Units</b>		Yes	No	
<b>Structures</b>				

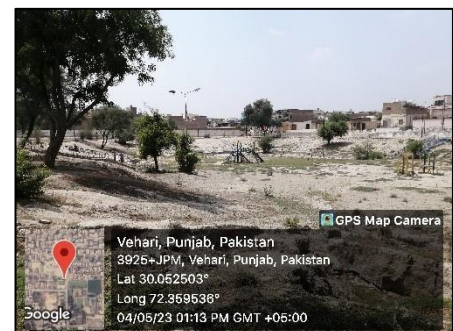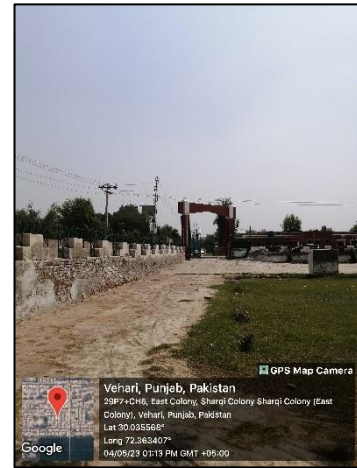













No. of Toilets	Gents	01			
	Ladies	01			
Condition of Toilets	Gents	Good	Fair	Poor	
	Ladies	Non-Functional			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

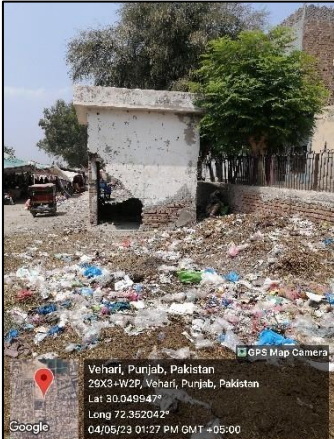

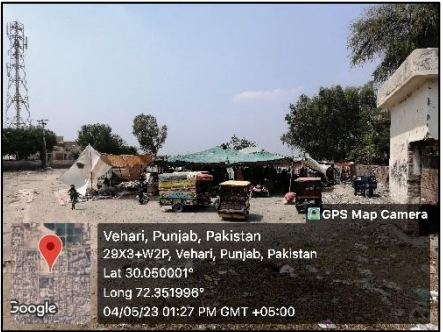





Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		Awais Park 9/11 WB		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.049984		
	<b>Longitude</b>	72.352031		
<b>Area In Acres</b>		1.6		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>	Good	Fair	Poor	
<b>Approach Road</b>	Good	Fair	Poor	
<b>Parking Lots</b>	Yes		No	
<b>Canteen Availability</b>	Yes		No	
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		0		
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No	
<b>Security system</b>		Yes	No	
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>		Yes	No	
<b>Water Supply from Municipal System</b>		Yes	No	
<b>Water Tank</b>		Yes	No	
<b>Pumping Unit</b>		Yes	No	
<b>Distribution Pipe Lines</b>		Yes	No	
<b>Valves</b>		Yes	No	
<b>Sprinkler System</b>		Yes	No	
<b>Ground water storage reservoirs/ponds</b>		Yes	No	
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>		Yes	No	
<b>Flower Beds</b>		Yes	No	
<b>Hedges</b>		Yes	No	
<b>Plants</b>		Yes	No	
<b>Number of trees and species (based on readily available information at MC)</b>		4-5		
<b>Lights</b>				
<b>Total Number</b>		4		
<b>Poles</b>		Yes	No	
<b>Cables</b>		Yes	No	
<b>Brackets And Lights</b>		Yes	No	
<b>Bulbs And Tubes</b>		Yes	No	
<b>Control Units</b>		Yes	No	
<b>Structures</b>				
<b>No. of Toilets</b>	Gents	0		



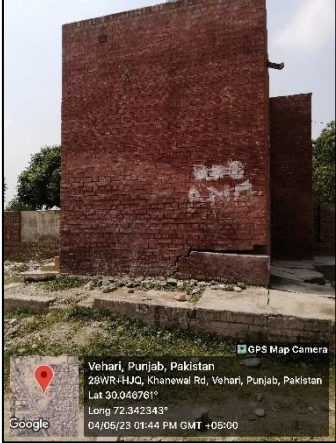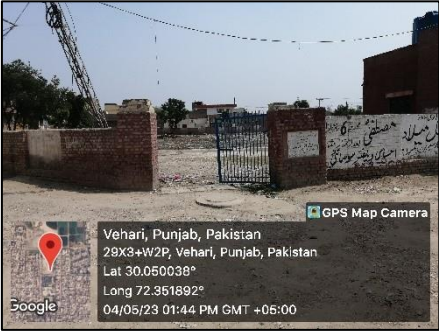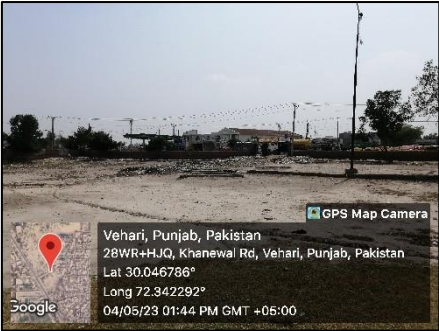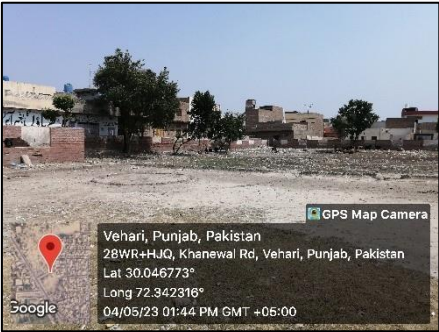




	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

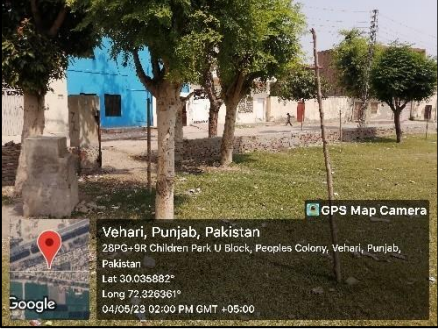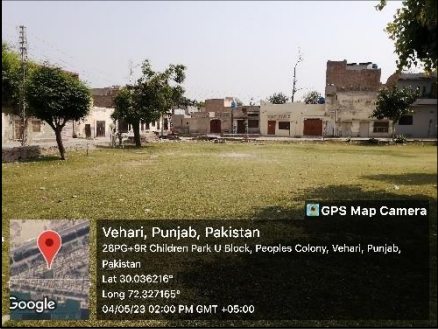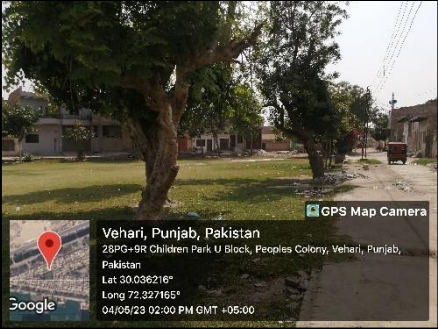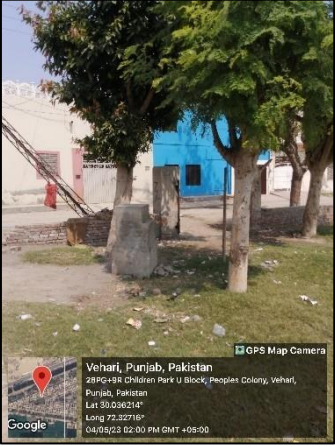Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10		Park Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Family Park, Khanewal Chowk		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.050038			
	<b>Longitude</b>	72.351892			
<b>Area In Acres</b>		0.4			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>		Good	Fair		Poor
<b>Approach Road</b>		Good	Fair		Poor
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		0			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		3-4			
<b>Lights</b>					
<b>Total Number</b>		2			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0			
					
					
					

	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10		Park Asset Condition Assessment		Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		People's Colony Park U-Block		<b>Pictures</b>    	
<b>Location</b>	<b>Latitude</b>	30.036216			
	<b>Longitude</b>	72.327165			
<b>Area In Acres</b>		0.6			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>		Good	Fair		Poor
<b>Approach Road</b>		Good	Fair		Poor
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		20-30			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		4-5			
<b>Lights</b>					
<b>Total Number</b>		0			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0			



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	

Integrated Development and Asset Management Plan (IDAMP)		
Municipal Committee Vehari		
<b>Form:</b> IDAMP-A10	<b>Park</b> Asset Condition Assessment	<b>Asset Code:</b> _____ <b>Date:</b> 04-05-2023
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023






Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		People's Colony Park, V-Block		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.037158		
	<b>Longitude</b>	72.332386		
<b>Area In Acres</b>		1.1		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>		Good	Fair	Poor
<b>Approach Road</b>		Good	Fair	Poor
<b>Parking Lots</b>		Yes	No	
<b>Canteen Availability</b>		Yes	No	
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		20-25		
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No	
<b>Security system</b>		Yes	No	
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>		Yes	No	
<b>Water Supply from Municipal System</b>		Yes	No	
<b>Water Tank</b>		Yes	No	
<b>Pumping Unit</b>		Yes	No	
<b>Distribution Pipe Lines</b>		Yes	No	
<b>Valves</b>		Yes	No	
<b>Sprinkler System</b>		Yes	No	
<b>Ground water storage reservoirs/ponds</b>		Yes	No	
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>		Yes	No	
<b>Flower Beds</b>		Yes	No	
<b>Hedges</b>		Yes	No	
<b>Plants</b>		Yes	No	
<b>Number of trees and species (based on readily available information at MC)</b>		4-5		
<b>Lights</b>				
<b>Total Number</b>		9		
<b>Poles</b>		Yes	No	
<b>Cables</b>		Yes	No	
<b>Brackets And Lights</b>		Yes	No	
<b>Bulbs And Tubes</b>		Yes	No	
<b>Control Units</b>		Yes	No	
<b>Structures</b>				
<b>No. of Toilets</b>	<b>Gents</b>	0		




	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		People's Colony Park W-Block (Females)		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.038809		
	<b>Longitude</b>	72.334522		
<b>Area In Acres</b>		0.6		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>	Good	Fair	Poor	
<b>Approach Road</b>	Good	Fair	Poor	
<b>Parking Lots</b>	Yes	No		
<b>Canteen Availability</b>	Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		25-40		
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No	
<b>Security system</b>		Yes	No	
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>		Yes	No	
<b>Water Supply from Municipal System</b>		Yes	No	
<b>Water Tank</b>		Yes	No	
<b>Pumping Unit</b>		Yes	No	
<b>Distribution Pipe Lines</b>		Yes	No	
<b>Valves</b>		Yes	No	
<b>Sprinkler System</b>		Yes	No	
<b>Ground water storage reservoirs/ponds</b>		Yes	No	
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>		Yes	No	
<b>Flower Beds</b>		Yes	No	
<b>Hedges</b>		Yes	No	
<b>Plants</b>		Yes	No	
<b>Number of trees and species (based on readily available information at MC)</b>		6-7		
<b>Lights</b>				
<b>Total Number</b>		2		
<b>Poles</b>		Yes	No	
<b>Cables</b>		Yes	No	
<b>Brackets And Lights</b>		Yes	No	
<b>Bulbs And Tubes</b>		Yes	No	
<b>Control Units</b>		Yes	No	
<b>Structures</b>				

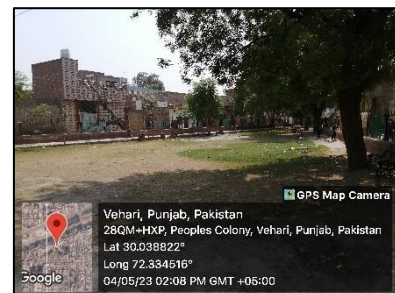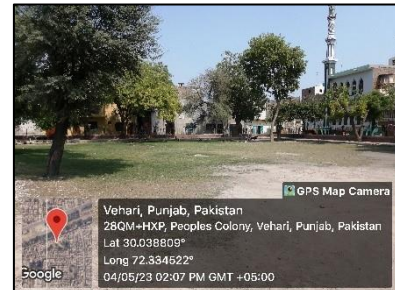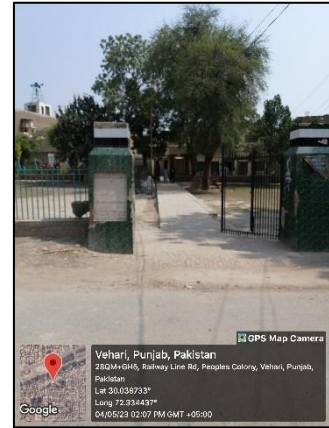
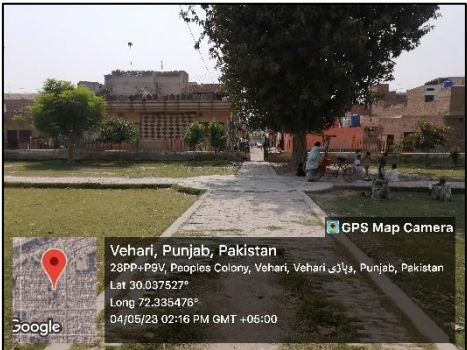




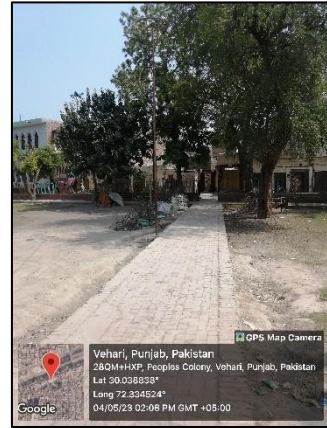

No. of Toilets	Gents	0			
	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	








Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		People's Colony Park W-Block (Males)		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.037527		
	<b>Longitude</b>	72.335476		
<b>Area In Acres</b>		0.3		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>		Good	Fair	Poor
<b>Approach Road</b>		Good	Fair	Poor
<b>Parking Lots</b>		Yes	No	
<b>Canteen Availability</b>		Yes	No	
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		30-40		
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No	
<b>Security system</b>		Yes	No	
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>		Yes	No	
<b>Water Supply from Municipal System</b>		Yes	No	
<b>Water Tank</b>		Yes	No	
<b>Pumping Unit</b>		Yes	No	
<b>Distribution Pipe Lines</b>		Yes	No	
<b>Valves</b>		Yes	No	
<b>Sprinkler System</b>		Yes	No	
<b>Ground water storage reservoirs/ponds</b>		Yes	No	
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>		Yes	No	
<b>Flower Beds</b>		Yes	No	
<b>Hedges</b>		Yes	No	
<b>Plants</b>		Yes	No	
<b>Number of trees and species (based on readily available information at MC)</b>		9-10		
<b>Lights</b>				
<b>Total Number</b>		4 Functional, 4 Non-Functional		
<b>Poles</b>		Yes	No	
<b>Cables</b>		Yes	No	
<b>Brackets And Lights</b>		Yes	No	
<b>Bulbs And Tubes</b>		Yes	No	
<b>Control Units</b>		Yes	No	








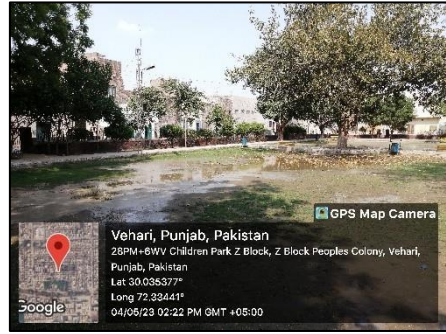
<b>Structures</b>					
No. of Toilets	Gents	0			
	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

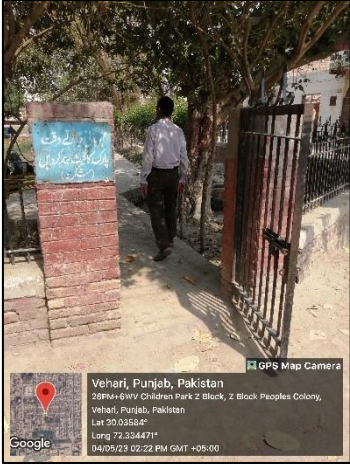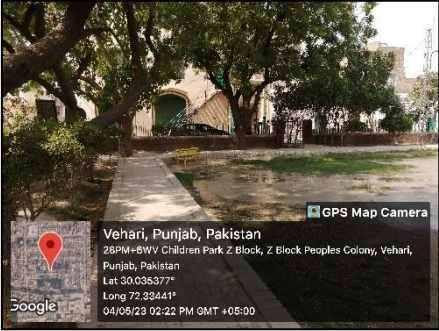





Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		People's Colony Park Z-Block		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.035377			
	<b>Longitude</b>	72.334110			
<b>Area In Acres</b>		0.5			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>		Good	Fair		Poor
<b>Approach Road</b>		Good	Fair		Poor
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		25-40			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		8-9			
<b>Lights</b>					
<b>Total Number</b>		2 Functional, 2 Non-Functional			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					



No. of Toilets	Gents	0			
	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	



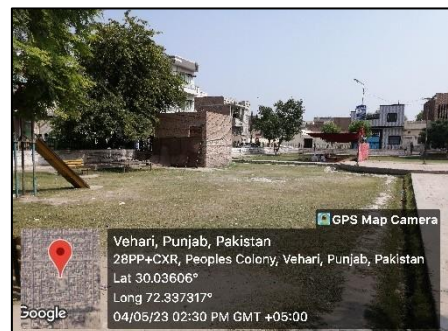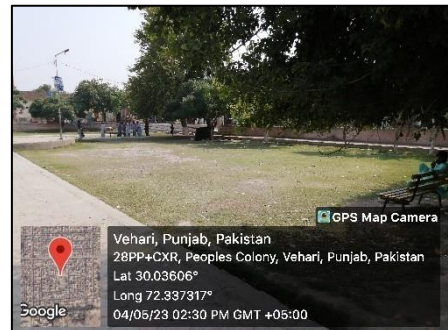



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		People's Colony Park Y-Block		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.036060			
	<b>Longitude</b>	72.337317			
<b>Area In Acres</b>		0.5			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>	Good	Fair	Poor		
<b>Approach Road</b>	Good	Fair	Poor		
<b>Parking Lots</b>	Yes	No			
<b>Canteen Availability</b>	Yes	No			
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		30-40			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		8-10			
<b>Lights</b>					
<b>Total Number</b>		3 Functional, 3 Non-Functional			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					





No. of Toilets	Gents	0			
	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	



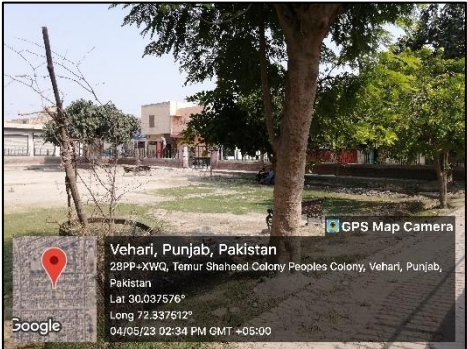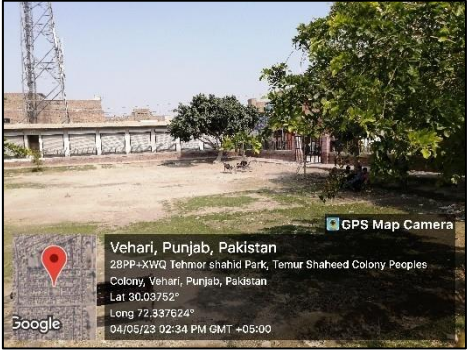




Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		People's Colony Park X-Block		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.037576			
	<b>Longitude</b>	72.337512			
<b>Area In Acres</b>		0.3			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>		Good	Fair		Poor
<b>Approach Road</b>		Good	Fair		Poor
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		20-30			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		8-10			
<b>Lights</b>					
<b>Total Number</b>		0			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0			



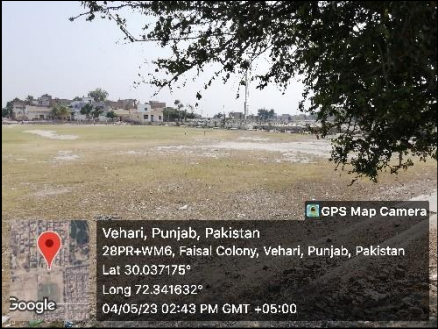
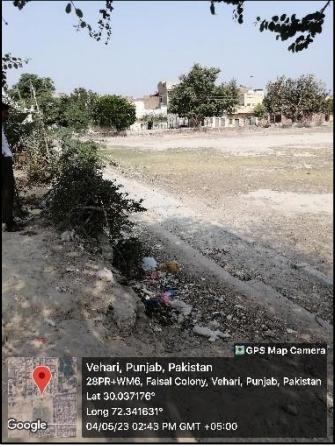
	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	






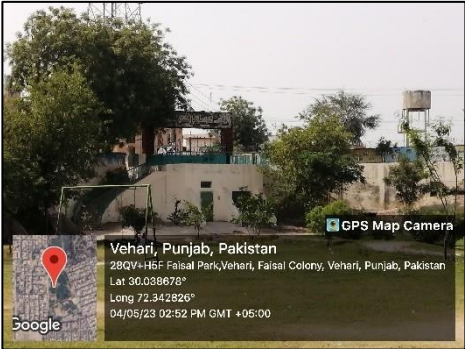
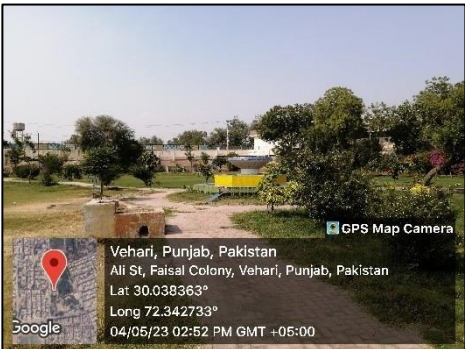
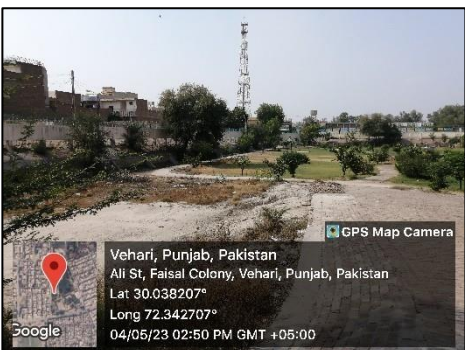
Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Family Park, X-Block People's Colony		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.038287			
	<b>Longitude</b>	72.337201			
<b>Area In Acres</b>		1.9			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>		Good	Fair		 <p>Vehari, Punjab, Pakistan 28QP+9R9, Temur Shaheed Colony Peoples Colony, Vehari, Punjab, Pakistan Lat 30.038287° Long 72.337201° 04/05/23 02:37 PM GMT +05:00</p>
<b>Approach Road</b>		Good	Fair		
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		50-60			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		5-6			
<b>Lights</b>					
<b>Total Number</b>		2 Functional, 2 Non-Functional			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		

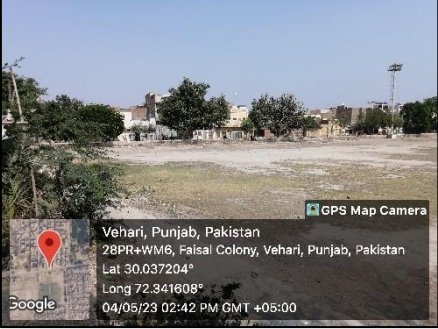

<b>Structures</b>					
No. of Toilets	Gents	0			
	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	






Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		Liaquat Pura/Zafar Colony Park		<b>Pictures</b>	
<b>Location</b>	<b>Latitude</b>	30.037204			
	<b>Longitude</b>	72.341608			
<b>Area In Acres</b>		1.8			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>		Good	Fair		Poor
<b>Approach Road</b>		Good	Fair		Poor
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		-			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		-			
<b>Lights</b>					
<b>Total Number</b>		9			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0		  	

	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	



Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023		
<b>Name</b>		Faisal Park		<b>Pictures</b>		
<b>Location</b>	<b>Latitude</b>	30.038678				
	<b>Longitude</b>	72.342826				
<b>Area In Acres</b>		4.2				
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC				
<b>Turfing Condition</b>		Good	Fair		      	
<b>Approach Road</b>		Good	Fair			
<b>Parking Lots</b>		Yes	No			
<b>Canteen Availability</b>		Yes	No			
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		80-100				
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No			
<b>Security system</b>		Yes	No			
<b>Watering &amp; Irrigation</b>						
<b>Tube Well</b>		Yes	No			
<b>Water Supply from Municipal System</b>		Yes	No			
<b>Water Tank</b>		Yes	No			
<b>Pumping Unit</b>		Yes	No			
<b>Distribution Pipe Lines</b>		Yes	No			
<b>Valves</b>		Yes	No			
<b>Sprinkler System</b>		Yes	No			
<b>Ground water storage reservoirs/ponds</b>		Yes	No			
<b>Landscaping &amp; Plantation</b>						
<b>Grass Beds</b>		Yes	No			
<b>Flower Beds</b>		Yes	No			
<b>Hedges</b>		Yes	No			
<b>Plants</b>		Yes	No			
<b>Number of trees and species (based on readily available information at MC)</b>		8-10				
<b>Lights</b>						
<b>Total Number</b>		0				
<b>Poles</b>		Yes	No			
<b>Cables</b>		Yes	No			
<b>Brackets And Lights</b>		Yes	No			
<b>Bulbs And Tubes</b>		Yes	No			
<b>Control Units</b>		Yes	No			
<b>Structures</b>						
<b>No. of Toilets</b>	<b>Gents</b>	1				
	<b>Ladies</b>	1				

Condition of Toilets	Gents	Good	Fair	Poor	
	Ladies	Good	Fair	Poor	
Buildings		Yes		No	
Fountains & Water Fall Structure		Yes		No	
Walkways		Yes		No	
Jogging tracks		Yes		No	
Ramps at entry gates for wheel chairs		Yes		No	
Bridges & Culverts		Yes		No	
Play Area		Yes		No	
Gazebos		Yes		No	
Benches/ sitting arrangements		Yes		No	
Boundary Wall & Gate		Yes		No	
Toilets		Yes		No	
Lakes & Brooks		Yes		No	
<b>Mechanical Equipment</b>					
Pumping Units		Yes		No	
Swings		Yes		No	
Children Games		Yes		No	
Fixtures		Yes		No	
Benches		Yes		No	
<b>Sanitation &amp; Water Supply</b>					
Litter Bins		Yes		No	
Condition of SWM		Good	Fair	Poor	
Toilet Fixtures		Yes		No	
Sewerage System		Yes		No	
Vegetation Cuttings & Disposal		Yes		No	
Drinking water availability and quality (based on availability of water quality test reports)		No			
Water Pipes		Yes		No	
<b>HR</b>					
Security Guards		Yes		No	
Landscape Experts		Yes		No	
Mali / Beldaar (Number)		Yes		No	
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	


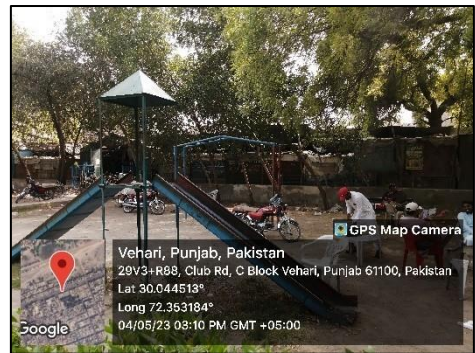
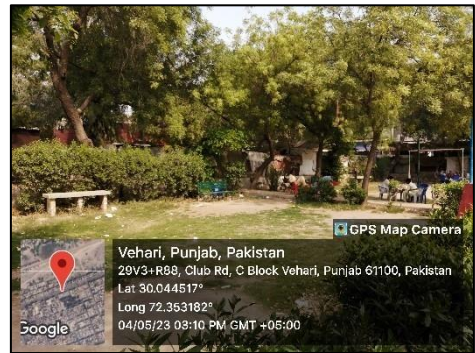
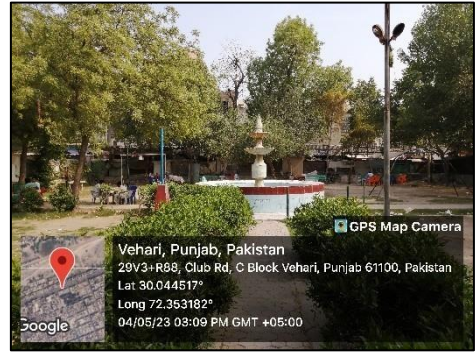
Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		C-Block Park		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.044517		
	<b>Longitude</b>	72.353182		
<b>Area In Acres</b>		0.3		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>	Good	Fair	Poor	
<b>Approach Road</b>	Good	Fair	Poor	
<b>Parking Lots</b>	Yes	No		
<b>Canteen Availability</b>	Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>	100			
<b>Any illegal occupants or encroachments observed-if yes, type</b>	Yes	No		
<b>Security system</b>	Yes	No		
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>	Yes	No		
<b>Water Supply from Municipal System</b>	Yes	No		
<b>Water Tank</b>	Yes	No		
<b>Pumping Unit</b>	Yes	No		
<b>Distribution Pipe Lines</b>	Yes	No		
<b>Valves</b>	Yes	No		
<b>Sprinkler System</b>	Yes	No		
<b>Ground water storage reservoirs/ponds</b>	Yes	No		
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>	Yes	No		
<b>Flower Beds</b>	Yes	No		
<b>Hedges</b>	Yes	No		
<b>Plants</b>	Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>	5-6			
<b>Lights</b>				
<b>Total Number</b>	1			
<b>Poles</b>	Yes	No		
<b>Cables</b>	Yes	No		
<b>Brackets And Lights</b>	Yes	No		
<b>Bulbs And Tubes</b>	Yes	No		
<b>Control Units</b>	Yes	No		
<b>Structures</b>				
<b>No. of Toilets</b>	Gents	0		











	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

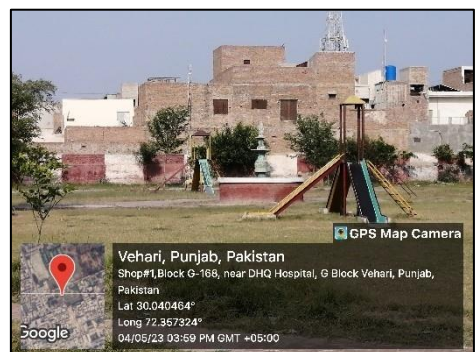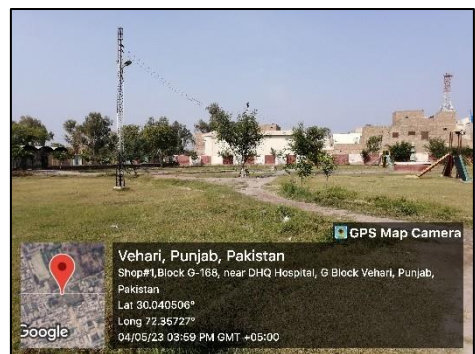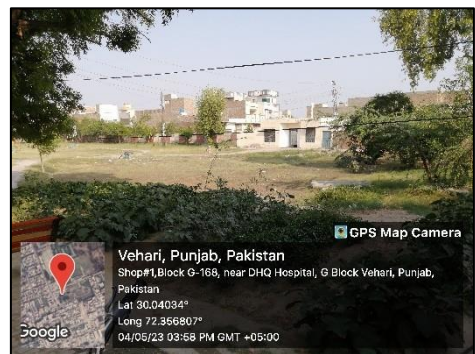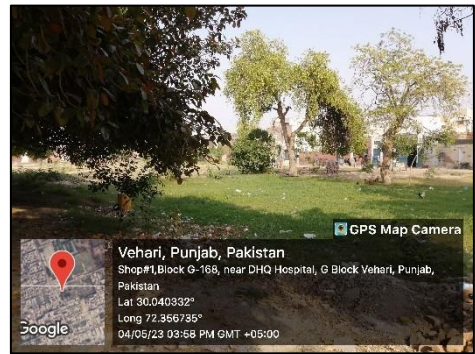

Integrated Development and Asset Management Plan (IDAMP)				
Municipal Committee Vehari				
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023
<b>Name</b>		G-Block Park		<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.040332		
	<b>Longitude</b>	72.356735		
<b>Area In Acres</b>		1.7		
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC		
<b>Turfing Condition</b>	Good	Fair	Poor	
<b>Approach Road</b>	Good	Fair	Poor	
<b>Parking Lots</b>	Yes	No		
<b>Canteen Availability</b>	Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		30-40		
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No	
<b>Security system</b>		Yes	No	
<b>Watering &amp; Irrigation</b>				
<b>Tube Well</b>		Yes	No	
<b>Water Supply from Municipal System</b>		Yes	No	
<b>Water Tank</b>		Yes	No	
<b>Pumping Unit</b>		Yes	No	
<b>Distribution Pipe Lines</b>		Yes	No	
<b>Valves</b>		Yes	No	
<b>Sprinkler System</b>		Yes	No	
<b>Ground water storage reservoirs/ponds</b>		Yes	No	
<b>Landscaping &amp; Plantation</b>				
<b>Grass Beds</b>		Yes	No	
<b>Flower Beds</b>		Yes	No	
<b>Hedges</b>		Yes	No	
<b>Plants</b>		Yes	No	
<b>Number of trees and species (based on readily available information at MC)</b>		9-10		
<b>Lights</b>				
<b>Total Number</b>		10		
<b>Poles</b>		Yes	No	
<b>Cables</b>		Yes	No	
<b>Brackets And Lights</b>		Yes	No	
<b>Bulbs And Tubes</b>		Yes	No	
<b>Control Units</b>		Yes	No	
<b>Structures</b>				
<b>No. of Toilets</b>	Gents	0		

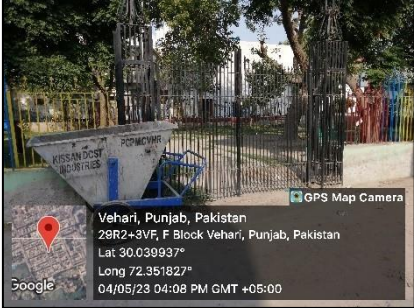

	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

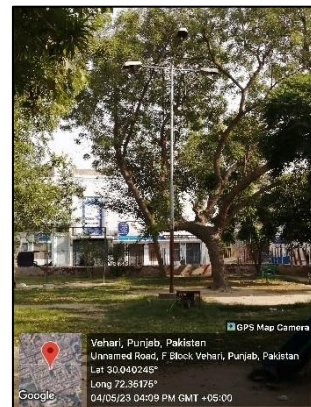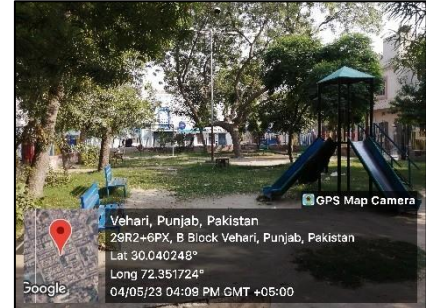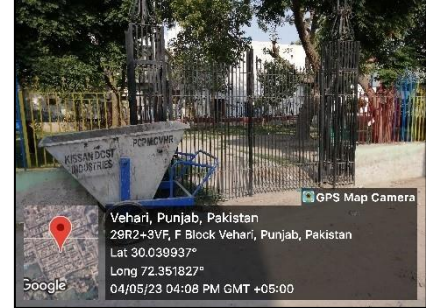Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A10	Park Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
<b>Name</b>		F-Block Park			<b>Pictures</b>
<b>Location</b>	<b>Latitude</b>	30.040248			
	<b>Longitude</b>	72.351724			
<b>Area In Acres</b>		0.2			
<b>Ownership-Owned by MC or possession allocated to MC by any other department (documents available)</b>		MC			
<b>Turfing Condition</b>		Good	Fair	Poor	
<b>Approach Road</b>		Good	Fair	Poor	
<b>Parking Lots</b>		Yes	No		
<b>Canteen Availability</b>		Yes	No		
<b>Average number of daily visitors (based on the assessment of MC staff)</b>		50-60			
<b>Any illegal occupants or encroachments observed-if yes, type</b>		Yes	No		
<b>Security system</b>		Yes	No		
<b>Watering &amp; Irrigation</b>					
<b>Tube Well</b>		Yes	No		
<b>Water Supply from Municipal System</b>		Yes	No		
<b>Water Tank</b>		Yes	No		
<b>Pumping Unit</b>		Yes	No		
<b>Distribution Pipe Lines</b>		Yes	No		
<b>Valves</b>		Yes	No		
<b>Sprinkler System</b>		Yes	No		
<b>Ground water storage reservoirs/ponds</b>		Yes	No		
<b>Landscaping &amp; Plantation</b>					
<b>Grass Beds</b>		Yes	No		
<b>Flower Beds</b>		Yes	No		
<b>Hedges</b>		Yes	No		
<b>Plants</b>		Yes	No		
<b>Number of trees and species (based on readily available information at MC)</b>		8-10			
<b>Lights</b>					
<b>Total Number</b>		2			
<b>Poles</b>		Yes	No		
<b>Cables</b>		Yes	No		
<b>Brackets And Lights</b>		Yes	No		
<b>Bulbs And Tubes</b>		Yes	No		
<b>Control Units</b>		Yes	No		
<b>Structures</b>					
<b>No. of Toilets</b>	<b>Gents</b>	0			





	Ladies	0			
Condition of Toilets	Gents	-			
	Ladies	-			
Buildings	Yes	No			
Fountains & Water Fall Structure	Yes	No			
Walkways	Yes	No			
Jogging tracks	Yes	No			
Ramps at entry gates for wheel chairs	Yes	No			
Bridges & Culverts	Yes	No			
Play Area	Yes	No			
Gazebos	Yes	No			
Benches/ sitting arrangements	Yes	No			
Boundary Wall & Gate	Yes	No			
Toilets	Yes	No			
Lakes & Brooks	Yes	No			
<b>Mechanical Equipment</b>					
Pumping Units	Yes	No			
Swings	Yes	No			
Children Games	Yes	No			
Fixtures	Yes	No			
Benches	Yes	No			
<b>Sanitation &amp; Water Supply</b>					
Litter Bins	Yes	No			
Condition of SWM	Good	Fair	Poor		
Toilet Fixtures	Yes	No			
Sewerage System	Yes	No			
Vegetation Cuttings & Disposal	Yes	No			
Drinking water availability and quality (based on availability of water quality test reports)	No				
Water Pipes	Yes	No			
<b>HR</b>					
Security Guards	Yes	No			
Landscape Experts	Yes	No			
Mali / Beldaar (Number)	Yes	No			
<b>Overall Rating</b>					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
<b>Remarks / Requirements</b>					
<ul style="list-style-type: none"> <li><b>No remarks</b></li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

**Bus Stands**

Sr #	Name	Condition	Area (Acres)	Book Value (PKR Million)
1	General Bus Stand, Vehari	Fair	3	96

Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A12	Bus Stand Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023		
<b>Name</b>		General Bus Stand		<b>Pictures</b>		
<b>Location</b>	<b>Latitude</b>	30.047791				
	<b>Longitude</b>	72.360903				
<b>Address</b>		Club Road, Vehari				
<b>Year of Construction</b>		Not Available				
<b>Last Major Renovation</b>		Not Available				
<b>Area (Acres)</b>		3				
<b>Ownership</b>		MC				
<b>Class</b>		A	B		C	D
<b>Designed Capacity of Vehicles</b>	<b>Buses</b>	Not Available				
	<b>Coasters</b>	Not Available				
	<b>Wagons</b>	Not Available				
<b>Daily parking of vehicles (based on information provided by MC)</b>	<b>Buses</b>	25				
	<b>Coasters</b>	35				
	<b>Wagons</b>	20				
	<b>Rickshaws</b>	Not Available				
<b>Distance from the urban area</b>		4 km				
<b>Security</b>	<b>At Entry</b>	Yes	No			
	<b>At Exit</b>	Yes	No			
<b>Gate</b>	<b>At Entry</b>	Yes	No			
	<b>At Exit</b>	Yes	No			
<b>Waiting Area</b>	<b>Men</b>	Yes	No			
	<b>Families</b>	Yes	No			
<b>Washroom</b>	<b>Male</b>	Yes	No			
	<b>Female</b>	Yes	No			
<b>Prayer Room</b>	<b>Male</b>	Yes	No			
	<b>Female</b>	Yes	No			
<b>Administration Office</b>		Yes	No			
<b>Parking Stand</b>	<b>Rickshaw</b>	Yes	No			
	<b>Cars</b>	Yes	No			
<b>Fuel Outlets</b>		Yes	No			
<b>Reception Desk</b>		Yes	No			



Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A12	Bus Stand Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Ticketing System	Yes			No	
Tuck Shop	Yes			No	
Workshop	Yes			No	
Ablution Area	Yes			No	
Pedestrian	Yes			No	
Green Spaces	Yes			No	
Water Drinking Arrangement	Yes			No	
Water Disposal Arrangement	Yes			No	
Boarding Shed	Yes			No	
Workshops	Yes			No	
Lighting	Yes			No	
Boundary Wall	Yes			No	
Flooring & Pavement	Type	PCC			
	Condition	Good	Fair	Poor	
Overall Rating					
Average Score	1	2	3	4	5
Asset Condition	Excellent	Good	Fair	Poor	Failing
Category	A	B	C	D	E
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

### C. Others

Sr #	Name	Condition	Area (Acres)	Book Value (PKR Million)
1	Cattle Mandi	Fair	8	20
2	Model Bazar	Good	0.8	2.5

## 6. Lands





### A. Open Plots




Sr #	Name	Condition	Area (Acres)	Book Value (PKR Million)
1	Open Plot Workshop	Fair	0.25	8
2	Open Plot Saraye	Fair	0.25	8

## 7. Office Vehicles


Sr #	Name	Registration Number	Age (Years)	Condition	Status	Book Value (PKR Million)	Capacity
1	Suzuki-Cultus	VRL 7575	15	Fair	Functional	0.4	1000 cc
2	Suzuki-Potohar	VRD 969	28	Poor	Functional	0.2	1000 cc
3	Suzuki-Cultus	VRG 7	21	Poor	Functional	0.3	1000 cc
4	Honda CD-70	VRC 4526	33	Poor	Functional	0.01	70 cc
5	Toyota	VR 4350	43	Poor	Functional	0.1	3000 cc
6	Suzuki- Cultus	VRL 9696	16	Fair	Functional	0.38	1000 cc
7	Suzuki-Potohar	VRF 4645	23	Poor	Functional	0.25	1000 cc
8	Yamaha	VRL 1103	16	Fair	Functional	0.035	70 cc
9	Yamaha-Bike	VRL 1105	16	Fair	Functional	0.035	100 cc
10	Yamaha-Bike	VRL 1104	16	Fair	Functional	0.035	100 cc
11	Yamaha-Bike	VRL 1126	16	Fair	Functional	0.035	100 cc



Integrated Development and Asset Management Plan (IDAMP)						
Municipal Committee Vehari						
Form: IDAMP-A16	Moveable Asset Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023		
Type of Vehicle / Machinery	Pictures					
Cars	<div style="display: flex; justify-content: space-around;">   </div>					
	Suzuki 1	Suzuki 2	Suzuki 3	Suzuki 4	Suzuki 5	Toyota
<b>Capacity</b>	1000 CC	1000 CC	1000 CC	1000 CC	1000 CC	3000 CC
<b>Purpose</b>	Staff	Staff	Staff	Staff	Staff	Staff
<b>Year of Manufacturing</b>	2008	1995	2002	2000	2007	1980
<b>Model</b>	Cultus	Potohar	Cultus	Cultus	Potohar	Not Available
<b>Capital Cost</b>						
<b>Fuel Consumption (Lt)</b>	235	152	50	198	144	127
<b>Condition</b>	Fair	Poor	Poor	Poor	Fair	Poor
<b>Engine Capacity</b>	1000 CC	1000 CC	1000 CC	1000 CC	1000 CC	3000 CC
<b>Maintenance Cost</b>	Not Available	Not Available	Not Available	Not Available	Not Available	Not Available
<b>Oiling /Fitness</b>	Yes	Yes	Yes	Yes	Yes	Yes
<b>Fitness Certificate</b>	No	No	No	No	No	No
<b>Registered</b>	VRL 7575	VRD 969	VRG 7	VRL 9696	VRF 4645	VR 4350
<b>Overall Rating</b>	Fair	Poor	Poor	Poor	Fair	Poor
Remarks / Requirements						
<ul style="list-style-type: none"> <li>No remarks</li> </ul>						
<i>Data Collected By: Mr. Abdullah</i>		<i>Designation: Team Member</i>			 Sign & Date: 30 May 2023	
<i>Data Checked By: Mr. M. Fiaz</i>		<i>Designation: Team Lead</i>			 Sign & Date: 30 May 2023	




Integrated Development and Asset Management Plan (IDAMP)					
Municipal Committee Vehari					
Form: IDAMP-A16	Moveable Asset Asset Condition Assessment			Asset Code: _____ Date: 04-05-2023	
Type of Vehicle / Machinery	Pictures				
Bike					
	Yamaha-Bike1	Yamaha-Bike2	Yamaha-Bike3	Yamaha-Bike4	Honda-Bike1
<b>Capacity</b>	100 CC	100 CC	100 CC	70 CC	70 CC
<b>Purpose</b>	Staff	Staff	Staff	Staff	Staff
<b>Year of Manufacturing</b>	2007	2007	2007	2007	1990
<b>Model</b>	YB-100	YB-100	YB-100	YB-100	CD-70
<b>Capital Cost</b>					
<b>Fuel Consumption (Lt) (Lt)</b>	51	60	38	47	37
<b>Condition</b>	Fair	Fair	Fair	Fair	Poor
<b>Engine Capacity</b>	100 CC	100 CC	100 CC	70 CC	70 CC
<b>Maintenance Cost</b>	Not Available	Not Available	Not Available	Not Available	Not Available
<b>Oiling /Fitness</b>	Yes	Yes	Yes	Yes	Yes
<b>Fitness Certificate</b>	No	No	No	No	No
<b>Registered</b>	VRL 1103	VRL 1126	VRL 1105	VRL 1104	VRC 4526
<b>Overall Rating</b>	Fair	Fair	Fair	Fair	Poor
Remarks / Requirements					
<ul style="list-style-type: none"> <li>No remarks</li> </ul>					
Data Collected By: Mr. Abdullah		Designation: Team Member		 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz		Designation: Team Lead		 Sign & Date: 30 May 2023	

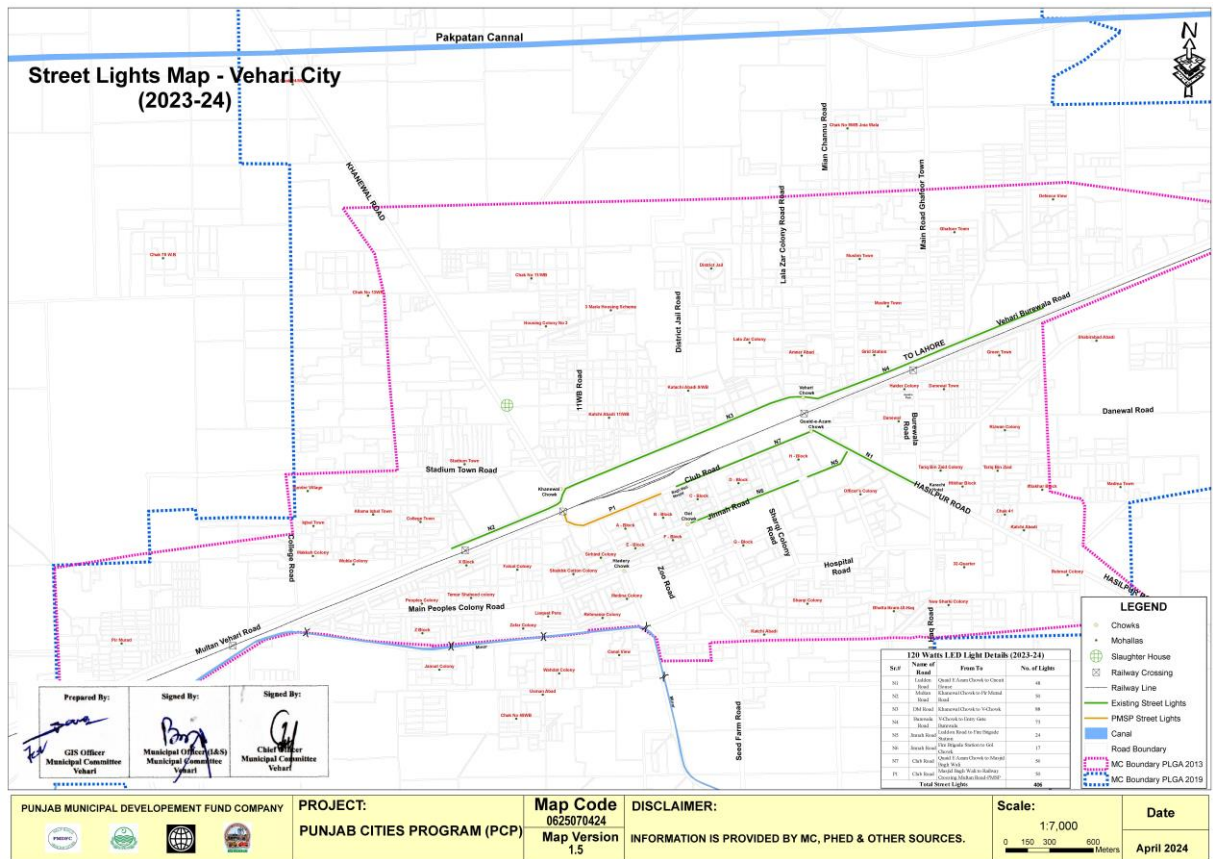

8. Street lights



	Streetlights	MC Operated	Privately Operated
Operational Street Lights	1,501	1,501	-
Non-Operational Street Lights	1,231	1,231	-
<b>Total</b>	<b>2,732</b>	<b>2,732</b>	<b>0</b>

Operated by	Precast Concrete	Steel Structure	Tubular Steel	Tree	Wire	Gate	Rail Box	Model	Wall	Grand Total
MC	503	1,025	320	1	496	3	5	8	31	2,392
Private	-	-	-	-	-	-	-	-	-	0


Integrated Development and Asset Management Plan (IDAMP)			
Municipal Committee Vehari			
Form: IDAMP-A9	Street Lights Asset Condition Assessment	Asset Code: _____ Date: 04-05-2023	
Pictures			
			
			
Area	No. of Street Lights	Operational Status	Poles Type (WAPDA Pole / MC Pole)
U Block Gulshan Chowk	42	Not Available	Not Available
V-Block	68	Not Available	Not Available
Main road people Colony.	54	Not Available	Not Available
W-Block	47	Not Available	Not Available
Y-Block	55	Not Available	Not Available
Z-Block	28	Not Available	Not Available
X-Block	123	Not Available	Not Available
Madina Colony	108	Not Available	Not Available
Liaqat Pura	78	Not Available	Not Available
College Town	13	Not Available	Not Available
Tanki Lakar Mandi	50	Not Available	Not Available
Lakar Mandi (Near Riasat Building Material)	23	Not Available	Not Available
Imam Bargah Colony (Baraf Phata Chowk)	6	Not Available	Not Available
Faisal Park	9	Not Available	Not Available
Sharqi Colony Passport Office Road	119	Not Available	Not Available
Sharqi Colony Bairi Chowk	96	Not Available	Not Available
Gol Chowk	286	Not Available	Not Available
H-Block	30	Not Available	Not Available
G-Block	26	Not Available	Not Available
Club Road Near Masjid Bagh Wali	39	Not Available	Not Available
D-Block	50	Not Available	Not Available
Chandni Park	82	Not Available	Not Available
Liddan Road	46	Not Available	Not Available
Club Road (Near Model Bazar)	58	Not Available	Not Available
Circuit House Road (Near Public Hotel)	27	Not Available	Not Available
Boray Wala Road	90	Not Available	Not Available
Multan Road	113	Not Available	Not Available
Lahore Road	100	Not Available	Not Available
Kalloom Nawaz Park	36	Not Available	Not Available

Daniwal (Khatpak Chowk)	39	Not Available	Not Available
GOR Road	14	Not Available	Not Available
Daniwal Markazi Masjid Chowk.	75	Not Available	Not Available
Rizwan Colony	19	Not Available	Not Available
New Daniwal	12	Not Available	Not Available
Rizwan Colony Iftikhar Block Near Bilal Masjid	103	Not Available	Not Available
Muslim Town	38	Not Available	Not Available
Lala Zar Colony	40	Not Available	Not Available
Bhata Shadi Khan Near Masjid Anwar e Madina	36	Not Available	Not Available
Bhata Shadi Khan Near Masjid Gulzar e Madina	53	Not Available	Not Available
Anwarabad	37	Not Available	Not Available
9 WB	147	Not Available	Not Available
11 WB	217	Not Available	Not Available
<b>Remarks / Requirements</b>			
<ul style="list-style-type: none"> <li>Out of the 2,732 lights in the MC, 1,501 lights are operational.</li> </ul>			
Data Collected By: Mr. Abdullah	Designation: Team Member	 Sign & Date: 30 May 2023	
Data Checked By: Mr. M. Fiaz	Designation: Team Lead	 Sign & Date: 30 May 2023	

Out of the 2,732 lights in the MC, 1,501 lights are operational. Details are given in the following table:

Equipment Type	Wattage of Lighting Fixture	Quantity		Daily Operational Hours
		MC	Private	
LED	12	697	-	12.0
LED	17	1	-	12.0
LED	18	7	-	12.0
LED	20	22	-	12.0
LED	30	212	-	12.0
LED	50	169	-	12.0
LED	70	3	-	12.0
LED	90	3	-	12.0
LED	100	52	-	12.0
LED	120	304	-	12.0
LED	150	12	-	12.0
LED	200	1	-	12.0
CFL	12	9	-	12.0
CFL	50	7	-	12.0
Halogen	250	2	-	12.0

9. Roads

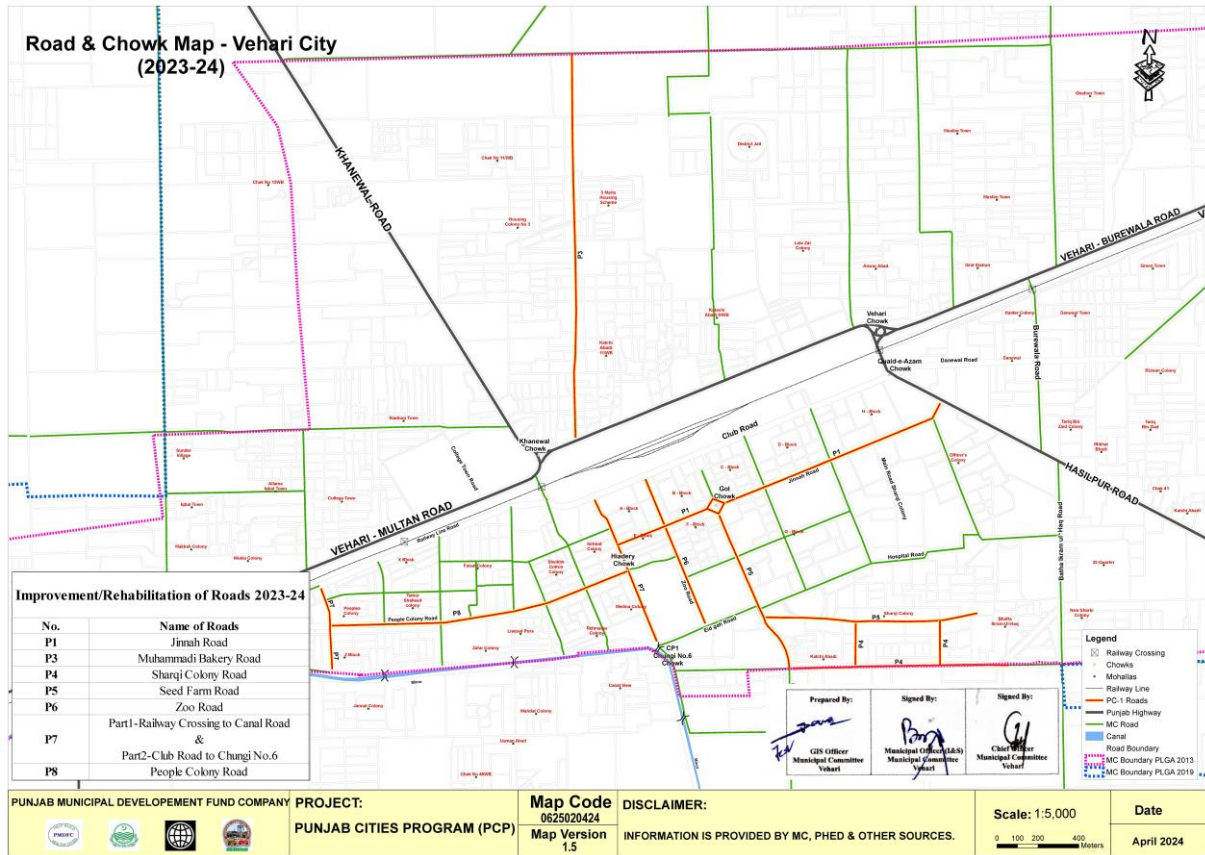



10.

Sr #	Road Name	R.O.W (ft)	Existing Type	Length (km)
1	Jinnah Road	55	T.S.T	2.5
2	DPS Road	60	T.S.T	1
3	Faisal Park Road	40	T.S.T	0.75
4	Chamra Mandi Road	60	T.S.T	0.75
5	Old Nadra Office Road	60	T.S.T	1
6	Passport Office Road	50	T.S.T	1
7	Main Road Sharqi Colony	100	T.S.T	1
8	Iqbal Road	100	T.S.T	0.5
9	Loha Bazar Road	100	T.S.T	0.5
10	Main People Colony Road	80	T.S.T	1.5
11	MNA House Road	40	T.S.T	1
12	Jannat Colony Road	40	T.S.T	0.25
13	Thana Sadar Road	40	T.S.T	1
14	Mohammadi Bakery Road	40	T.S.T	2
15	Main Lalazar Road	40	T.S.T	1
16	Ghafoor Town Road	40	Asphalt	1
17	Danewal main road	40	Asphalt	1.25
18	People colony road (along railway line)	30	TST	2.5
19	Canal road (liaqatpura)	25	Asphalt	2.5
20	Zafar park road	40	Asphalt	0.5
21	Rail bazar	50	Asphalt	0.3

Integrated Development and Asset Management Plan (IDAMP)									
Municipal Committee Vehari									
Form: IDAMP-A8	Road Asset Condition Assessment				Asset Code: _____ Date: 04-05-2023				
Pictures									
Sr. No.	Road Name	From	to	Ownership	TST, Asphalt Or Concrete Pavers	Row (Ft)	Paved Width (Ft)	Approx. Length (Km)	Condition
1	Jinnah Road	Ludden Road	Bilal Masjid Sirhind Colony	MC Vehari	TST	55	40	2.5	Poor
2	DPS Road	Goal Chowk	Masani Bagh	MC Vehari	TST	60	40	1.0	Poor
3	Faisal Park Road	Main People Colony Road	Commerce College Road	MC Vehari	TST	40	40	0.75	Poor
4	Chamra Mandi Road	Club Road	Madina Colony Chowk	MC Vehari	TST	60	40	0.75	Poor
5	Old Nadra Office Road	Club Road	Zoo	MC Vehari	TST	60	40	1.0	Poor
6	Passport Office Road	Masani Bagh	New Sharqi Colony	MC Vehari	TST	50	40	1.0	Poor
7	Main Road Sharqi Colony	Chungi No 5	Disposal Works Sharqi Colony	MC Vehari	TST	100	40	1.0	Poor
8	Iqbal Road	Club Road	Karkhana Bazar Road	MC Vehari	TST	100	40	0.5	Poor
9	Loha Bazar Road	Club Road	Karkhana Bazar Road	MC Vehari	TST	100	40	0.5	Poor
10	Main People Colony Road	Pehla Chowk	Taimoor Shaheed Colony	MC Vehari	TST	80	40	1.5	Poor
11	MNA House Road	Club Road	Quaid-E-Azam Park	MC Vehari	TST	40	40	1.0	Poor
12	Jannat Colony Road	Habib Chowk	Jannat Colony	MC Vehari	TST	40	30	0.25	Poor
13	Thana Sadar Road	Club Road	Nursing Hostel	MC Vehari	TST	40	30	1.0	Poor
14	Mohammadi Bakery Road	Main DM Road	Makka Town	MC Vehari	TST	40	25	2.0	Poor
15	Main Lalazar Road	DPO Office	Chaudry Garden	MC Vehari	TST	40	30	1.0	Fair
16	Ghafoor Town Road	Dm Road	Ghafoor Town	MC Vehari	TST	40		1.0	Poor



Integrated Development and Asset Management Plan (IDAMP)									
Municipal Committee Vehari									
Form: IDAMP-A8		Road Asset Condition Assessment					Asset Code: _____		
Date: 04-05-2023									
17	Danewal main road	Quaid e Azam chowk	Rizwan colony chowk	MC Vehari	TST	40	16	1.25	Poor
18	People colony road (along railway line)	Thana city	People colony	MC Vehari	TST	30	10	2.5	Poor
19	Canal road (liaqatpura)	Eid Gah chowk	End of colony	MC Vehari	TST	25	10	2.5	Poor
20	Zafar park road	Faisal town	Khachi Mandi	MC Vehari	TST	40	24	0.5	Poor
21	Rail bazar	Goal chowk	Masjid baghwali	MC Vehari	TST	50	40	0.3	Poor
Remarks / Requirements									
<ul style="list-style-type: none"> <li>No remarks</li> </ul>									
Data Collected By: Mr. Abdullah				Designation: Team Member			 Sign & Date: 30 May 2023		
Data Checked By: Mr. M. Fiaz				Designation: Team Lead			 Sign & Date: 30 May 2023		

### Annexure B. Projects Coding Scheme:

Region Name	Region Code	MC	MC Code	Property Types	Property Type Code	Sub Property Types	Sub Property Type Code	Unique Codes
Southern Punjab	03	Vehari	15	Water Supply System	01	Tube wells	01	03-15-01-01-XX
						Water Supply Network (ft)	02	03-15-01-02-XX
						OHR	03	03-15-01-03-XX
						Filtration Plants	04	03-15-01-04-XX
						Vehicles	05	03-15-01-05-XX
						GST	06	03-15-01-06-XX
				Sewerage System	02	Sewerage Network (ft)	01	03-15-02-01-XX
						Disposal Stations	02	03-15-02-02-XX
						Vehicles	03	03-15-02-03-XX
				Solid Waste Management System	03	Dumping site	01	03-15-03-01-XX
						Vehicles	02	03-15-03-02-XX
						Parking Shed	03	03-15-03-03-XX
				Roads and Streets	04	Roads	01	03-15-04-01-XX
						Street	02	03-15-04-02-XX
						Street light	03	03-15-04-03-XX
				Public Places	05	Parks	01	03-15-05-01-XX
						Playgrounds	02	03-15-05-02-XX
						Open Spaces / Plots	03	03-15-05-03-XX
						Bus Stand	04	03-15-05-04-XX
						Library	05	03-15-05-05-XX
						Slaughter Houses	06	03-15-05-06-XX
						Graveyards	07	03-15-05-07-XX
						Masjid/ Imam bargah	08	03-15-05-08-XX
				Shops	09	03-15-05-09-XX		

Region Name	Region Code	MC	MC Code	Property Types	Property Type Code	Sub Property Types	Sub Property Type Code	Unique Codes
				Others	06	Office buildings	01	03-15-06-01-XX
						Office vehicles	02	03-15-06-02-XX
						Residential building	03	03-15-06-03-XX

## Annexure C. Project Screening and Phasing

**Project ID:** 03-15-01-02-01

**Project Description :** Improvement & Rehabilitation of Water Supply system in Vehari City

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score	
<b>1. Project Purpose &amp; Service Delivery Improvement</b>								
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Significant contribution	10	
				7.5	Major contribution			
				10	Significant contribution			
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		10	10	0	No contribution.	Major contribution to key development goal.	10
					2.5	Indirect contribution.		
					7.5	Minor direct contribution		
					10	Major contribution to key development goal.		
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?		10	10	0	No consequences	Major immediate consequences	10
					2.5	Minor consequences		
		7.5			Major future consequences			
		10			Major immediate consequences			
<b>2. Public Response</b>								
2.1	Population served by the project.	15	7.5	1	Less than 10%	Greater than 20%	7.5	
				5	Between 10% to 20%			
				7.5	Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media, or business organizations?		5	5	0	Majority opposition	Majority support	5
					1	Minority opposition		
					5	Majority support		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?		2.5	2.5	Minority support	Majority support	2.5
				0	Majority opposition		
				0.5	Minority opposition		
				2.5	Majority support		
				1.5	Minority support		
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g., Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?		7.5	0	No direct revenue	Direct revenue is not sufficient to meet O&M costs	2.5
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g., employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Additional investment in the area and increased wealth for citizens	5
				2.5	Little or no long-term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?		5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?		5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4	Ease of implementation of project in respect of technical design?		5	1	Difficult	Standard	3
				3	Standard		
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O&M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
		3		Outside expertise needed for preparation phase i .e., feasibility studies			
		5		No outside expertise needed			
<b>Total Achieved Score</b>							<b>86.5</b>

**Project ID:** 03-15-01-02-02  
**Project Description :** Improvement & Rehabilitation of Water Supply system in Vehari City

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Significant contribution	10		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Major contribution to key development goal.	10	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
					10	Major contribution to key development goal.			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	0	No consequences	Major immediate consequences	10
						2.5	Minor consequences		
		7.5				Major future consequences			
		10				Major immediate consequences			
<b>2. Public Response</b>									
2.1	Population served by the project.	15	7.5		1	Less than 10%	Greater than 20%	7.5	
					5	Between 10% to 20%			
					7.5	Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?		15		5	0	Majority opposition	Majority support	5
				1		Minority opposition			
				5		Majority support			
				2.5		Minority support			

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?		2.5	0	Majority opposition	Majority support	2.5
				0.5	Minority opposition		
				2.5	Majority support		
				1.5	Minority support		
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?		7.5	0	No direct revenue	Direct revenue is not sufficient to meet O&M costs	2.5
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Additional investment in the area and increased wealth for citizens	5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2			5	5	Yes	Yes	5



Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?			0	No		
5.3	Will the project get approval from higher levels of Government?		5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4	Ease of implementation of project in respect of technical design?		5	1	Difficult	Standard	3
				3	Standard		
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O&M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i.e. feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>86.5</b>

Project ID:

03-15-01-06-01

Project Description :

Construction of Underground Water Storage Tank

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Significant contribution	10		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Major contribution to key development goal.	10	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	10	Major contribution to key development goal.	Major immediate consequences	10
						0	No consequences		
						2.5	Minor consequences		
		7.5				Major future consequences			
2.1	Population served by the project.	15			7.5	10	Major immediate consequences	Majority support	5
						1	Minority support		
			5			Majority support			
			2.5		Minority support				
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?		15		5	0	Majority opposition	Majority support	5
				1		Minority opposition			
				5		Majority support			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?			15	5	1	Minority opposition	Majority support	5
						5	Majority support		
		2.5				Minority support			

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?		2.5	0	Majority opposition	Majority support	2.5
				0.5	Minority opposition		
				2.5	Majority support		
				1.5	Minority support		
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?		7.5	0	No direct revenue	Direct revenue is not sufficient to meet O&M costs	2.5
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Additional investment in the area and increased wealth for citizens	5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2			5	5	Yes	Yes	5

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?			0	No		
5.3	Will the project get approval from higher levels of Government?		5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4	Ease of implementation of project in respect of technical design?		5	1	Difficult	Standard	3
				3	Standard		
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O&M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i.e. feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>86.5</b>

**Project ID:** 03-15-02-02-01  
**Project Description :** Improvement of Existing Sewerage System and Disposal Stations for Vehari City

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score	
<b>1. Project Purpose &amp; Service Delivery Improvement</b>								
1.1	Does the project fill a gap in a wider system of service delivery?	<b>30</b>	10	2.5	Minor contribution	Significant contribution	<b>10</b>	
				7.5	Major contribution			
				10	Significant contribution			
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		10	10	0	No contribution.	Major contribution to key development goal.	<b>10</b>
					2.5	Indirect contribution.		
					7.5	Minor direct contribution		
				10	10	Major contribution to key development goal.		
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?		10	10	0	No consequences	Major immediate consequences	<b>10</b>
					2.5	Minor consequences		
		7.5			Major future consequences			
		10			Major immediate consequences			
<b>2. Public Response</b>								
2.1	Population served by the project.	<b>15</b>	7.5	1	Less than 10%	Greater than 20%	<b>7.5</b>	
				5	Between 10% to 20%			
				7.5	Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media, or business organizations?		5	5	0	Majority opposition	Majority support	<b>5</b>
					1	Minority opposition		
					5	Majority support		
			2.5	Minority support				
2.3		2.5	2.5	0	Majority opposition	Majority support	<b>2.5</b>	
				0.5	Minority opposition			

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
	Is there support or opposition from residents in the immediate vicinity of the new facility?			2.5	Majority support				
				1.5	Minority support				
<b>3. Environmental Impact</b>									
3.1	The impact of the proposed project on the quality of local environment (e.g., Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10		
				5	Neutral				
				10	Positive effects on the quality of the local environment				
<b>4. Socio-Economic Impact</b>									
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	No direct revenue	0		
								2.5	Direct revenue is not sufficient to meet O&M costs
								5	Revenue meets O&M costs
								7.5	Revenue exceeds O&M costs
4.2	Are there indirect economic benefits from this project in the long term, e.g., employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Additional investment in the area and increased wealth for citizens	5		
								2.5	Little or no long-term economic development benefits
								5	Additional investment in the area and increased wealth for citizens
								7.5	Significant competitive advantage to industry and boost to the local economy
<b>5. Ease of Implementation</b>									
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10		
								0	No
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?		5	5	5	Yes	Yes	5	
									0
5.3	Will the project get approval from higher levels of Government?		5	5	1	Difficult	Easy	5	
									2.5

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score	
				5	Easy			
5.4	Ease of implementation of project in respect of technical design?			5	1	Difficult	Standard	3
					3	Standard		
					5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?			5	0	Outside expertise needed for construction, O&M	Outside expertise needed for construction phase only	1
					1	Outside expertise needed for construction phase only		
					3	Outside expertise needed for preparation phase i.e., feasibility studies		
		5			No outside expertise needed			
<b>Total Achieved Score</b>							<b>84</b>	

**Project ID:** 03-15-04-03-01

**Project Description :** Replacement of LED lights in Vehari City

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score	
<b>1. Project Purpose &amp; Service Delivery Improvement</b>								
1.1	Does the project fill a gap in a wider system of service delivery?	<b>30</b>	10	2.5	Minor contribution	Major contribution	<b>7.5</b>	
				7.5	Major contribution			
				10	Significant contribution			
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		10	10	0	No contribution.	Indirect contribution.	<b>2.5</b>
					2.5	Indirect contribution.		
					7.5	Minor direct contribution		
				10	10	Major contribution to key development goal.		
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?		10	10	0	No consequences	Minor consequences	<b>2.5</b>
					2.5	Minor consequences		
		7.5			Major future consequences			
		10			Major immediate consequences			
<b>2. Public Response</b>								
2.1	Population served by the project.	<b>15</b>	7.5	1	Less than 10%	Between 10% to 20%	<b>5</b>	
				5	Between 10% to 20%			
				7.5	Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media, or business organizations?		5	5	0	Majority opposition	Majority support	<b>5</b>
					1	Minority opposition		
					5	Majority support		
				2.5	2.5	Minority support		
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?		2.5	2.5	0	Majority opposition	Majority support	<b>2.5</b>
					0.5	Minority opposition		
		2.5			Majority support			
		1.5			Minority support			



Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g., Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	No direct revenue	0
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g., employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Little or no long-term economic development benefits	2.5
				2.5	Little or no long-term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Standard	2.5
				2.5	Standard		
				5	Easy		
5.4	Ease of implementation of project in respect of technical design?	30	5	1	Difficult	Standard	3
				3	Standard		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O&M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i.e., feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>59</b>

**Project ID:** 03-15-05-04-01

**Project Description :** Improvement and Rehabilitation of Bus Stand

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Indirect contribution.	2.5	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	0	No consequences	Minor consequences	2.5
						2.5	Minor consequences		
						7.5	Major future consequences		
						10	Major immediate consequences		
<b>2. Public Response</b>									
2.1	Population served by the project.	15			7.5	1	Less than 10%	Greater than 20%	7.5
			5			Between 10% to 20%			
			7.5			Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media, or business organizations?		15		5	0	Majority opposition	Majority support	5
				1		Minority opposition			
				5		Majority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?			15	2.5	2.5	Minority support	Majority support	2.5
						0	Majority opposition		
						0.5	Minority opposition		
						2.5	Majority support		
						1.5	Minority support		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g., Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Neutral	5
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	Revenue exceeds O&M costs	7.5
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g., employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Additional investment in the area and increased wealth for citizens	5
				2.5	Little or no long-term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4	Ease of implementation of project in respect of technical design?	30	5	1	Difficult	Easy	5
				3	Standard		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O&M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i. e., feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>71</b>

**Project ID:** 03-15-05-01-01

**Project Description :** Improvement & Rehabilitation of Parks

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Indirect contribution.	2.5	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	0	No consequences	Minor consequences	2.5
						2.5	Minor consequences		
						7.5	Major future consequences		
		10				Major immediate consequences			
<b>2. Public Response</b>									
2.1	Population served by the project.	15			7.5	1	Less than 10%	Between 10% to 20%	5
			5			Between 10% to 20%			
			7.5			Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media, or business organizations?		15		5	0	Majority opposition	Majority support	5
				1		Minority opposition			
				5		Majority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?			15	2.5	2.5	Minority support	Majority support	2.5
						0	Majority opposition		
						0.5	Minority opposition		
		2.5				Majority support			
						1.5	Minority support		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g., Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	No direct revenue	2.5
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g., employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Little or no long-term economic development benefits	2.5
				2.5	Little or no long-term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Standard	5
				2.5	Standard		
				5	Easy		
5.4	Ease of implementation of project in respect of technical design?	30	5	1	Difficult	Easy	5
				3	Standard		
				5	Easy		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O&M	Outside expertise needed for construction phase only	5
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i.e. , feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>70</b>



**Project ID:** 03-15-05-06-01

**Project Description :** Rehabilitation of slaughterhouse

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Indirect contribution.	2.5	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	0	No consequences	Minor consequences	2.5
						2.5	Minor consequences		
						7.5	Major future consequences		
		30			10	10	Major immediate consequences		
<b>2. Public Response</b>									
2.1	Population served by the project.		15		7.5	1	Less than 10%	Between 10% to 20%	5
						5	Between 10% to 20%		
				7.5		Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media, or business organizations?			15	5	0	Majority opposition	Majority support	5
						1	Minority opposition		
		5				Majority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?	15			2.5	2.5	Minority support	Majority support	2.5
						0	Majority opposition		
						0.5	Minority opposition		
			15		2.5	2.5	Majority support	Majority support	2.5
				2.5	1.5	1.5	Minority support	Majority support	2.5

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g., Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	Direct revenue is not sufficient to meet O&M costs	2.5
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g., employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Little or no long-term economic development benefits	2.5
				2.5	Little or no long-term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Standard	2.5
				2.5	Standard		
				5	Easy		
5.4	Ease of implementation of project in respect of technical design?	30	5	1	Difficult	Standard	3
				3	Standard		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O&M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i. e., feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>61.5</b>

**Project ID:** 03-15-06-04-01

**Project Description :** Solarization of the municipal buildings

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score	
<b>1. Project Purpose &amp; Service Delivery Improvement</b>								
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5	
				7.5	Major contribution			
				10	Significant contribution			
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?			10	0	No contribution.	Major contribution to key development goal.	10
			2.5		Indirect contribution.			
			7.5		Minor direct contribution			
			10	Major contribution to key development goal.				
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc. ?			10	0	No consequences	Minor consequences	2.5
			2.5		Minor consequences			
		7.5	Major future consequences					
		10	Major immediate consequences					
<b>2. Public Response</b>								
2.1	Population served by the project.	15	7.5	1	Less than 10%	Less than 10%	1	
				5	Between 10% to 20%			
				7.5	Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?			5	0	Majority opposition	Majority support	5
			1		Minority opposition			
			5		Majority support			
			2.5		Minority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?			2.5	0	Majority opposition	Majority support	2.5
			0.5		Minority opposition			
		2.5	Majority support					
		1.5	Minority support					

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	Revenue exceeds O&M costs	7.5
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Significant competitive advantage to industry and boost to the local economy	7.5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4	Ease of implementation of project in respect of technical design?	30	5	1	Difficult	Easy	5
				3	Standard		
				5	Easy		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction , O&M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i.e. feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>79.5</b>

**Project ID:** 03-15-01-01-02

**Project Description :** Solarization of Tubewells and Water Supply System

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Major contribution to key development goal.	10	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc. ?			30	10	0	No consequences	Minor consequences	2.5
						2.5	Minor consequences		
						7.5	Major future consequences		
		10				Major immediate consequences			
<b>2. Public Response</b>									
2.1	Population served by the project.	15			7.5	1	Less than 10%	Less than 10%	1
			5			Between 10% to 20%			
			7.5			Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?		15		5	0	Majority opposition	Majority support	5
				1		Minority opposition			
				5		Majority support			
				2.5		Minority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?			15	2.5	0	Majority opposition	Majority support	2.5
						0.5	Minority opposition		
		2.5				Majority support			
		1.5				Minority support			

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	Revenue exceeds O&M costs	7.5
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Significant competitive advantage to industry and boost to the local economy	7.5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4	Ease of implementation of project in respect of technical design?	30	5	1	Difficult	Easy	5
				3	Standard		
				5	Easy		



Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction , O&M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i.e. feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>79.5</b>

**Project ID:** 03-15-04-01-01

**Project Description :** Improvement and Rehabilitation of Jinnah Road, Zoo Road & Gol Chowk in MC Vehari Package-I

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Major contribution to key development goal.	10	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	0	No consequences	Major future consequences	7.5
						2.5	Minor consequences		
						7.5	Major future consequences		
		10				Major immediate consequences			
<b>2. Public Response</b>									
2.1	Population served by the project.	15			7.5	1	Less than 10%	Between 10% to 20%	5
			5			Between 10% to 20%			
			7.5			Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?		15		5	0	Majority opposition	Majority support	5
				1		Minority opposition			
				5		Majority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?			15	2.5	0	Majority opposition	Majority support	2.5
						0.5	Minority opposition		
						2.5	Majority support		
		1.5				Minority support			

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	No direct revenue	0
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Significant competitive advantage to industry and boost to the local economy	7.5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4		30	5	1	Difficult	Easy	5

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
	Ease of implementation of project in respect of technical design?			3	Standard		
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O &M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
		3		Outside expertise needed for preparation phase i.e. feasibility studies			
		5		No outside expertise needed			
<b>Total Achieved Score</b>							<b>81</b>

Project ID:

03-15-04-01-02

Project Description :

"Improvement and Rehabilitation of Sharqi Colony Road & Seed Farm  
in Vehari Package-II"

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Major contribution to key development goal.	10	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	0	No consequences	Major future consequences	7.5
						2.5	Minor consequences		
						7.5	Major future consequences		
		10				Major immediate consequences			
<b>2. Public Response</b>									
2.1	Population served by the project.	15			7.5	1	Less than 10%	Between 10% to 20%	5
			5			Between 10% to 20%			
			7.5			Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?		15		5	0	Majority opposition	Majority support	5
				1		Minority opposition			
				5		Majority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?			15	2.5	2.5	Minority support	Majority support	2.5
						0	Majority opposition		
						0.5	Minority opposition		
		1.5				Minority support			

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	No direct revenue	0
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Significant competitive advantage to industry and boost to the local economy	7.5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4		30	5	1	Difficult	Easy	5

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
	Ease of implementation of project in respect of technical design?			3	Standard		
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O &M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
		3		Outside expertise needed for preparation phase i.e. feasibility studies			
		5		No outside expertise needed			
<b>Total Achieved Score</b>							<b>81</b>

**Project ID:** 03-15-04-01-03

**Project Description :** "Improvement and Rehabilitation of Muhammad Bakery Road in MC Vehari Package-III"

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Major contribution to key development goal.	10	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	0	No consequences	Major future consequences	7.5
						2.5	Minor consequences		
						7.5	Major future consequences		
		10				Major immediate consequences			
<b>2. Public Response</b>									
2.1	Population served by the project.	15			7.5	1	Less than 10%	Between 10% to 20%	5
			5			Between 10% to 20%			
			7.5			Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?		15		5	0	Majority opposition	Majority support	5
				1		Minority opposition			
				5		Majority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?			15	2.5	2.5	Minority support	Majority support	2.5
						0	Majority opposition		
						0.5	Minority opposition		
		1.5				Minority support			



Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	No direct revenue	0
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Significant competitive advantage to industry and boost to the local economy	7.5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4		30	5	1	Difficult	Easy	5

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
	Ease of implementation of project in respect of technical design?			3	Standard		
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O &M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i.e. feasibility studies		
		5	No outside expertise needed				
<b>Total Achieved Score</b>							<b>81</b>

**Project ID:** 03-15-04-01-04

**Project Description :**

"Improvement and Rehabilitation of of Railway Crossing to Canal Road & Club Road to Chungi No.6 and People Colony Road Vehari Package-IV"

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Major contribution to key development goal.	10	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	0	No consequences	Major future consequences	7.5
						2.5	Minor consequences		
						7.5	Major future consequences		
		10				Major immediate consequences			
<b>2. Public Response</b>									
2.1	Population served by the project.	15			7.5	1	Less than 10%	Between 10% to 20%	5
			5			Between 10% to 20%			
			7.5			Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?		15		5	0	Majority opposition	Majority support	5
				1		Minority opposition			
				5		Majority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?			15	2.5	0	Majority opposition	Majority support	2.5
						0.5	Minority opposition		
						2.5	Majority support		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
				1.5	Minority support		
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	No direct revenue	0
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Significant competitive advantage to industry and boost to the local economy	7.5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
5.4	Ease of implementation of project in respect of technical design?		5	1	Difficult	Easy	5
				3	Standard		
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O &M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i.e. feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>81</b>

**Project ID:** 03-15-04-01-05

**Project Description :** Rehabilitation of Roads

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score	
<b>1. Project Purpose &amp; Service Delivery Improvement</b>								
1.1	Does the project fill a gap in a wider system of service delivery?	<b>30</b>	10	2.5	Minor contribution	Major contribution	<b>7.5</b>	
				7.5	Major contribution			
				10	Significant contribution			
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		10	10	0	No contribution.	Major contribution to key development goal.	<b>10</b>
					2.5	Indirect contribution.		
					7.5	Minor direct contribution		
				10	10	Major contribution to key development goal.		
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?		10	10	0	No consequences	Major future consequences	<b>7.5</b>
					2.5	Minor consequences		
		7.5			Major future consequences			
		10			Major immediate consequences			
<b>2. Public Response</b>								
2.1	Population served by the project.	<b>15</b>	7.5	1	Less than 10%	Between 10% to 20%	<b>5</b>	
				5	Between 10% to 20%			
				7.5	Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?		5	5	0	Majority opposition	Majority support	<b>5</b>
					1	Minority opposition		
					5	Majority support		
				2.5	2.5	Minority support		
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?		2.5	2.5	0	Majority opposition	Majority support	<b>2.5</b>
					0.5	Minority opposition		
		2.5			Majority support			
		1.5			Minority support			

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	No direct revenue	0
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Significant competitive advantage to industry and boost to the local economy	7.5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4		30	5	1	Difficult	Easy	5

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
	Ease of implementation of project in respect of technical design?			3	Standard		
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction, O &M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
		3		Outside expertise needed for preparation phase i.e. feasibility studies			
		5		No outside expertise needed			
<b>Total Achieved Score</b>							<b>81</b>



**Project ID:** 03-15-02-02-02

**Project Description :** Solarization of Tubewells and Disposal Stations in Vehari City

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score		
<b>1. Project Purpose &amp; Service Delivery Improvement</b>									
1.1	Does the project fill a gap in a wider system of service delivery?	30	10	2.5	Minor contribution	Major contribution	7.5		
				7.5	Major contribution				
				10	Significant contribution				
1.2	Whether the project will contribute to Sectoral Plan / City Master Plan?		30	10	0	No contribution.	Major contribution to key development goal.	10	
					2.5	Indirect contribution.			
					7.5	Minor direct contribution			
1.3	Whether the deference/ delay of the project is going to affect citizens' health, safety, property, prosperity etc.?			30	10	10	Major contribution to key development goal.	Minor consequences	2.5
						0	No consequences		
						2.5	Minor consequences		
		7.5				Major future consequences			
						10	Major immediate consequences		
<b>2. Public Response</b>									
2.1	Population served by the project.	15	7.5		1	Less than 10%	Less than 10%	1	
					5	Between 10% to 20%			
					7.5	Greater than 20%			
2.2	Is there support or opposition for the project from NGO's, community groups, network, media or business organizations?		15	5	0	Majority opposition	Majority support	5	
					1	Minority opposition			
					5	Majority support			
					2.5	Minority support			
2.3	Is there support or opposition from residents in the immediate vicinity of the new facility?			15	2.5	0	Majority opposition	Majority support	2.5
						0.5	Minority opposition		
		2.5				Majority support			

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
				1.5	Minority support		
<b>3. Environmental Impact</b>							
3.1	The impact of the proposed project on the quality of local environment (e.g. Air quality, Water pollution, Waste reduction, etc.	10	10	0	Negative effects on quality of the local environment	Positive effects on the quality of the local environment	10
				5	Neutral		
				10	Positive effects on the quality of the local environment		
<b>4. Socio-Economic Impact</b>							
4.1	Will the project bring in direct revenue?	15	7.5	0	No direct revenue	Revenue exceeds O&M costs	7.5
				2.5	Direct revenue is not sufficient to meet O&M costs		
				5	Revenue meets O&M costs		
				7.5	Revenue exceeds O&M costs		
4.2	Are there indirect economic benefits from this project in the long term, e.g. employment creation, investment generation, increase in land/property prices, reduction in citizens' expenditures, etc.?	15	7.5	0	Negative impact on the local economy	Significant competitive advantage to industry and boost to the local economy	7.5
				2.5	Little or no long term economic development benefits		
				5	Additional investment in the area and increased wealth for citizens		
				7.5	Significant competitive advantage to industry and boost to the local economy		
<b>5. Ease of Implementation</b>							
5.1	Has land been acquired for the project (If required)?	30	10	10	Yes	Yes	10
				0	No		
5.2	Has funding been secured/allocated within the Local Government budget or whether the external sources of funding have been secured?	30	5	5	Yes	Yes	5
				0	No		
5.3	Will the project get approval from higher levels of Government?	30	5	1	Difficult	Easy	5
				2.5	Standard		
				5	Easy		
5.4		30	5	1	Difficult	Easy	5

Index	Question	Index Weight	Question Weight	Sub Weight	Possible Responses	Selected Response	Achieved Score
	Ease of implementation of project in respect of technical design?			3	Standard		
				5	Easy		
5.5	Is there a capable system in place to implement and operate this project or is external support needed?		5	0	Outside expertise needed for construction , O&M	Outside expertise needed for construction phase only	1
				1	Outside expertise needed for construction phase only		
				3	Outside expertise needed for preparation phase i.e. feasibility studies		
				5	No outside expertise needed		
<b>Total Achieved Score</b>							<b>79.5</b>

## Annexure D. Environmental and Social Considerations in IDAMP<sup>3</sup>

### Section 1: Policy, Legal and Administrative Framework

This section provides an overview of the policy framework and national legislation that applies to the proposed project. The project is expected to comply with all national/provincial legislation regulations, EPA guidelines, World Bank Operational Policies and guidelines which are relevant and applicable to the sub-project.

#### 1.1. Punjab Environment Protection Act 1997 (Amended 2012 & 2017)

Under Section 12 (and subsequent amendment in 2012 and then in 2017) of the PEPA (1997):

*“a project falling under any category specified in Schedule I of the IEE/EIA Regulations 2022 requires the proponent of the project to file an IEE with the concerned provincial EPA while projects falling under any category specified in Schedule II require the proponent to file an EIA with the provincial agency, which is responsible for its review and accordance of approval or request any additional information deemed necessary”*

In compliance of local legal framework, development of IEE/EIA reports and subsequent approval from the competent forums shall be mandatory for all new infrastructure projects.

#### Regulatory Clearances, Punjab EPA

In accordance with provincial regulatory requirements, an IEE/EIA satisfying the requirements of the Punjab Environmental Protection Act (amended 2012&2017) will be marked cleared by Punjab-EPA and No Objection Certificate (NOC) will be issued for it. MCs will ensure to obtain NOCs/approval from the competent forums before the execution of new infrastructure development projects.

---

<sup>3</sup> The Environmental & Social Considerations have been provided by the Environment & Social Management (E&SM) team of PMDFC.

### **1.2. Guidelines for Environmental Assessment, Pakistan EPA**

The Pak-EPA has published a set of environmental guidelines for conducting environmental assessments and the environmental management of different types of development projects. The guidelines that are relevant to the proposed projects are listed below:

- Guidelines for the Preparation and Review of Environmental Reports, Pakistan, EPA 1997.
- Guidelines for Public Consultations; Pakistan EPA May 1997

These guidelines have been adopted by the Punjab Environment Protection Agency after 18<sup>th</sup> amendment.

### **1.3. Punjab Environmental Quality Standards (PEQS)**

The Punjab Environmental Quality Standards (PEQS), 2016 specify the following standards:

1. Punjab Environment Quality Standards for Drinking Water, 2016
2. Punjab Environment Quality Standards for Ambient Air, 2016
3. Punjab Environment Quality Standards for Noise, 2016
4. Punjab Environment Quality Standards for Municipal and Liquid Industrial Effluents, 2016

32 parameters of PEQs for drinking water shall be applicable to all water supply schemes/ projects/ subprojects (rehabilitation and new). PEQs for ambient air shall be applicable during rehabilitation or new construction of infrastructure development projects to analyze the emissions that may emerge from construction work machinery/equipment's. PEQs for noise shall also be applicable during rehabilitation or new construction of infrastructure development projects to analyze the emissions that may emerge from construction work machinery/equipment. PEQs for municipal and liquid waste shall be applicable to determine the quality of municipal wastewater where wastewater is to be treated.

#### 1.4. Other Environment Related Legislations:

Sr. #	Act	Description	Applicability to sub-project
1.	Punjab Environment Protection Act, 1997 (as amended up to 2017)	The Act establishes the Environmental Protection Agency that deals with the preparation of national environmental policies, prepare & publish national environment report, ensure the enforcement of National Environmental Quality Standards, establishment of ambient air, water and land quality standards, measures to control environmental pollution. Additionally, under this Act, no proponent of a project shall commence construction or operation unless he has filed with the Provincial Agency an initial environmental examination or, where the project is likely to cause an adverse environmental effect, an Environmental Impact Assessment (EIA/ESIA), and has obtained from the approval in respect thereof.	Section 11,12,13 and 14 of PEPA, 2012 shall be applicable to all the new infrastructure projects.
2.	Punjab Environment Protection Review of IEE/EIA Regulations 2022	Provided that the proponent shall file an Initial Environmental Examination or Environmental Impact Assessment, if the project is likely to cause an adverse environmental impact	<ul style="list-style-type: none"> <li>These regulations have two schedules I &amp; II. As per schedule I the subprojects require submission of IEE report have to be prepared and as per schedule II the EIA of Subproject will be carried out.</li> </ul>

Sr. #	Act	Description	Applicability to sub-project																	
			<p>The sector wise screening of MCs subprojects as per Punjab Environment protection review of IEE/EIA regulations 2000 are given below in Table.</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="background-color: #FFD700;">Schedule</th> <th style="background-color: #FFD700;">Sector</th> <th style="background-color: #FFD700;">Clause</th> </tr> </thead> <tbody> <tr> <td rowspan="4" style="text-align: center; vertical-align: middle;">Schedule I</td> <td style="text-align: center;">Stormwater Drainage</td> <td>F. Water management, dams, irrigation and flood protection 1. Small Dams and reservoirs 2. Irrigation and drainage projects</td> </tr> <tr> <td style="text-align: center;">Water supply</td> <td>G. Water Supply and Treatment Water supply schemes and treatment plants with total cost less than Rs. 50 million</td> </tr> <tr> <td style="text-align: center;">Parks</td> <td>I. Urban development and tourism  5. Urban development projects</td> </tr> <tr> <td style="text-align: center;">Waste</td> <td>H. Waste disposal Non-hazardous scrap yard / warehouse</td> </tr> <tr> <td style="text-align: center;">Schedule II</td> <td style="text-align: center;">Water supply, Sewerage System and treatment</td> <td>F. Water supply, Sewerage System and treatment Water supply schemes and treatment plants (excluding the Reverse</td> </tr> </tbody> </table>			Schedule	Sector	Clause	Schedule I	Stormwater Drainage	F. Water management, dams, irrigation and flood protection 1. Small Dams and reservoirs 2. Irrigation and drainage projects	Water supply	G. Water Supply and Treatment Water supply schemes and treatment plants with total cost less than Rs. 50 million	Parks	I. Urban development and tourism  5. Urban development projects	Waste	H. Waste disposal Non-hazardous scrap yard / warehouse	Schedule II	Water supply, Sewerage System and treatment	F. Water supply, Sewerage System and treatment Water supply schemes and treatment plants (excluding the Reverse
Schedule	Sector	Clause																		
Schedule I	Stormwater Drainage	F. Water management, dams, irrigation and flood protection 1. Small Dams and reservoirs 2. Irrigation and drainage projects																		
	Water supply	G. Water Supply and Treatment Water supply schemes and treatment plants with total cost less than Rs. 50 million																		
	Parks	I. Urban development and tourism  5. Urban development projects																		
	Waste	H. Waste disposal Non-hazardous scrap yard / warehouse																		
Schedule II	Water supply, Sewerage System and treatment	F. Water supply, Sewerage System and treatment Water supply schemes and treatment plants (excluding the Reverse																		

Sr. #	Act	Description	Applicability to sub-project	
				<p>Osmosis, Ultra filtration and such like) with total cost more than Rs. 50 million</p> <p>2. Wastewater channels / Sewerage System Schemes</p> <p>3. Combined Wastewater Treatment Plants with treatment capacity greater than 100m<sup>3</sup>/hr</p>
			Waste Storage and Disposal	<p>G. Waste Storage and Disposal</p> <p>1. Landfill sites</p> <p>2. Waste Incinerators and autoclaves</p> <p>3. Hazardous substance or waste storage warehouse</p>
3.	Delegations of power for Environment Approvals Rule 2017	According to these rules the powers of environmental approval are delegated to commissioner for specific types of projects	<ul style="list-style-type: none"> <li>• Under PCP the clause of h, n and o are applicable.</li> <li>• clause h Construction of roads fallings within the jurisdiction of a district, expecting highways, expressways and motorways</li> <li>• Clause o solid waste management excepting landfills</li> <li>• Clause p water supply schemes /water purifications plants costing upto Rs. 20,000/-</li> </ul>	



Sr. #	Act	Description	Applicability to sub-project
4.	Notification No. SOG/EPD/5-86/2019 delegation of powers to Deputy Commissioner	According to this notification the powers of environmental approval are delegated to deputy commissioner for specific types of projects	Under PCP clause g is applicable Bus and Wagon stands od category C with area upto 8 kanal.
3.	Pakistan Penal Code, 1860	The Code deals with the offences where public or private property or human lives are affected due to intentional or accidental misconduct of an individual or organization. The Code also addresses control of noise, noxious emissions and disposal of effluents.	The provisions of the Penal Code, 1860 are applicable to the project in terms of penalties for effecting human lives and public property. It also addresses the control of noise, air emissions and effluent disposal.
4.	Motor Vehicle Rules, 1969	It defines powers and responsibilities of Motor Vehicle Examiners (MVEs). The establishment of MVE inspection system is one of the regulatory measures that can be taken to tackle the ambient air quality problems associated with the vehicular emissions during operation phase.	This act is applicable to the gaseous emission that will be released from the vehicles in operation phase at machinery used during construction phase of this subproject.
5.	The Land Acquisition Act, 1894	The Land Acquisition Act, 1894, is a "law for the acquisition of land needed for public purposes and for companies and for determining the amount of compensation to be paid on account of such acquisition".	This act will not be triggered as no land acquisition is required.
6.	The Punjab Land Acquisition Rules, 1983,	It describes the land acquisition procedure for public purposes or for a company.	This act will be triggered as wherever land to be acquired for subproject. Such as in Swerage project, Construction of

Sr. #	Act	Description	Applicability to sub-project
			Wastewater treatment plants, installation of new tube wells etc.
7.	Pakistan Antiquities Act 1975 and Punjab Antiquities Amendment Act 2012	<p>The Punjab Antiquities Amendment Act, 2012 is adopted from the Pakistan Antiquities Act of 1975 with a few minor changes. The Antiquities Act, 1975 (amended in 1990) states the following:</p> <ul style="list-style-type: none"> <li>• “Ancient” is any object that is at least 75 years old;</li> <li>• All accidental discoveries of artifacts must be reported to the Federal Department of Archaeology;</li> <li>• The Government is the owner of all buried antiquities discovered on any site, whether protected or otherwise;</li> <li>• All new construction within a distance of 200 feet from protected antiquities is forbidden;</li> <li>• No changes or repairs can be made to a protected monument, even if it is owned privately, without approval of the responsible authorities; and</li> </ul> <p>The cultural heritage laws of Pakistan are uniformly applicable to all categories of sites regardless of their</p>	The law will be applicable to the project due to its provision that if any accidental archaeological discoveries may occur during the excavation works for the construction of sub-projects.

Sr. #	Act	Description	Applicability to sub-project
		state of preservation and classification as monuments of national or world heritage.	
8.	Punjab Restriction of Employment of Children Act, 2016	According to the sub-section 11(a) of this Act, an occupier who employs or permits a child (person under the age of 15 years) to work in an establishment shall be liable to punishment with imprisonment for a term which may extend to six months, but which shall not be less than seven days, and a mandatory fine between 10,000 and 50,000 rupees.	The relevance of this act to the project will be to prohibit child employment for construction related activities of the proposed sub- project and it will be applicable throughout the construction activities related to subprojects.
9.	The Punjab Occupational Safety and Health Act, 2019	The Punjab Occupational Safety and Health Act, 2019 (IV of 2019) An Act to provide for occupational safety and health at workplace. It is necessary to make and consolidate the law for the occupational safety and health of the persons at workplace and to protect them against risks arising out of the occupational hazards; to promote safe and healthy working environment catering to the physiological and psychological needs of the employees at workplace and to provide for matters connected therewith or ancillary thereto.	The Punjab Occupational Safety and Health Act, 2019 relevant sections to the proposed projects are: 8. Safety and Health, 10. Consultation 13. Notification and investigation of accidents, dangerous occurrences and occupational illness. Adopting this Act, PMDFC has developed SOPs for health and safety of the labor (including women workers) and communities which will be applicable for all the infrastructure related activities of new or rehabilitation subprojects.

Sr. #	Act	Description	Applicability to sub-project
10	National Hazardous Waste Management Policy, 2022	A policy to facilitate the implementation of international treaties & Conventions on a national level to improve the definition & implementation of Hazardous Waste Management (HWM) for better environmental management, clarify institutional responsibilities related to HWM, and strengthen the management of hazardous & other wastes.	Policy measures shall be applicable whereas there is any risk of usage or generation of hazardous waste.
11	Protection Against Harassment of Women at the Workplace (Amended) Act, 2014	In this act major and minor penalties are mentioned.	This act is applicable for all the employees of MCs, LG&CDD and women labor (if involved for infrastructure development activities)
12	Punjab Labor Policy, 2018	Punjab Labor Policy, 2018 presents a policy document which directly addresses the child labor, bonded labor, gender discrimination, gender mainstreaming, labor protection, out of school children and lack of health facilities for the workers etc. Labor Policy of 2018 incorporates the key thematic areas regarding effective implementation of labor standards, social dialogue, improvements in workplace safety, living wages, awareness raising, excellence in labor inspections regime, imparting quality technical trainings through well-	This act is applicable for all the employees of MCs, LG&CDD and women labor (if involved for infrastructure development activities)

Sr. #	Act	Description	Applicability to sub-project
		<p>improved Training Centers, simplification of labor laws, medical facilities for secured workers even after retirement, establishment of labor colonies and schools for workers' children, improvement in the wage fixation process and strengthening the role of Punjab Minimum Wages Board, efficient disbursement of welfare grants and gradual extension of labor protection frame-work.</p>	
13	Punjab Local Government Act, 2019	<p>As per PLGA 2019 Functions of a Metropolitan Corporation, Municipal Corporation and Municipal Committee:</p> <p>Part I</p> <p>(g) Solid waste collection and disposal;</p> <p>(h) Sewerage collection and disposal including water management and treatment;</p> <p>(i) Building control and land use;</p> <p>(j) Births, deaths, marriages and divorce registration;</p> <p>(k) Museums and art galleries;</p> <p>(l) Open markets;</p> <p>(m) Livestock and agriculture markets;</p> <p>(n) Public parking facilities;</p> <p>(o) City roads and traffic management;</p>	<p>All the related clauses of this Act shall be applicable for MCs.</p>

Sr. #	Act	Description	Applicability to sub-project
		<p>(p) Public transport;</p> <p>(q) Abstraction of water for industrial and commercial purposes;</p> <p>(r) Emergency planning and relief;</p> <p>(s) Support to provincial agencies in prevention of crime and maintenance of public order; and</p> <p>(t) Regulatory enforcement in the functions assigned under Part 1 and 2 of this Schedule;</p> <p>Part 2</p> <p>(u) Establishment and management of pre-schools;</p> <p>(v) Libraries;</p> <p>(w) Drinking water supply;</p> <p>(x) Public convenances;</p> <p>(z) Children's services;</p> <p>(aa) Community safety;</p> <p>(bb) Arts and recreation;</p> <p>(cc) Public fairs and ceremonies;</p> <p>(dd) Sports;</p> <p>(ee) Environmental health, awareness and services;</p> <p>(ff) Parks and landscape development;</p> <p>(gg) Slaughtering of animals;</p>	

Sr. #	Act	Description	Applicability to sub-project
		(hh) Street lights; and (ii) Sign boards and street advertisements.	
14	Guidelines for Preparation and Review of Environment Reports, 1997	Guidelines for preparation and Review of Environmental Reports were issued by Pak EPA in 1997 under Pakistan Environment Protection Act, 1997 and are adopted by Punjab Environment protection Agency after 18 <sup>th</sup> Amendment. These guidelines describe the steps in IEE Preparation, format of IEE Reports, assessing impacts, mitigation and impact management, reporting, reviewing and decision making, monitoring and auditing and project management.	These guidelines shall be applicable during preparation and review of IEEs/EIAs of new infrastructure development projects.
15	Guidelines for Public Consultation, 1997	These guidelines address possible approaches to public consultation and techniques for designing an effective program of consultation that reaches all major stakeholders and ensures the incorporation of their concerns in any impact assessment study. The guidelines cover consultation, involvement, and participation of stakeholders; effective public consultation (planning, stages of an EIA where consultation is appropriate); and	Public consultation and citizens engagement is mandatory at projects planning and design phase and these guidelines shall be applicable for public consultation.

Sr. #	Act	Description	Applicability to sub-project
		facilitation of involvement (including the poor, women, and NGOs).	
16	Guidelines for Regulation of Disclosure of Environmental Information & Citizen Engagement 2020	<p>These guidelines give details about disclosure of environmental information. These guidelines have 2 parts:</p> <p>First part deals with Public Disclosure instructions regarding arrangement of public disclosure of environment information and maintenance of record in indexed form</p> <p>Second part is regarding Citizen Engagement, and it gives detailed information regarding citizen engagement and Grievance redress mechanism.</p>	<p>These guidelines will be applicable for public disclosure of environment related information of IEEs/EIAs or any other interventions that may cause any harm to the environment.</p>
17	Canal and Drainage Act 1873 and Amendment Act 2016	<p>The CDA focuses on construction and maintenance of drainage channels and defines powers to prohibit obstruction or order their removal. It also covers issues related to canal navigation. It briefly addresses issues relating to environmental pollution.</p> <p>Section 70(5) of the CDA clearly states that no one is allowed to “corrupt or foul the water of any canal so as to render it less fit for the purposes for which it is ordinarily used.”</p>	<p>This act shall be applicable for all the subprojects of MCs where untreated wastewater is being dispose off to the irrigation canals.</p>



Sr. #	Act	Description	Applicability to sub-project
		In addition, Section 73 of the CDA gives power to arrest without warrant or to be taken before the magistrate a person who has willfully damaged or obstructed the canal or “rendered it less useful.”	
18	Punjab Wildlife Protection, Conservation and Management Act, 1974	The Act requires the protection of wildlife species declared as endangered/threatened and rare. It gives protection to these species by declaring their natural living environment as protected and reserved, which includes areas such as national parks, wildlife sanctuaries, and game reserves.	This act shall be applicable in case any harm to wildlife is assessed at the stage of early screening or if there is any potential risk identified to the wildlife during or after execution of the subprojects/projects related to infrastructure development and municipal service delivery.
19	Guidelines and Checklists adopted by GOP after 18th Amendment	<p>Punjab EPA has also designed the following Guidelines/Checklists for IEE/EIA Projects:</p> <p>Check List for IEE (updated September 2020)</p> <p>Check List for EIA (updated September 2020)</p> <p>After 18<sup>th</sup> Amendment, Punjab EPA has adopted the following sectoral Guidelines that were prepared by other provinces and were earlier adopted by Pak EPA:</p> <ul style="list-style-type: none"> <li>✓ Poultry Farms</li> <li>✓ Urban Roads</li> <li>✓ Rural Schools</li> <li>✓ Housing Schemes</li> </ul>	<p>Checklists for IEE and EIA shall be applicable to all the new infrastructure development projects.</p> <p>Following Guidelines shall be applicable for MC’s municipal service delivery projects:</p> <ul style="list-style-type: none"> <li>✓ Urban Roads</li> <li>✓ Water Supply</li> <li>✓ Sanitation Schemes</li> <li>✓ Major Sewerage Schemes</li> </ul>

Sr. #	Act	Description	Applicability to sub-project
		<ul style="list-style-type: none"><li>✓ Petrol &amp; CNG</li><li>✓ Forest Road</li><li>✓ Forest Harvesting</li><li>✓ Water Supply</li><li>✓ Tourist Facilities</li><li>✓ Sanitation Schemes</li><li>✓ Major Chemicals and Manufacturing Plants</li><li>✓ Flour Mills</li><li>✓ Carpet Manufacturing</li><li>✓ Housing Estates and New Town Development</li><li>✓ Industrial Estate</li><li>✓ Major Roads</li><li>✓ Major Sewerage Schemes</li><li>✓ Stone Crushers</li><li>✓ Marble Units</li><li>✓ Oil &amp; Gas Exploration</li></ul>	

## Section 2: Environmental & Social Categorization

### 2.1. Environmental Screening and Categorization of Sub-Projects

Based upon the Screening Checklists, following table will be used to for environmental screening of the identified sub-projects/projects and further documentation requirements. This classification is preliminary and will be finalized when the exact locations and scale of the sub-projects are identified, and screening checklist will be filled in for each of the sub-project/project.

Sr. #	Project Categories	Type of Sub-projects	Nature of Environmental Issues	Env. Category	Social Category	Instruments Required
1.	<b>Waste Management</b>					
	<b>Solid Waste</b>	Collection Equipment, Collection Bins	Negligible environmental impacts	E3	S3	Applicability of PMDFC EHS SOPs for SWM Machinery/Equipment
	<b>Liquid Waste</b>	Sludge ponds	May have some negative but localized environmental and social impacts	E2	S2	ESMP
		Community septic tanks	May have some negative but localized environmental and social impacts	E2	S2	ESMP
		Vacuum Trucks, Vacuum Handcarts and others	Negligible environmental impacts	E3	S3	NA
	Construction of Waste Water Treatment Plants	May have significant environmental impacts	E1	S2/S1	IEE/EIA as per nature of impacts and Schedule I and II of PEPA Review of IEE/EIA Regulations 2022.	

Sr. #	Project Categories	Type of Sub-projects	Nature of Environmental Issues	Env. Category	Social Category	Instruments Required
<b>2.</b>	<b>Water Supply</b>					
		Water supply pumps / tube wells	May have negligible environmental impacts	E3	S3	NA
		Overhead reservoirs (OHRs)	May have negligible environmental impacts	E2	S2	ESMP
		Water Supply distribution network	May have some negative to significant environmental and social impacts depending upon the scope of work	E1 or E2	S1 or S2	ESMP for repair and maintenance of existing network or IEE/EIA for new sub-projects as per scope of work and environmental impacts and categorization given in Schedule I and II of PEPA Review of IEE/EIA Regulations 2000
<b>3.</b>	<b>Storm Water Drainage</b>					
	Urban drainage systems Open Drainage System Covered Drains		May have some negative to significant environmental and social impacts depending upon the scope of work	E1 or E2	S1 or S2	ESMP for repair and maintenance of existing systems or IEE/EIA for new sub-projects as per scope of work and environmental impacts and categorization given in Schedule I and II of PEPA Review of IEE/EIA Regulations 2000
	Flood control systems		May have some negative to significant environmental and social impacts depending upon the scope of work	E1 or E2	S2	ESMP for repair and maintenance of existing system or IEE/EIA for new sub-project as per scope of work and environmental impacts and

Sr. #	Project Categories	Type of Sub-projects	Nature of Environmental Issues	Env. Category	Social Category	Instruments Required
						categorization given in Schedule I and II of PEPA Review of IEE/EIA Regulations 2000
<b>4.</b>	<b>Connectivity</b>					
	Rehabilitation and maintenance of urban roads <sup>4</sup>		May have some negative but localized environmental and social impacts	E2	S2S	ESMP
	Pedestrian walkways, Bicycle paths		May have negligible environmental impacts	E2	S2	ESMP
	Streets and security lights, and road signs		May have negligible environmental impacts	E3	S3	NA
	Construction of Bus Workshops		May have some negative but localized environmental and social impacts	E2	S2	ESMP
	Rehabilitation of Bus Stands/Terminals <sup>5</sup>		May have negligible environmental impacts	E2	E2	ESMP
<b>5.</b>	<b>Social and Livability Infrastructure</b>					
	Urban greenery and public spaces		May have negligible environmental impacts	E2	S2	ESMP
	Construction of Community Parks <sup>6</sup>		May have some negative but localized environmental and social impacts	E2/E1	S2/S1	ESMP/IEE/EIA
	Rehabilitation /Maintenance of Community Parks		May have negligible environmental impacts	E2	S2	ESMP

4 After 18<sup>th</sup> Amendment, Punjab EPA has adopted the Checklists/Guidelines adopted by the Pakistan EPA (as it is). Punjab EPA has adopted Checklists/Guidelines developed by KPK and Balochistan for Small to medium water supply schemes, sanitation schemes, small and medium sized road construction and expansion in urban areas and construction and expansion of bus terminals. These Checklists/Guidelines will be used for the mentioned subprojects of PCP adopted by Punjab EPA

5 According to a notification by Punjab EPA vide No. Dir (EIA)/01/2017 dated 29-05-2017, Bus and Wagon stands of Category C with area upto 8 kanals, are exempted from IEE/EIA

6 Parks will be constructed on already allocated lands (for community parks) by Local Government



### Section 3: Budget Allocation

To carryout Environmental Assessment as per ESMF-PCP and PEPA, there is need to allocate budget in PC-I.

The IEE/EIA/ESMPs of each sub-project will be included in the bidding documents and the contracts. In this manner, the social and environmental management instruments will be included in the overall scope of works/services and BOQs, and the contractor will implement the mitigation measures included in the contracts alongside other works/services.

Activity	Budget Allocation (PKR)
<b>Environmental Impact Assessment (EIA)</b>	
Hiring of Environmental Consultant	100,0000-15,0000
Implementation of EIA	100,0000
EIA Submission fee	30,000
<b>Initial Environmental Examination (IEE)</b>	
Hiring of Environmental Consultant	500,000-800,000
Implementation of IEE	500,000- 700,000
IEE Submission fee	15, 000

#### **Section 4: Monitoring & Supervision**

Environment Focal Person (EFP) and Social Focal Point (SFP) and MCs of their respective region to monitor the contractor to ensure complete and proper implementation of the works/services in accordance with the contract. During this phase, environmental and social monitoring will be carried out to ensure that the mitigation measures given in the IEE/EIA/ESMPs are effectively implemented. The environmental and social monitoring will include the following:

- Environmental and social monitoring to ensure effective implementation of ESMPs and EMPs particularly the mitigation measures included in these documents.
- The monitoring will be conducted with the help of checklists prepared on the basis of the mitigation plans included in environmental and social management instruments.
- Laboratory analysis will be conducted if specified in the ESMPs.
- Photographic records will be maintained where applicable/useful.
- Preparation of monitoring reports.



## Annexure E. Project Appraisal

**Project ID:** 03-15-04-03-01

**Project Description :** Replacement of LED lights in Vehari City

Sr. No.	Description	Unit	Value	Remarks
1	Net Present Value (NPV)	Rs.	109	NPV=PV of benefits @ 22.32% - PV of costs @ 22.32%
2	Financial Internal Rate of Return (FIRR)	%	78%	FIRR
3	Benefit Cost Ratio (BCR)	Ratio	135.12	BCR= Total Benefits ÷ Total Costs
4	Payback Period	Years	5	PBP= Capital costs ÷ Annual Net Benefits

Year No.	Year	Costs			Benefits				Net (Cost)/ Benefits	PV @ % 22.32	
		Capital Cost	O&M Cost	Total Cost	Cost saving to society	Direct Revenue	Cost Savings/ Reduction	Total Benefits		Discount Factor	PV
		A	B	C=A+B	D	E	F	G=D+E+F		H=G-C	I=(1.22.32)^n
0	2023-2024	17.80	-	18	-	-	-	(18)	1	(18)	
1	2024-2025	-	-	-	-	11.04	11	11	0.82	9	
2	2025-2026	-	-	-	-	12.82	13	13	0.67	9	
3	2026-2027	-	-	-	-	14.89	15	15	0.55	8	
4	2027-2028	-	-	-	-	17.28	17	17	0.45	8	
5	2028-2029	-	-	-	-	20.07	20	20	0.37	7	
6	2029-2030	-	-	-	-	23.31	23	23	0.30	7	
7	2030-2031	-	-	-	-	27.06	27	27	0.24	7	
8	2031-2032	-	-	-	-	31.43	31	31	0.20	6	
9	2032-2033	-	-	-	-	36.49	36	36	0.16	6	
10	2033-2034	-	-	-	-	42.37	42	42	0.13	6	
11	2034-2035	-	-	-	-	49.20	49	49	0.11	5	
12	2035-2036	-	-	-	-	57.14	57	57	0.09	5	
13	2036-2037	-	-	-	-	66.35	66	66	0.07	5	
14	2037-2038	-	-	-	-	77.04	77	77	0.06	5	
15	2038-2039	-	-	-	-	89.46	89	89	0.05	4	
16	2039-2040	-	-	-	-	103.88	104	104	0.04	4	
17	2040-2041	-	-	-	-	120.63	121	121	0.03	4	
18	2041-2042	-	-	-	-	140.07	140	140	0.03	4	
19	2042-2043	-	-	-	-	162.65	163	163	0.02	4	
20	2043-2044	-	-	-	-	188.87	189	189	0.02	3	
21	2044-2045	-	-	-	-	219.32	219	219	0.01	3	
22	2045-2046	-	-	-	-	254.67	255	255	0.01	3	
23	2046-2047	-	-	-	-	295.73	296	296	0.01	3	
24	2047-2048	-	-	-	-	343.40	343	343	0.01	3	
25	2048-2049	-	-	-	-	-	-	-	0.01	-	
Total		18	-	18	-	-	2,405	2,405	2,387	109	

### Assumptions for Financial Appraisal

#### **Costs:**

- 1 Capital cost of the Project incorporates both the initial one-off costs such as engineering cost, project construction cost, development cost, procurement cost of equipment, machinery & other assets, utility set up cost, and any other costs to be incurred during the construction period.
- 2 Operating and maintenance (O&M) cost shall be incurred during operational phases of the project. Operation and maintenance cost includes electricity and other utility cost, administrative expenses, maintenance cost, payroll cost and other overheads etc.
- 3 Inflation rate is taken for O&M costs @ 16.12%, which is average inflation of last 5 years.

#### **Benefits:**

- 4 Benefits include the potential saving in the opportunity cost of vehicles. Project would provide effective protection to the vehicles against the solar radiation and ultraviolet rays, rain, hail, wind, and dust, thereby slowing down the deterioration of vehicles and reducing the cost of maintenance.
- 5 Inflation rate is applied at cost savings @ 16.12%, which is average inflation of last 5 years.
- 6 Residual Value had been taken as nil.

#### **Estimated Project Life:**

- 7 The life estimates of assets are compiled after review of design criteria for MC assets and international best practices. The Life Estimates taken in IDAMP are as follow:

Asset	Useful Life
Buildings/ Civil Works	25
Tubewell Pumps	15
Disposal Pumps	15
OHR	50
Water Pipelines	25
Rising Mains/ Transmission Mains	25
Sewerage/ RCC Pipelines	25
Vehicles	10
Machinery & Equipment	15

#### **Macro-economic Indicators**

- 8 The discount rate used for computation of present value of cash flows is taken @ 22.32 % per anum, which is KIBOR prescribed by State Bank of Pakistan as at April 11, 2023.
- 9 Exchange rate is taken as 284.65 PKR/ USD as per Exchange Rates for Mark to Market Revaluation provided at State Bank of Pakistan at April 07, 2023.

**Project ID:** 03-15-01-06-01

**Project Description :** Construction of Underground Water Storage Tank

Sr. No.	Description	Unit	Value	Remarks
1	Net Present Value (NPV)	NPV=PV of benefits @ 22.32% - PV of costs @ 22.32%	Rs.	(208)
2	Financial Internal Rate of Return (FIRR)	FIRR	%	14%
3	Benefit Cost Ratio (BCR)	BCR= Total Benefits ÷ Total Costs	Ratio	2.17
4	Payback Period	PBP= Capital costs ÷ Annual Net Benefits	Years	7.25

Year No.	Year	Costs			Benefits				Net (Cost)/ Benefits	PV @ % 22.32	
		Capital Cost	O&M Cost	Total Cost	Cost saving to society	Direct Revenue	Cost Savings/ Reduction	Total Benefits		Discount Factor	PV
		A	B	C=A+B	D	E	F	G=D+E+F		H=G-C	I=(1.22.32)^n
0	2023-2024	125.00		125				-	(125)	1	(125)
1	2024-2025	250.00		250	27.50			28	(223)	0.82	(182)
2	2025-2026	125.00	12.50	138	31.93			32	(106)	0.67	(71)
3	2026-2027		14.52	15	37.08			37	23	0.55	12
4	2027-2028		16.85	17	43.06			43	26	0.45	12
5	2028-2029		19.57	20	50.00			50	30	0.37	11
6	2029-2030		22.73	23	58.06			58	35	0.30	11
7	2030-2031		26.39	26	67.42			67	41	0.24	10
8	2031-2032		30.64	31	78.29			78	48	0.20	10
9	2032-2033		35.58	36	90.91			91	55	0.16	9
10	2033-2034		41.32	41	105.56			106	64	0.13	9
11	2034-2035		47.98	48	122.58			123	75	0.11	8
12	2035-2036		55.72	56	142.33			142	87	0.09	8
13	2036-2037		64.70	65	165.28			165	101	0.07	7
14	2037-2038		75.13	75	191.92			192	117	0.06	7
15	2038-2039		87.24	87	222.86			223	136	0.05	7
16	2039-2040		101.30	101	258.78			259	157	0.04	6
17	2040-2041		117.63	118	300.50			301	183	0.03	6
18	2041-2042		136.59	137	348.94			349	212	0.03	6
19	2042-2043		158.61	159	405.19			405	247	0.02	5
20	2043-2044		184.18	184	470.51			471	286	0.02	5
21	2044-2045		213.87	214	546.35			546	332	0.01	5
22	2045-2046		248.34	248	634.42			634	386	0.01	5
23	2046-2047		288.37	288	736.69			737	448	0.01	4
24	2047-2048		334.86	335	855.45			855	521	0.01	4
25	2048-2049		388.84	389	993.35			993	605	0.01	4
26	2049-2050			-					-	0.01	-
Total		500	2,723	3,223	6,985	-	-	6,985	3,761		(208)

### Assumptions for Financial Appraisal

#### **Costs:**

- 1 Capital cost of the Project incorporates both the initial one-off costs such as engineering cost, project construction cost, development cost, procurement cost of equipment, machinery & other assets, utility set up cost, and any other costs to be incurred during the construction period.
- 2 Operating and maintenance (O&M) cost shall be incurred during operational phases of the project. Operation and maintenance cost includes electricity and other utility cost, administrative expenses, maintenance cost, payroll cost and other overheads etc.
- 3 Inflation rate is taken for O&M costs @ 16.12%, which is average inflation of last 5 years.

#### **Benefits:**

- 4 Benefits include the potential saving in the opportunity cost of vehicles. Project would provide effective protection to the vehicles against the solar radiation and ultraviolet rays, rain, hail, wind, and dust, thereby slowing down the deterioration of vehicles and reducing the cost of maintenance.
- 5 Inflation rate is applied at cost savings @ 16.12%, which is average inflation of last 5 years.
- 6 Residual Value had been taken as nil.

#### **Estimated Project Life:**

- 7 The life estimates of assets are compiled after review of design criteria for MC assets and international best practices. The Life Estimates taken in IDAMP are as follow:

Asset	Useful Life
Buildings/ Civil Works	25
Tubewell Pumps	15
Disposal Pumps	15
OHR	50
Water Pipelines	25
Rising Mains/ Transmission Mains	25
Sewerage/ RCC Pipelines	25
Vehicles	10
Machinery & Equipment	15

#### **Macro-economic Indicators**

- 8 The discount rate used for computation of present value of cash flows is taken @ 22.32 % per annum, which is KIBOR prescribed by State Bank of Pakistan as at April 11, 2023.
- 9 Exchange rate is taken as 284.65 PKR/ USD as per Exchange Rates for Mark to Market Revaluation provided at State Bank of Pakistan at April 07, 2023.

**Project ID:** 03-15-06-04-01

**Project Description :** Solarization of the municipal buildings

Sr. No.	Description	Unit	Value	Remarks
1	Net Present Value (NPV)	NPV=PV of benefits @ 22.32% - PV of costs @ 22.32%	Rs.	453
2	Financial Internal Rate of Return (FIRR)	FIRR	%	37%
3	Benefit Cost Ratio (BCR)	BCR= Total Benefits ÷ Total Costs	Ratio	22.53
4	Payback Period	PBP= Capital costs ÷ Annual Net Benefits	Years	7.25

Year No.	Year	Costs			Benefits				Net (Cost)/ Benefits H=G-C	PV @ % 22.32	
		Capital Cost	O&M Cost	Total Cost	Cost saving to society	Direct Revenue	Cost Savings/ Reduction	Total Benefits		Discount Factor	PV
		A	B	C=A+B	D	E	F	G=D+E+F		$I=(1.22.32)^n$	J=HxI
0	2023-2024	300.00	1.50	302				-	(302)	1	(302)
1	2024-2025		1.74	2	66.00			66	64	0.82	53
2	2025-2026		2.02	2	76.64			77	75	0.67	50
3	2026-2027		2.35	2	88.99			89	87	0.55	47
4	2027-2028		2.73	3	103.34			103	101	0.45	45
5	2028-2029		3.17	3	120.00			120	117	0.37	43
6	2029-2030		3.68	4	139.34			139	136	0.30	41
7	2030-2031		4.27	4	161.80			162	158	0.24	38
8	2031-2032		4.96	5	187.89			188	183	0.20	37
9	2032-2033		5.76	6	218.17			218	212	0.16	35
10	2033-2034		6.69	7	253.34			253	247	0.13	33
11	2034-2035		7.76	8	294.18			294	286	0.11	31
12	2035-2036		9.02	9	341.60			342	333	0.09	30
13	2036-2037		10.47	10	396.67			397	386	0.07	28
14	2037-2038		12.16	12	460.61			461	448	0.06	27
15	2038-2039		14.12	14	534.86			535	521	0.05	25
16	2039-2040		16.39	16	621.08			621	605	0.04	24
17	2040-2041		19.03	19	721.20			721	702	0.03	23
18	2041-2042		22.10	22	837.46			837	815	0.03	22
19	2042-2043		25.66	26	972.46			972	947	0.02	21
20	2043-2044		29.80	30	1,129.22			1,129	1,099	0.02	20
21	2044-2045		34.60	35	1,311.25			1,311	1,277	0.01	19
22	2045-2046		40.18	40	1,522.62			1,523	1,482	0.01	18
23	2046-2047		46.66	47	1,768.07			1,768	1,721	0.01	17
24	2047-2048		54.18	54	2,053.08			2,053	1,999	0.01	16
25	2048-2049		62.92	63	2,384.03			2,384	2,321	0.01	15
Total		300	444	744	16,764	-	-	16,764	16,020		453

### Assumptions for Financial Appraisal

#### **Costs:**

- 1 Capital cost of the Project incorporates both the initial one-off costs such as engineering cost, project construction cost, development cost, procurement cost of equipment, machinery & other assets, utility set up cost, and any other costs to be incurred during the construction period.
- 2 Operating and maintenance (O&M) cost shall be incurred during operational phases of the project. Operation and maintenance cost includes electricity and other utility cost, administrative expenses, maintenance cost, payroll cost and other overheads etc.
- 3 Inflation rate is taken for O&M costs @ 16.12%, which is average inflation of last 5 years.

#### **Benefits:**

- 4 Benefits include the potential saving in the opportunity cost of vehicles. Project would provide effective protection to the vehicles against the solar radiation and ultraviolet rays, rain, hail, wind, and dust, thereby slowing down the deterioration of vehicles and reducing the cost of maintenance.
- 5 Inflation rate is applied at cost savings @ 16.12%, which is average inflation of last 5 years.
- 6 Residual Value had been taken as nil.

#### **Estimated Project Life:**

- 7 The life estimates of assets are compiled after review of design criteria for MC assets and international best practices. The Life Estimates taken in IDAMP are as follow:

Asset	Useful Life
Buildings/ Civil Works	25
Tubewell Pumps	15
Disposal Pumps	15
OHR	50
Water Pipelines	25
Rising Mains/ Transmission Mains	25
Sewerage/ RCC Pipelines	25
Vehicles	10
Machinery & Equipment	15

#### **Macro-economic Indicators**

- 8 The discount rate used for computation of present value of cash flows is taken @ 22.32 % per anum, which is KIBOR prescribed by State Bank of Pakistan as at April 11, 2023.
- 9 Exchange rate is taken as 284.65 PKR/ USD as per Exchange Rates for Mark to Market Revaluation provided at State Bank of Pakistan at April 07, 2023.

Project ID: 03-15-01-01-02

Project Description : Solarization of Tubewells and Water Supply System

Sr. No.	Description	Unit	Value	Remarks
1	Net Present Value (NPV)	Rs.	241	NPV=PV of benefits @ 22.32% - PV of costs @ 22.32%
2	Financial Internal Rate of Return (FIRR)	%	37%	FIRR
3	Benefit Cost Ratio (BCR)	Ratio	22.53	BCR= Total Benefits ÷ Total Costs
4	Payback Period	Years	7.25	PBP= Capital costs ÷ Annual Net Benefits

Year No.	Year	Costs			Benefits				Net (Cost)/ Benefits H=G-C	PV @ % 22.32	
		Capital Cost	O&M Cost	Total Cost	Cost saving to society	Direct Revenue	Cost Savings/ Reduction	Total Benefits		Discount Factor	PV
		A	B	C=A+B	D	E	F	G=D+E+F		I=(1.22.32) <sup>n</sup>	J=HxI
0	2023-2024	160.00	0.80	161				-	(161)	1	(161)
1	2024-2025		0.93	1	35.20			35	34	0.82	28
2	2025-2026		1.08	1	40.87			41	40	0.67	27
3	2026-2027		1.25	1	47.46			47	46	0.55	25
4	2027-2028		1.45	1	55.11			55	54	0.45	24
5	2028-2029		1.69	2	64.00			64	62	0.37	23
6	2029-2030		1.96	2	74.32			74	72	0.30	22
7	2030-2031		2.28	2	86.29			86	84	0.24	21
8	2031-2032		2.64	3	100.21			100	98	0.20	19
9	2032-2033		3.07	3	116.36			116	113	0.16	18
10	2033-2034		3.57	4	135.12			135	132	0.13	18
11	2034-2035		4.14	4	156.90			157	153	0.11	17
12	2035-2036		4.81	5	182.19			182	177	0.09	16
13	2036-2037		5.58	6	211.56			212	206	0.07	15
14	2037-2038		6.48	6	245.66			246	239	0.06	14
15	2038-2039		7.53	8	285.26			285	278	0.05	14
16	2039-2040		8.74	9	331.24			331	323	0.04	13
17	2040-2041		10.15	10	384.64			385	374	0.03	12
18	2041-2042		11.79	12	446.64			447	435	0.03	12
19	2042-2043		13.69	14	518.64			519	505	0.02	11
20	2043-2044		15.89	16	602.25			602	586	0.02	10
21	2044-2045		18.46	18	699.33			699	681	0.01	10
22	2045-2046		21.43	21	812.06			812	791	0.01	9
23	2046-2047		24.89	25	942.97			943	918	0.01	9
24	2047-2048		28.90	29	1,094.98			1,095	1,066	0.01	8
25	2048-2049		33.56	34	1,271.49			1,271	1,238	0.01	8
Total		160	237	397	8,941	-	-	8,941	8,544		241

### Assumptions for Financial Appraisal

#### **Costs:**

- 1 Capital cost of the Project incorporates both the initial one-off costs such as engineering cost, project construction cost, development cost, procurement cost of equipment, machinery & other assets, utility set up cost, and any other costs to be incurred during the construction period.
- 2 Operating and maintenance (O&M) cost shall be incurred during operational phases of the project. Operation and maintenance cost includes electricity and other utility cost, administrative expenses, maintenance cost, payroll cost and other overheads etc.
- 3 Inflation rate is taken for O&M costs @ 16.12%, which is average inflation of last 5 years.

#### **Benefits:**

- 4 Benefits include the potential saving in the opportunity cost of vehicles. Project would provide effective protection to the vehicles against the solar radiation and ultraviolet rays, rain, hail, wind, and dust, thereby slowing down the deterioration of vehicles and reducing the cost of maintenance.
- 5 Inflation rate is applied at cost savings @ 16.12%, which is average inflation of last 5 years.
- 6 Residual Value had been taken as nil.

#### **Estimated Project Life:**

- 7 The life estimates of assets are compiled after review of design criteria for MC assets and international best practices. The Life Estimates taken in IDAMP are as follow:

Asset	Useful Life
Buildings/ Civil Works	25
Tubewell Pumps	15
Disposal Pumps	15
OHR	50
Water Pipelines	25
Rising Mains/ Transmission Mains	25
Sewerage/ RCC Pipelines	25
Vehicles	10
Machinery & Equipment	15

#### **Macro-economic Indicators**

- 8 The discount rate used for computation of present value of cash flows is taken @ 22.32 % per anum, which is KIBOR prescribed by State Bank of Pakistan as at April 11, 2023.
- 9 Exchange rate is taken as 284.65 PKR/ USD as per Exchange Rates for Mark to Market Revaluation provided at State Bank of Pakistan at April 07, 2023.



## Annexure F. Stakeholder's Consultative Session



Consultative Session - Vehari.pdf

2022-2023



Consultative  
Session\_Vehari.pdf

2023-2024

**Annexure G. Cost Estimates for Operation & Maintenance of water supply systems for the budgeted year (2023-2024)**

Summary of Cost		
Sub Head No	Sub Head	Total Cost (Rs)
1	Man power (Annex-A-1)	51,728,706
2	Electricity charges (Annex-B-1)	19,819,308
3	Repairs & Replacements (Annex-C-1)	4,275,000
4	Supply items (Annex-D-1)	3,321,900
4	POL	648,000
5	Contingencies	3,335,000
	<b>Grand Total</b>	<b>83,127,914</b>
	<b>Grand Total</b>	<b>83,127,914</b>
	<b>Say (million Rs)</b>	<b>831.28</b>

**Annexure H. Cost Estimates for Operation & Maintenance of sewerage systems for the budgeted year  
(2023-2024)**

Summary of Cost Sewerage		
Sub Head No	Sub Head	Total Cost
1	Man power (Annex-A-2)	11,819,800.00
2	Electricity charges (Annex-B-2)	14,701,198.20
3	Repairs & Replacements (Annex-C-2)	6,222,000.00
4	Supply items (Annex-D-2)	675,600.00
	POL	487,500.00
	Contengencies	100,000.00
	<b>Grand Total</b>	<b>34,006,098.20</b>
	<b>Grand Total</b>	<b>34,006,098.20</b>
	<b>Say (million Rs)</b>	<b>34.01</b>

**Annexure I. Cost Estimates for Operation & Maintenance of solid waste management for the budgeted year (2023-2024)**

Summary of Cost		
Sub Head No	Sub Head	Total Cost
1	Man power (Annex-A-3)	161,000,143
2	Energy Charges (Annex-B-3)	-
3	Repairs & Replacements (Annex-C-3)	5,110,000
4	Supply items (Annex-3)	-
	POL	10,816,470
	Contingencies	4,800,000
	<b>Grand Total</b>	<b>181,726,613</b>
	<b>Grand Total</b>	<b>181,726,613</b>
	<b>Say (million Rs)</b>	<b>181.73</b>